 


|                                                                                  |                                                                                                                                                  |
|----------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------|
|  | Specialist cleaning. Allow to remove varnish/staining to lath and plaster. associated timber framing/beams and carved angels.                    |
|  | Decorated timber beams, braces and angel corbels to be cleans as part of specialist conservation works - see M60/800 and M60/900.                |
|  | Crack assumed to be stable. Allow to fill and touch up as part of specialist repair works.                                                       |
|  | Crack assumed to be unstable. Inspect further. Provisionally allow to secure panel back to laths above as part of specialist conservation works. |
|  | New plasterboard ceiling to U/S ceiling joists - NBS K10/245                                                                                     |
|  | New lath and plaster ceiling to U/S ceiling joists - NBS M20/310 & 625                                                                           |
|  | Existing cornice to be retained insitu. New partitions are to be formed around cornice. Cornice is not to be cut through                         |
|  | Patch repair - Refer to specific note on drawing for defect and repair.                                                                          |
|  | New ceiling hatch - NBS L20/634                                                                                                                  |

NOTES

The existing building measured survey has been undertaken by Salford Archaeology and all reference to this information is referenced directly from the associated drawings.

 Specialist conservation works undertaken by Hirst.

 Specialist conservation works refer to  
RTH-DIA-XX-XX-SH-A-6504-SpecialistCleaningSchedule

Note: Specialist ceiling works to Zodiac ceiling covered in Specialist Cleaning and Decorations Schedule.

1. Any dwg format drawing is to be read in conjunction with and at the scale of the accompanying pdf.
2. Where colours other than black or grey are used, the drawing must be plotted in colour.
3. For status "C" (Construction) drawings all dimensions are to be checked on site by the contractor, scaling is for Local Authority purposes only.
4. All information indicated, all dimensions are in millimeters.
5. All information on this drawing is to be read in conjunction with the relevant Donald Insall Associates specification and trade contractors' drawings and information by specialists.
6. In the event of any discrepancy, please contact us immediately.
7. This drawing may contain survey information by others and is to be used solely for the purposes for which it was issued.
8. These are uncontrolled documents issued for information purposes only. If you require any queries regarding the drawings, please contact D/A immediately.
9. Please note D/A cannot be held responsible for any errors arising from changes made to an uncontrolled dwg file.

| Status codes             |                                                           |
|--------------------------|-----------------------------------------------------------|
| <b>S0</b>                | Work in Progress                                          |
| <b>S1</b>                | Suitable for Co-ordination                                |
| <b>S2</b>                | Suitable for Information                                  |
| <b>S3</b>                | Suitable for Review & Comment                             |
| <b>S4</b>                | Suitable for Stage Approval                               |
| <b>D1</b>                | Suitable for Costing                                      |
| <b>D2</b>                | Suitable for Tender                                       |
| <b>D3</b>                | Suitable for Contractor Design                            |
| <b>D4</b>                | Suitable for Manufacture/Procurement                      |
| <b>A1,A2,A3, An etc.</b> | Approved and accepted as stage complete                   |
| <b>B1,B2,B3, Bn etc.</b> | Partially signed off: with minor comments from the Client |
| <b>CR</b>                | Construction Record                                       |

Hatches to Kitchen And Store set out on FF MEP RCP 2583.  
Hatches to ceilings of Kitchen F6c and Store F6d are required to be metal faced doors having a 60 minute integrity and insulation rating.

(M20/555 & M20/597)  
Removal of redundant MEP surface mounted services. Localised repair to existing painted lath and plaster ceiling. Decorating Item.  
Plant on timber to be removed and plaster repaired.

(M20/598)  
Crack line corresponds to stone slab joint above. Assume plaster finish to soffit - allow to rake out and fill.

(M20/555 & M20/597)  
Removal of redundant MEP surface mounted services. Localised repair to existing painted plaster to underside of stone landing. Decorating Item.

New cornice to new corridor. F3h to match existing.  
Timber downstand beams supported on decorative corbels. Carefully brush back loose and flaking paint. Re-paint. See Decorations Schedule.  
Access hatch to service high level cistern located on centre line of middle urinal, and set between ceiling lights.

No need to remove existing lath and plaster prior to installation of counter batten and Gyproc FireLine (2no. 12.5mm layers) to underside of existing lath and plaster ceiling.

(M20/555 & M20/597)  
Removal of redundant MEP surface mounted services.

F3a: Carry out localised repairs and stabilisation of cornice as identified in report prepared by Ornate Interiors.

(M20/555 & M20/597)  
Removal of redundant MEP surface mounted services. Localised repair to existing painted lath and plaster.

Existing vertical clear finished timber riser retained in situ.

(M20/310)  
Removal of redundant vent grille to lath and plaster ceiling, allow for local patch repair.

(M20/598)  
Cracks across lath and plaster ceiling. Local repair.

New access hatch

Carefully take down existing sections of cornice and set aside for reinstatement in lift lobby F6h.  
Carefully cut clean, secure and stable line through existing lath and plaster ceiling and cornice to allow insertion of lift shaft walls.  
Salvaged section of cornice from lift shaft to new lift lobby F6h to match existing. Carry out associated localised making good of ceiling in new lath and plaster adjacent to cornice where lost as a result of lift installation. Carry out localised repairs of cornice as identified in report prepared by Ornate Interiors.  
(M20/555 & M20/597)  
F6h - Removal of redundant MEP surface mounted services. Localised repair to existing painted lath and plaster ceiling. Decorating Item.

01 3771  
New lift shaft

(M20/555 & M20/597)  
Removal of redundant MEP surface mounted services.

Where floor joists run perpendicular and a pattress cannot be installed. Ornate Plaster to secure existing cornice with extra long screws and washers into the existing ceiling timbers.

Existing cornices to be retained and protected in-situ. Carefully cut along line of existing cornice and take down unstable lath and plaster ceiling. Offer additional screw fixings to consolidate ceiling joists and counter joists. Reinstall new plasterboard ceiling to U/S ceiling joists.

New cornice to match existing profile to reinstate original room line following removal of lift shaft.

Central section of plaster loose. Allow for consolidation with washer fixings from below. Redecoration required following works.

(M20/555 & M20/597)  
F2b - Removal of redundant MEP surface mounted services. Localised repair to existing painted lath and plaster ceiling. Decorating Item.

F2a and F2b: Carry out localised repairs and stabilisation of cornice as identified in report prepared by Ornate Interiors.

See drawing 2587 for setting out of hatches.

(M20/598)  
Cracks across lath & plaster ceiling. Local repairs.

Refer to dwg 1584 for Great Hall reflected ceiling plan

0 1 2  
Scale 1:100