
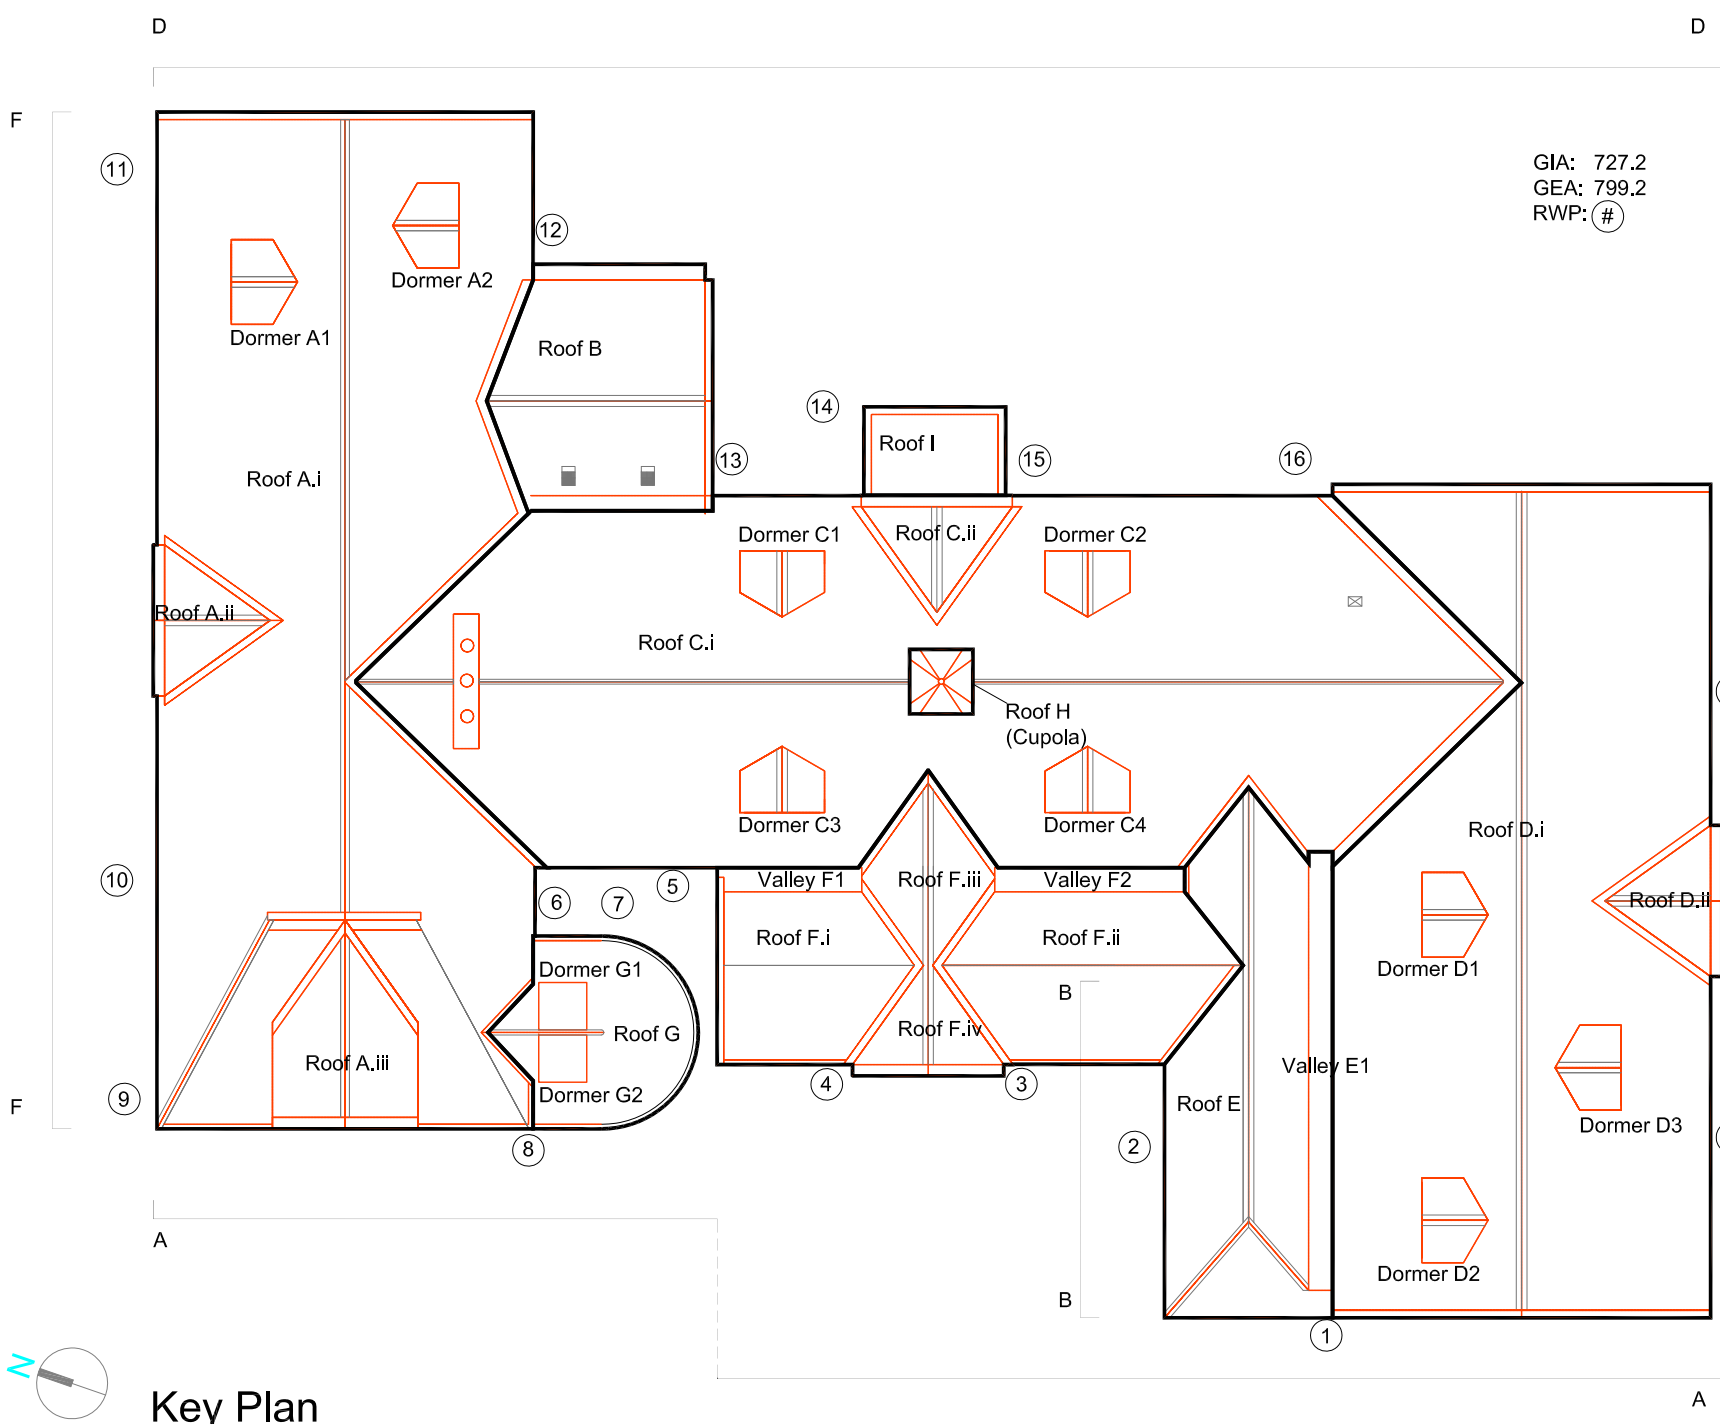


- notes:
- DO NOT SCALE FROM THIS DRAWING - USE FIGURED DIMENSIONS ONLY.
 - TO BE READ IN CONJUNCTION WITH ALL OTHER CONSULTANTS / SPECIALISTS DRAWINGS. REPORT ANY DISCREPANCIES BEFORE AFFECTED WORK COMMENCES.
 - ALL SETTING OUT DIMENSIONS TO BE CHECKED ON SITE BY CONTRACTOR BEFORE WORK COMMENCES.

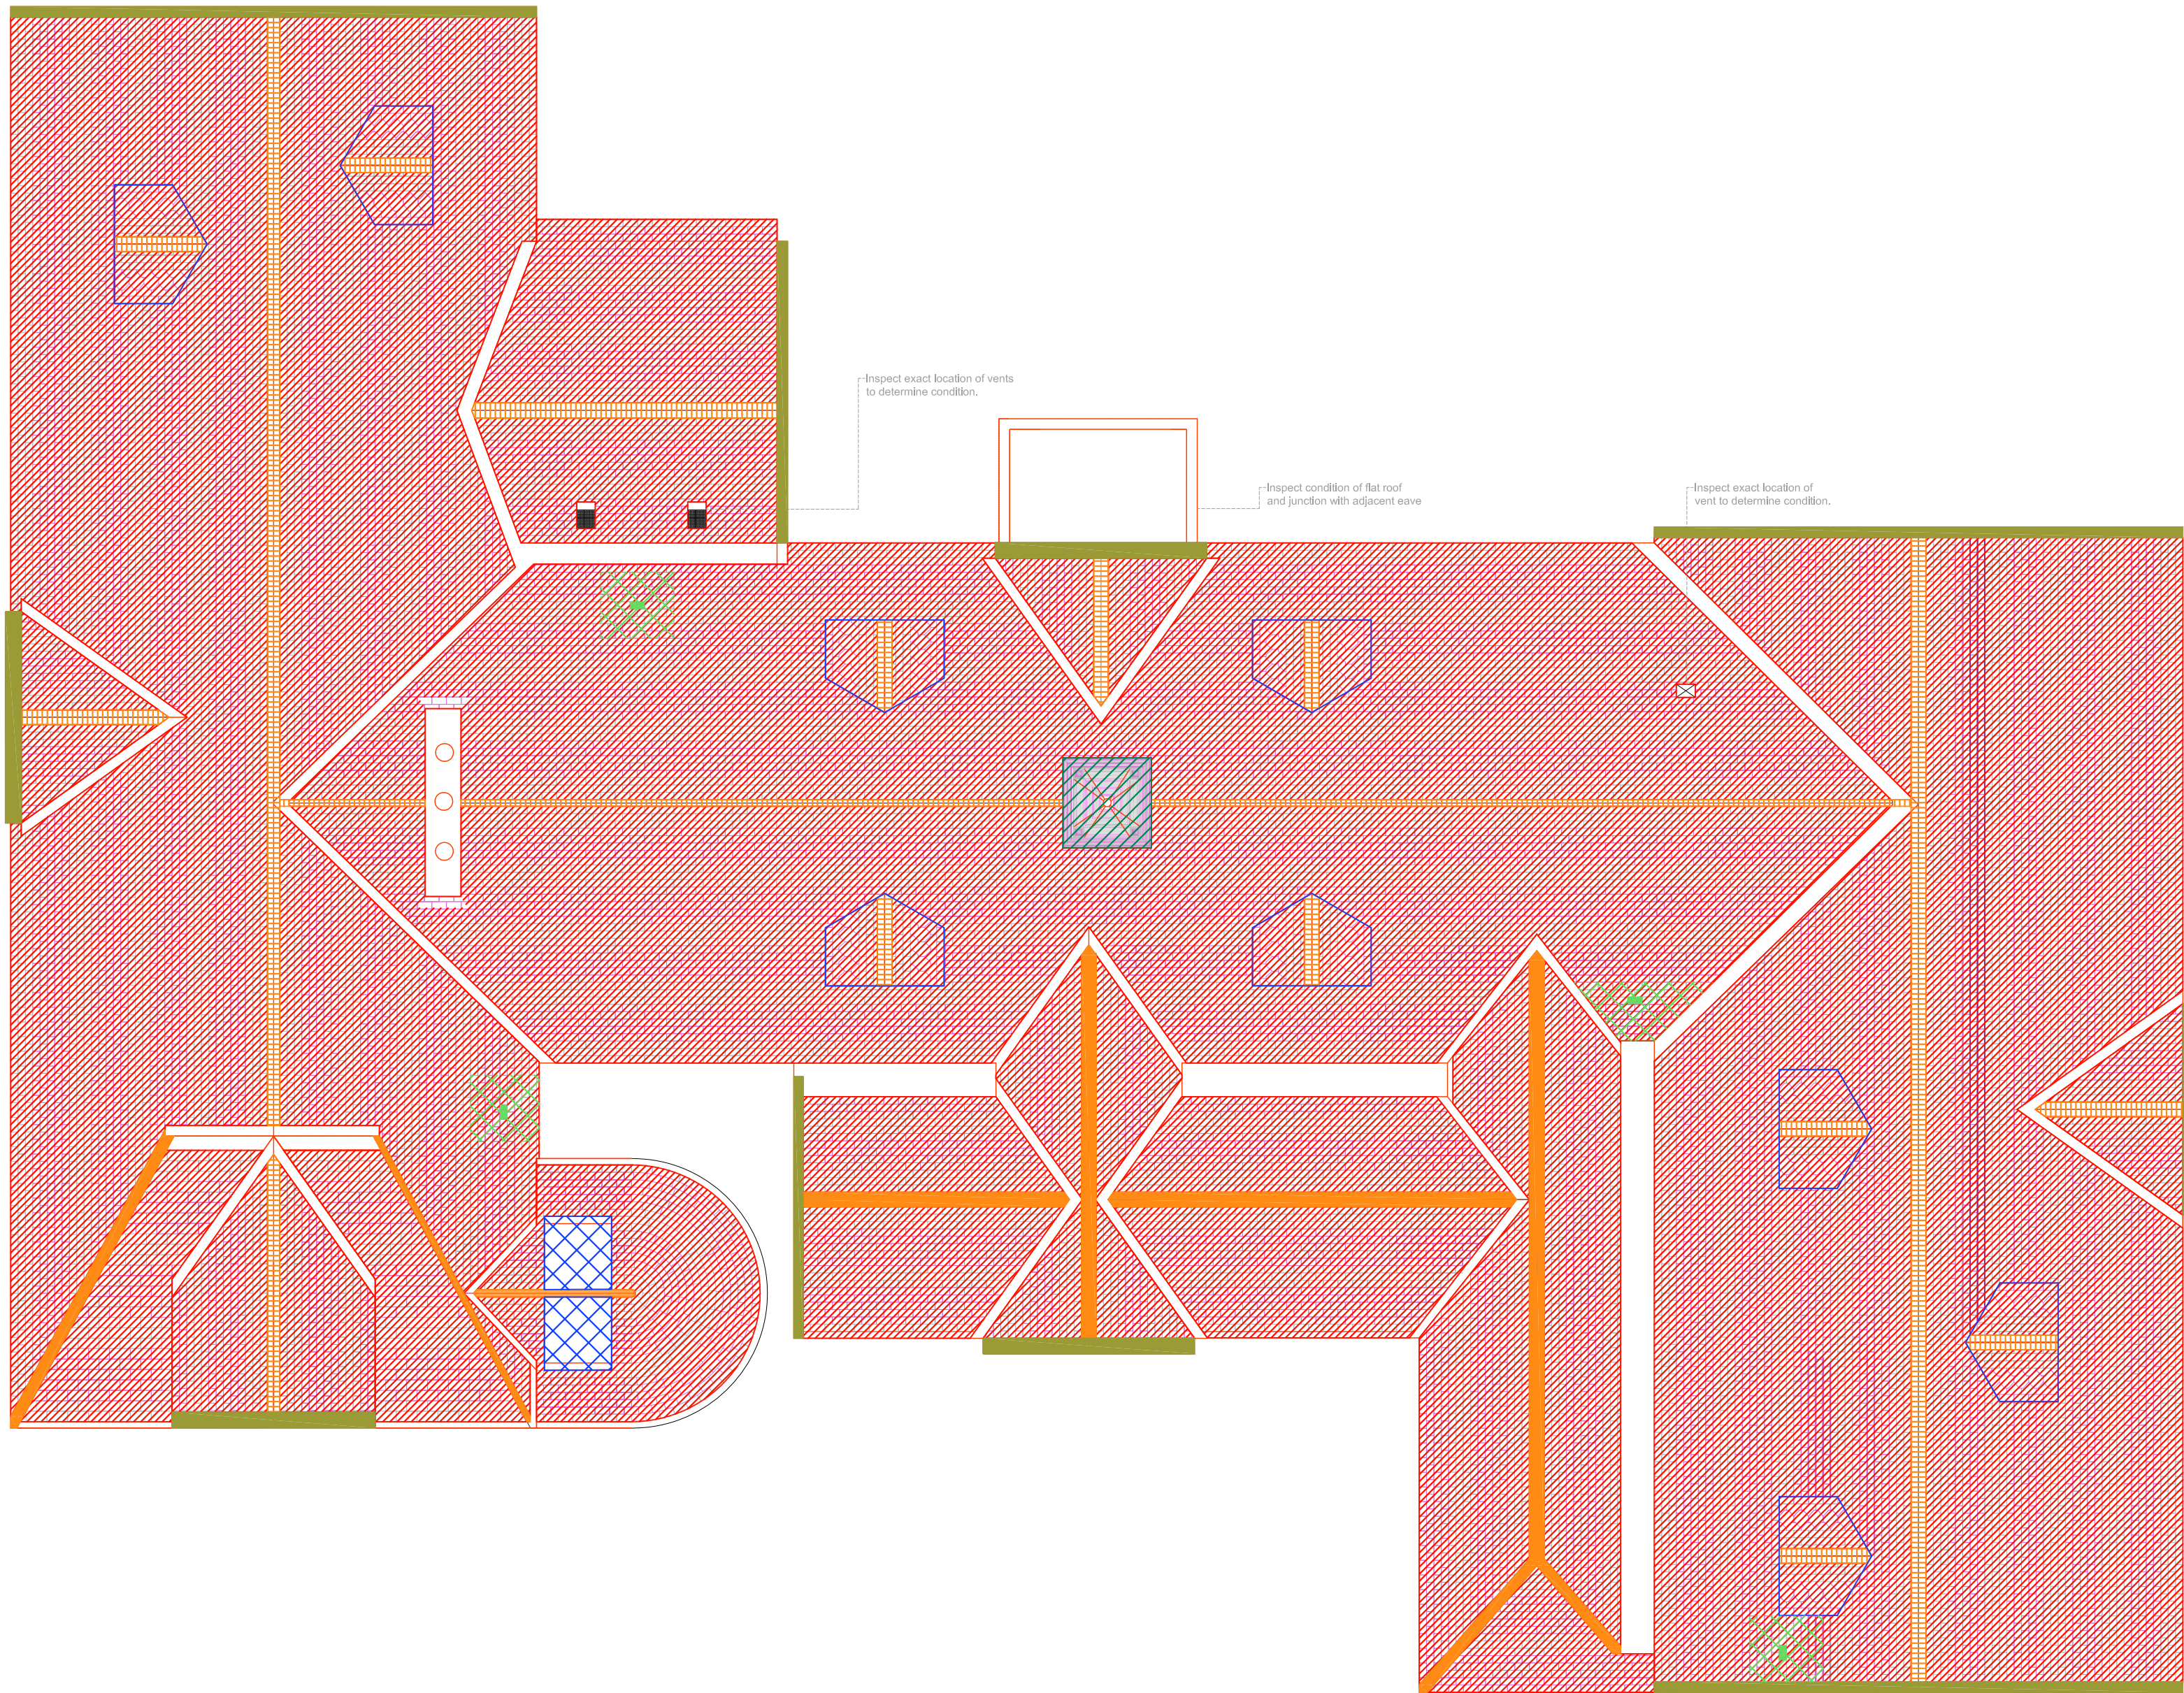

- Key:
- Roof Slate Restoration: 762sqm / 8220sqft
Strip existing slate roof coverings and set aside salvaged slates for re-use. Strip existing battens, felt, lead-lined gutters and gutter structure then safely dispose of any defective material. Insulate, re-felt, batten, counter batten existing roof slope.
As per detail A-A in drawing SMP-SEV-XX-XX-DR-A-03100 (Typical Roof Build-Up)
 - Dormer Window: 09 no.
Splice in new timbers where appropriate. Access to be provided for detailed inspection and methodology agreed. Carefully sand down and repaint in appropriate materials as per the specification. Roofing section per detail F-F in drawing SMP-SEV-XX-XX-DR-A-03105 (Typical Dormer Window)
 - Cupola: 01 no.
Splice in new timbers where appropriate. Access to be provided for detailed inspection and methodology agreed. Carefully sand down and repaint in appropriate materials as per the specification. Cupola roofing is as per the building's other slate roof eaves, but is at a steeper gradient.
 - Ridge Tiles: 105 Lm.
Ridge tiles to be removed and set aside with salvaged tiles for re-use.
Replace damaged tiles as per the existing style. Ridge ventilation provided with new linear vent.
Ridge venting per detail F-F in drawing SMP-SEV-XX-XX-DR-A-03105 (Typical Dormer Window)
 - Ridge Tiles: 50 Lm
Ridge tiles to be removed and set aside with salvaged tiles for re-use.
Replace damaged tiles like-for-like.
 - Stone Capping:
Take up and re-bed existing stone capping pieces and re-point. Ensure appropriate stiff mortar (NHL 3.5 Lime Mortar) applied to capping sections. Sample cappings to be provided to ensure secure structure.
 - Non-Gabled Dormer Windows:
'Shed Dormer' windows with flat felt topping.
Splice in new timbers where appropriate. Access to be provided for detailed inspection and methodology agreed. Carefully sand down and repaint in appropriate materials as per the specification. Re-felt top cover if deemed necessary after inspection.
 - Slate Tiles:
Grey and Grey-Purple slate tiles.
To be relocated in the same location/pattern as existing.
 - Bat Slate: [Dashed Hatch Approx. Location, Solid Hatch Exact Location]
Integrated Bat access slate: metal vent to allow access for bats into roof void, with sufficient gap cut into roof structure underneath. Fitted within a hole cut to slate which is placed over the vent to reduce visual impact. 1no. Bat Slate located in area of observed bat emergence (west wing of the building, facing north, adjacent to Dormer D2) and then 3no. supplementary 'enhancement slates' along remaining wings (north, east, south).

REVISIONS	P02	TENDER_ISSUE	07/11/23	SM	SGI
	P01	FIRST_ISSUE	26/09/23	SM	SGI
			DATE: DRAWN: CHECK		

CLIENT	Rochdale Borough Council				
PROJECT	SMP - St Mary's CE Primary School				
TITLE	Roof - Fabric Repair Plan				
NUMBER	SMP-SEV-XX-R1-DR-A-02012				
REVISION	P01				
STATUS	Planning				
SCALE	1:50 @A1				
DATE	20/10/23				
DRAWN BY	SM				
CHECKED BY	SGI				

seven.

Studios at:
Unit 1.3, Wask Mill, 51 Bengal Street,
MANCHESTER, M4 6LN
t: 0161 236 5655
Clarendon House, Victoria Avenue,
HARROGATE, HG1 1DY
t: 01423 709 807
LONDON, EC1N 8SS
t: 0203 036 0691