

- notes:
- DO NOT SCALE FROM THIS DRAWING - USE FIGURED DIMENSIONS ONLY.
 - TO BE READ IN CONJUNCTION WITH ALL OTHER CONSULTANTS / SPECIALISTS DRAWINGS. REPORT ANY DISCREPANCIES BEFORE AFFECTED WORK COMMENCES.
 - ALL SETTING OUT DIMENSIONS TO BE CHECKED ON SITE BY CONTRACTOR BEFORE WORK COMMENCES.



Multiple damaged Ridge Tiles



Ridge Tiles damaged near Cupola

Wooden structural arches between 2no. tiled sections

Significant Ridge tile damage in this area




C3 Dormer wooden structure damaged; requires further inspection




Cupola wooden structure undamaged; requires further inspection



C4 Dormer wooden structure damaged; will require replacement sections

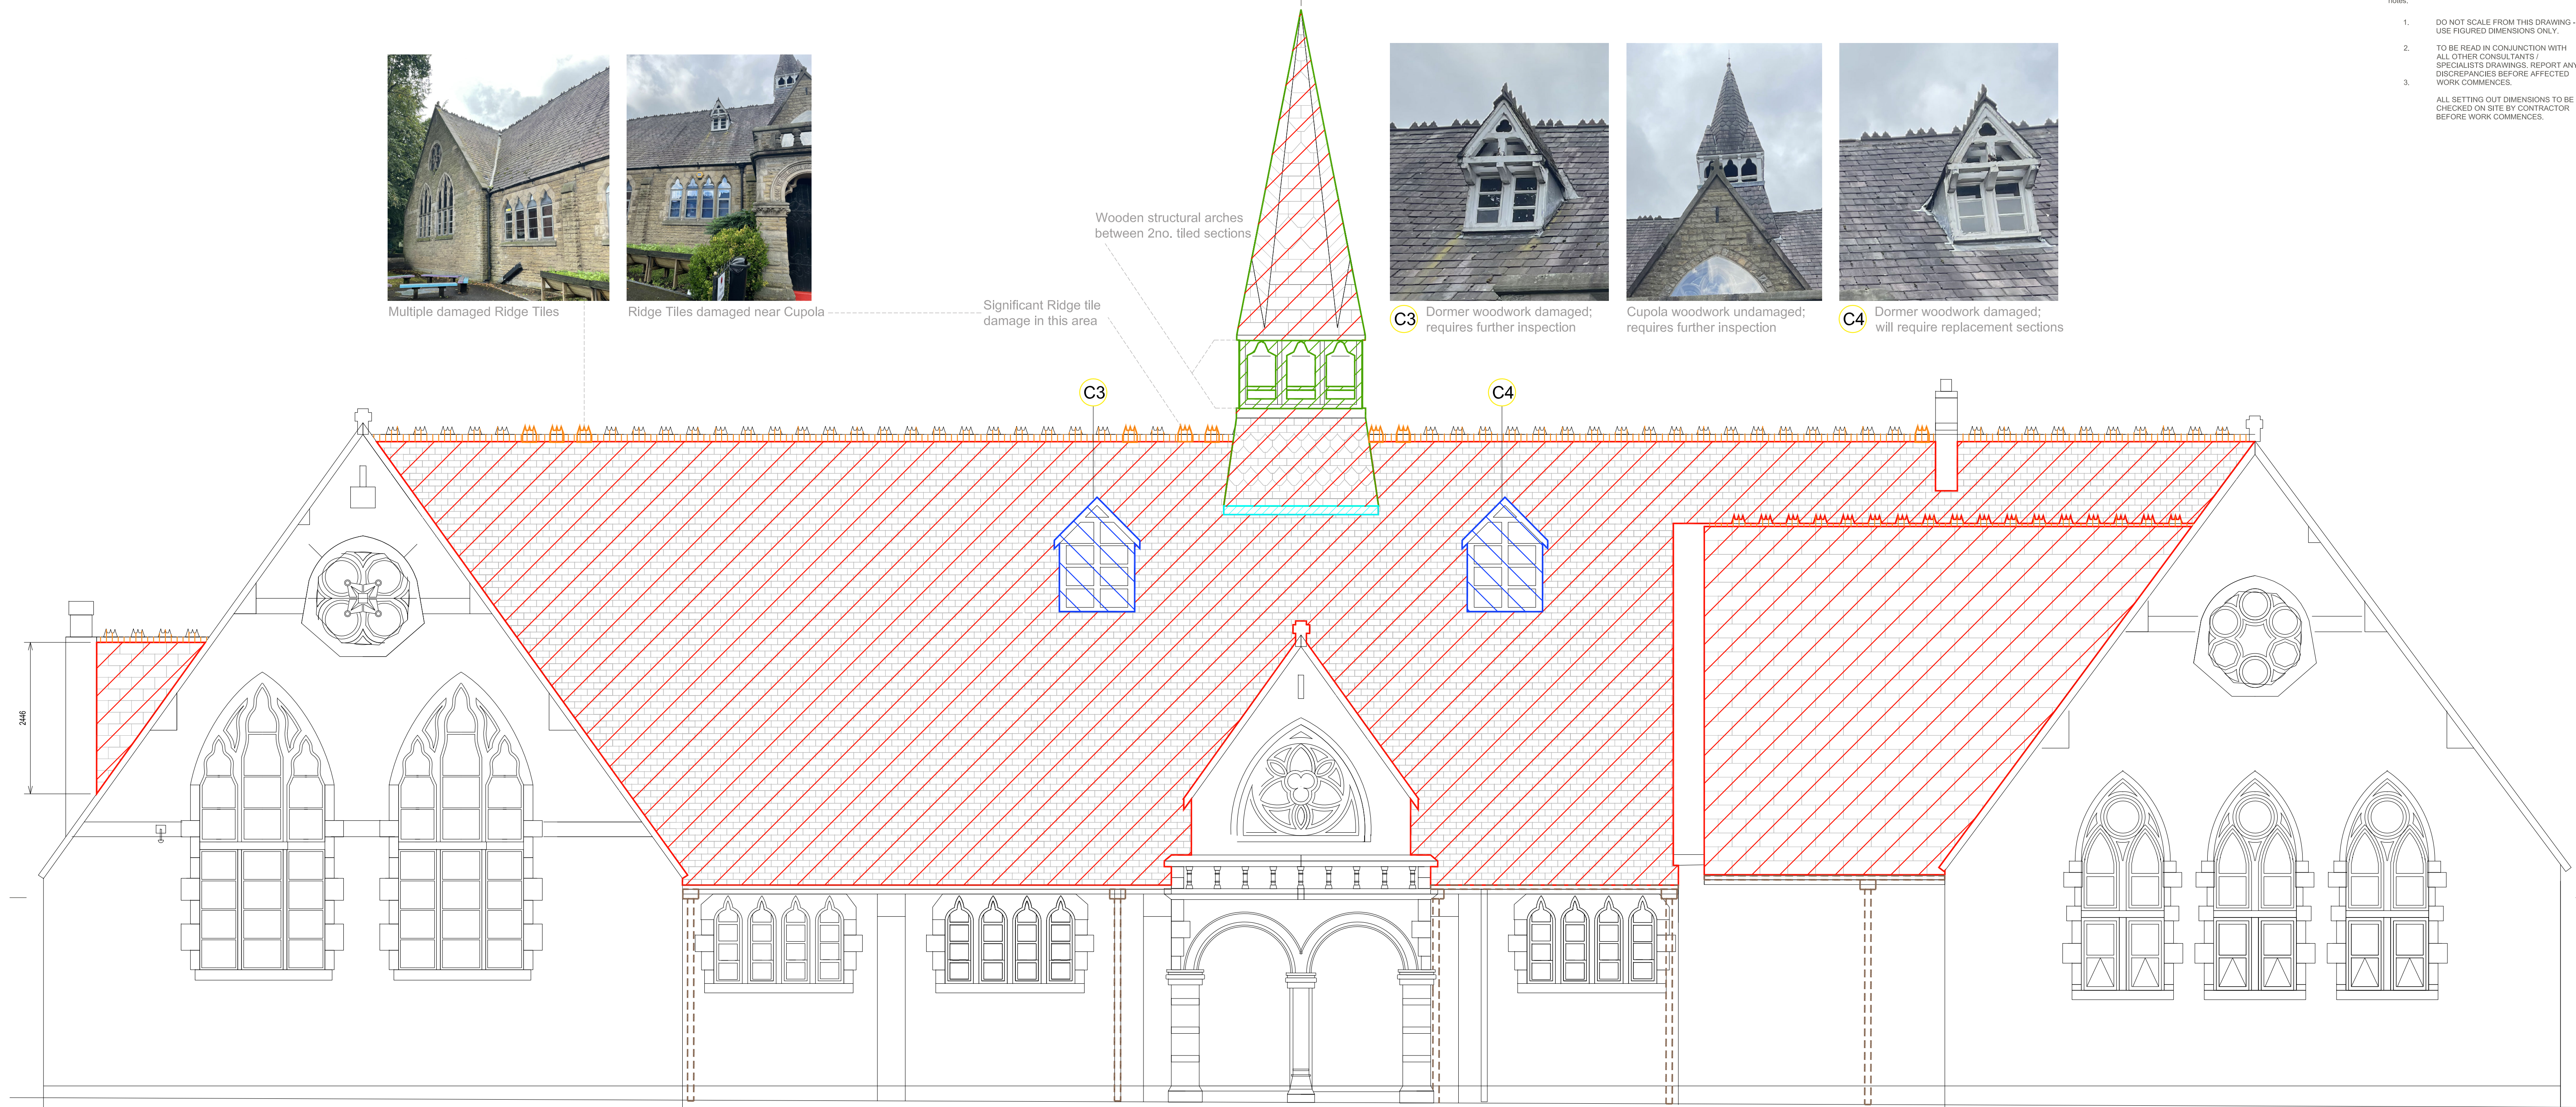

Elevation DD

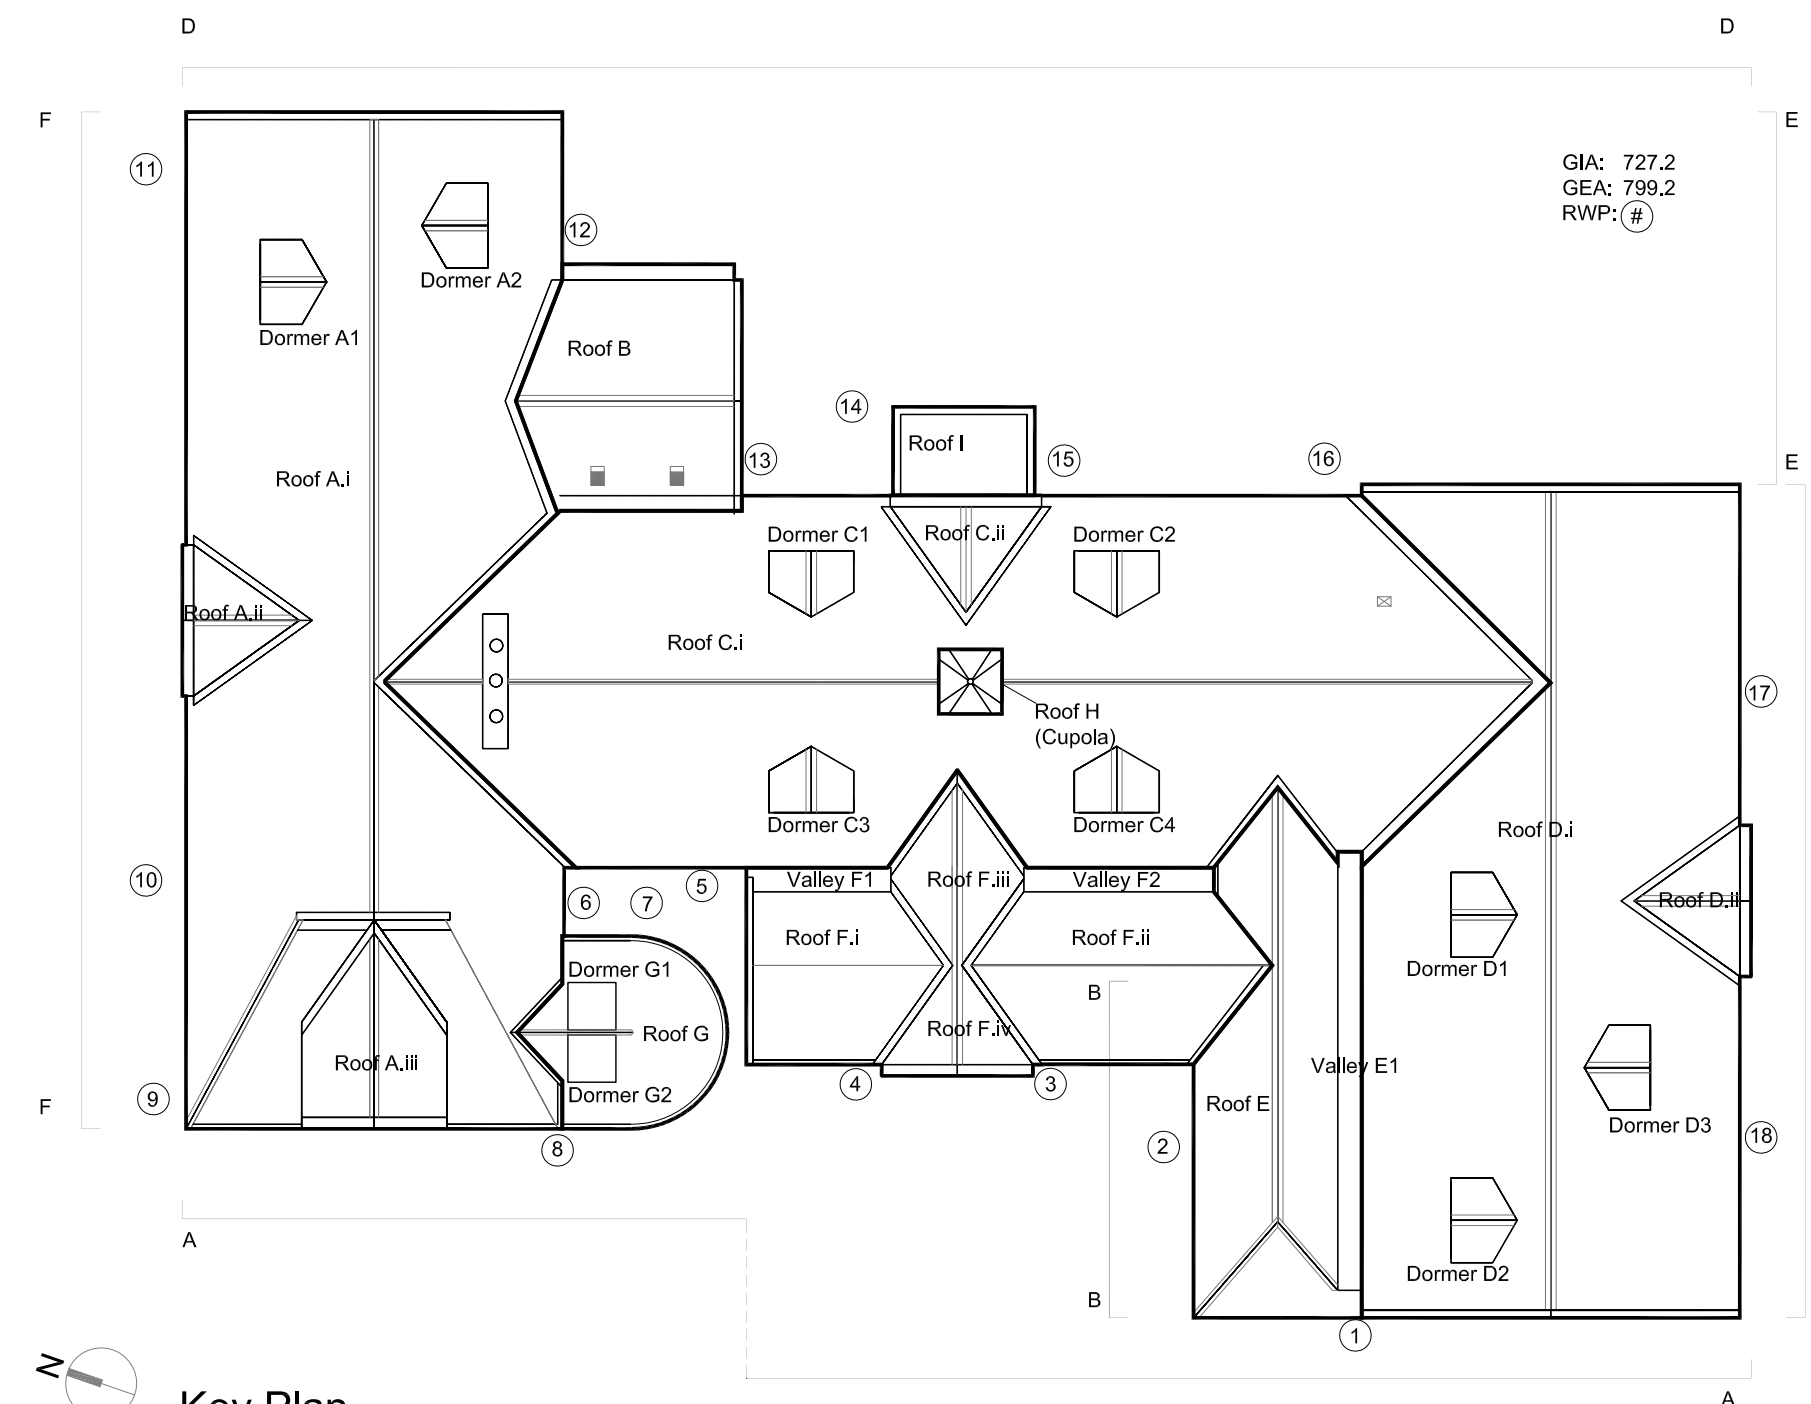

Key:

- Roof Slate Restoration: 762sqm / 8220sqft
Strip existing slate roof coverings and set aside salvaged slates for re-use. Strip existing battens, felt, lead-lined gutters and gutter structure then safely dispose of any defective material. Insulate, re-felt, battens, counter battens existing roof slope.
As per detail A-A in drawing SMP-SEV-XX-XX-DR-A-03100 (Typical Roof Build-Up)
- Dormer Window: 09 no.
Splice in new timbers where appropriate. Access to be provided for detailed inspection and methodology agreed. Carefully sand down and repaint in appropriate materials as per the specification. Roofing section per detail F-F in drawing SMP-SEV-XX-XX-DR-A-03105 (Typical Dormer Window)
- Cupola: 01 no.
Splice in new timbers where appropriate. Access to be provided for detailed inspection and methodology agreed. Carefully sand down and repaint in appropriate materials as per the specification. Cupola roofing is as per the building's other slate roof eaves, but is at a steeper gradient.
- Rainwater Goods: 18 no.
Down-pipe to be removed and replaced with cast-iron rainwater goods allowing for increased diameter (6 inch) to mitigate increased rainfall.
Guttering per detail B-B in drawing SMP-SEV-XX-XX-DR-A-03100 (Typical External Gutter)
- Lead Flashing: 75 Lm
Replace with new lead flashing where appropriate.
Access to be provided for detailed inspection and methodology agreed.
- Ridge Tiles: 105 Lm
Ridge tiles to be removed and set aside with salvaged tiles for re-use.
Replace damaged tiles as per the existing style. Ridge ventilation provided with new linear vent.
Ridge venting per detail F-F in drawing SMP-SEV-XX-XX-DR-A-03105 (Typical Dormer Window)
- Ridge Tiles: 50 Lm
Ridge tiles to be removed and set aside with salvaged tiles for re-use.
Replace damaged tiles like-for-like.

CLIENT	Rochdale Borough Council
PROJECT	SMP - St Mary's CE Primary School
TITLE	Elevation DD - Demolition & Repairs
NUMBER	SMP-SEV-XX-XX-DR-A-03013
REVISION	P01
STATUS	Planning
SCALE	1:50 @A1
DATE	22/09/23
DRAWN BY	SM
CHECKED BY	SGI

seven.

SEVENARCHITECTURE.CO.UK

Studios at:
Unit 1.3, Wauk Mill, 51 Bengal Street,
MANCHESTER, M4 6LN
t: 0161 236 5655

Clarendon House, Victoria Avenue,
HARROGATE, HG1 1DY
t: 01423 709 807

LONDON, EC1N 8SS
t: 0203 036 0691

REVISIONS | P01 FIRST_ISSUE

22/09/23 SM SGI
DATE: DRAWN: CHECK