




Specification/Method statement for arched windows – Syke Farm, Littleborough

Specification	
Material	Sapele (also known as African mahogany); 14mm slimlite sealed glazing units
Fixtures and fittings	Brass hinges; brass flush bolts; brass window stays; brass window latch
Finish	3 coats of Natural – 429 Extra Osmo UV Protection Oil

Construction
- Window frames to be constructed using traditional through mortice and tenon joinery. - Window set will consist of a fixed arched fanlight over 2 opening sashes, with a flying mullion, both of which will open outwards. - Window sashes will be side hung and open outwards. - Glazing will be done from the outside. - Weatherproofing will be done using clip in stormguard elite 11 joinery seal which will be applied inside the rebate of the window casing. - Sealed glazing units will be bedded using black butyl glazing tape, and sealed using Hogson heritage putty to fill the void between the glazing unit and the frame. - Timber beading will be applied internally using black butyl glazing tape and pins.

Installation
- We will remove the existing windows with care, being careful not to cause any damage to the existing stonework. - We will NOT be using expanding foam to fit the new windows out of respect for the historic fabric of the building. - We will use screws to fix the new timber windows into the openings. - Any potential gaps will be kept to a minimum and will be filled with cotton caulking wiped with linseed oil. - The external of the window frames will be pointed around using trowel mastic.

Additional Information

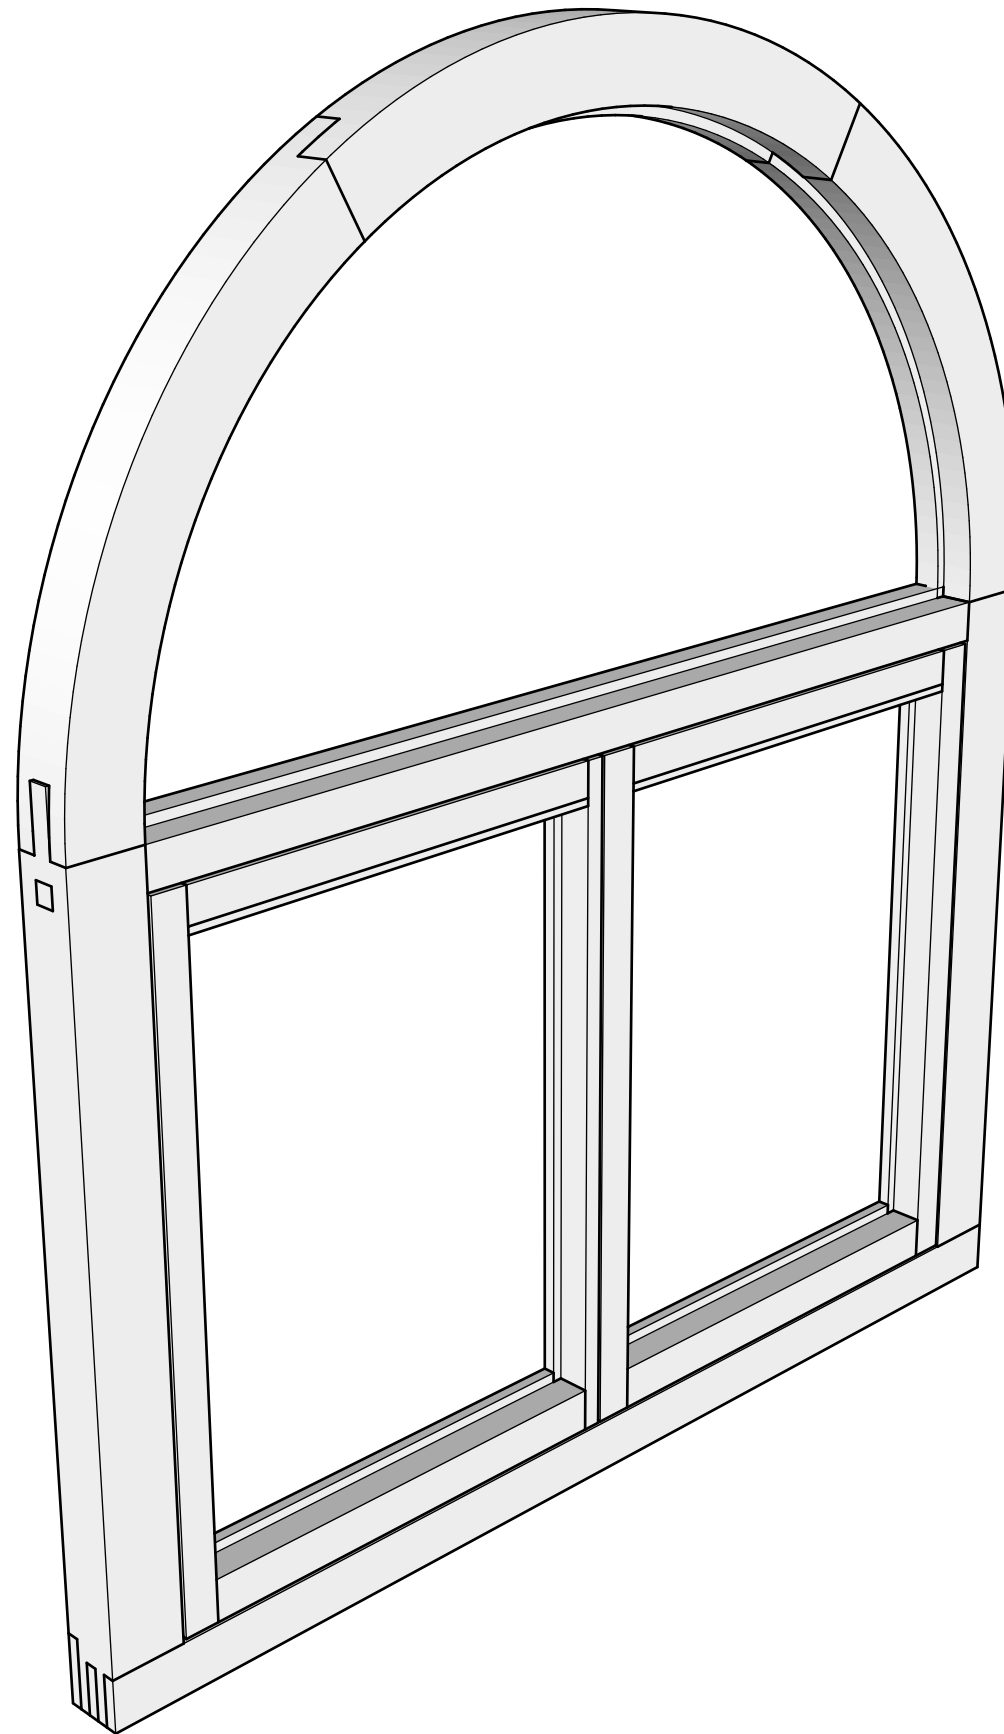

Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk


Arched Window

General Assembly

ernest rose
HERITAGE JOINERY AND CARPENTRY

01

A

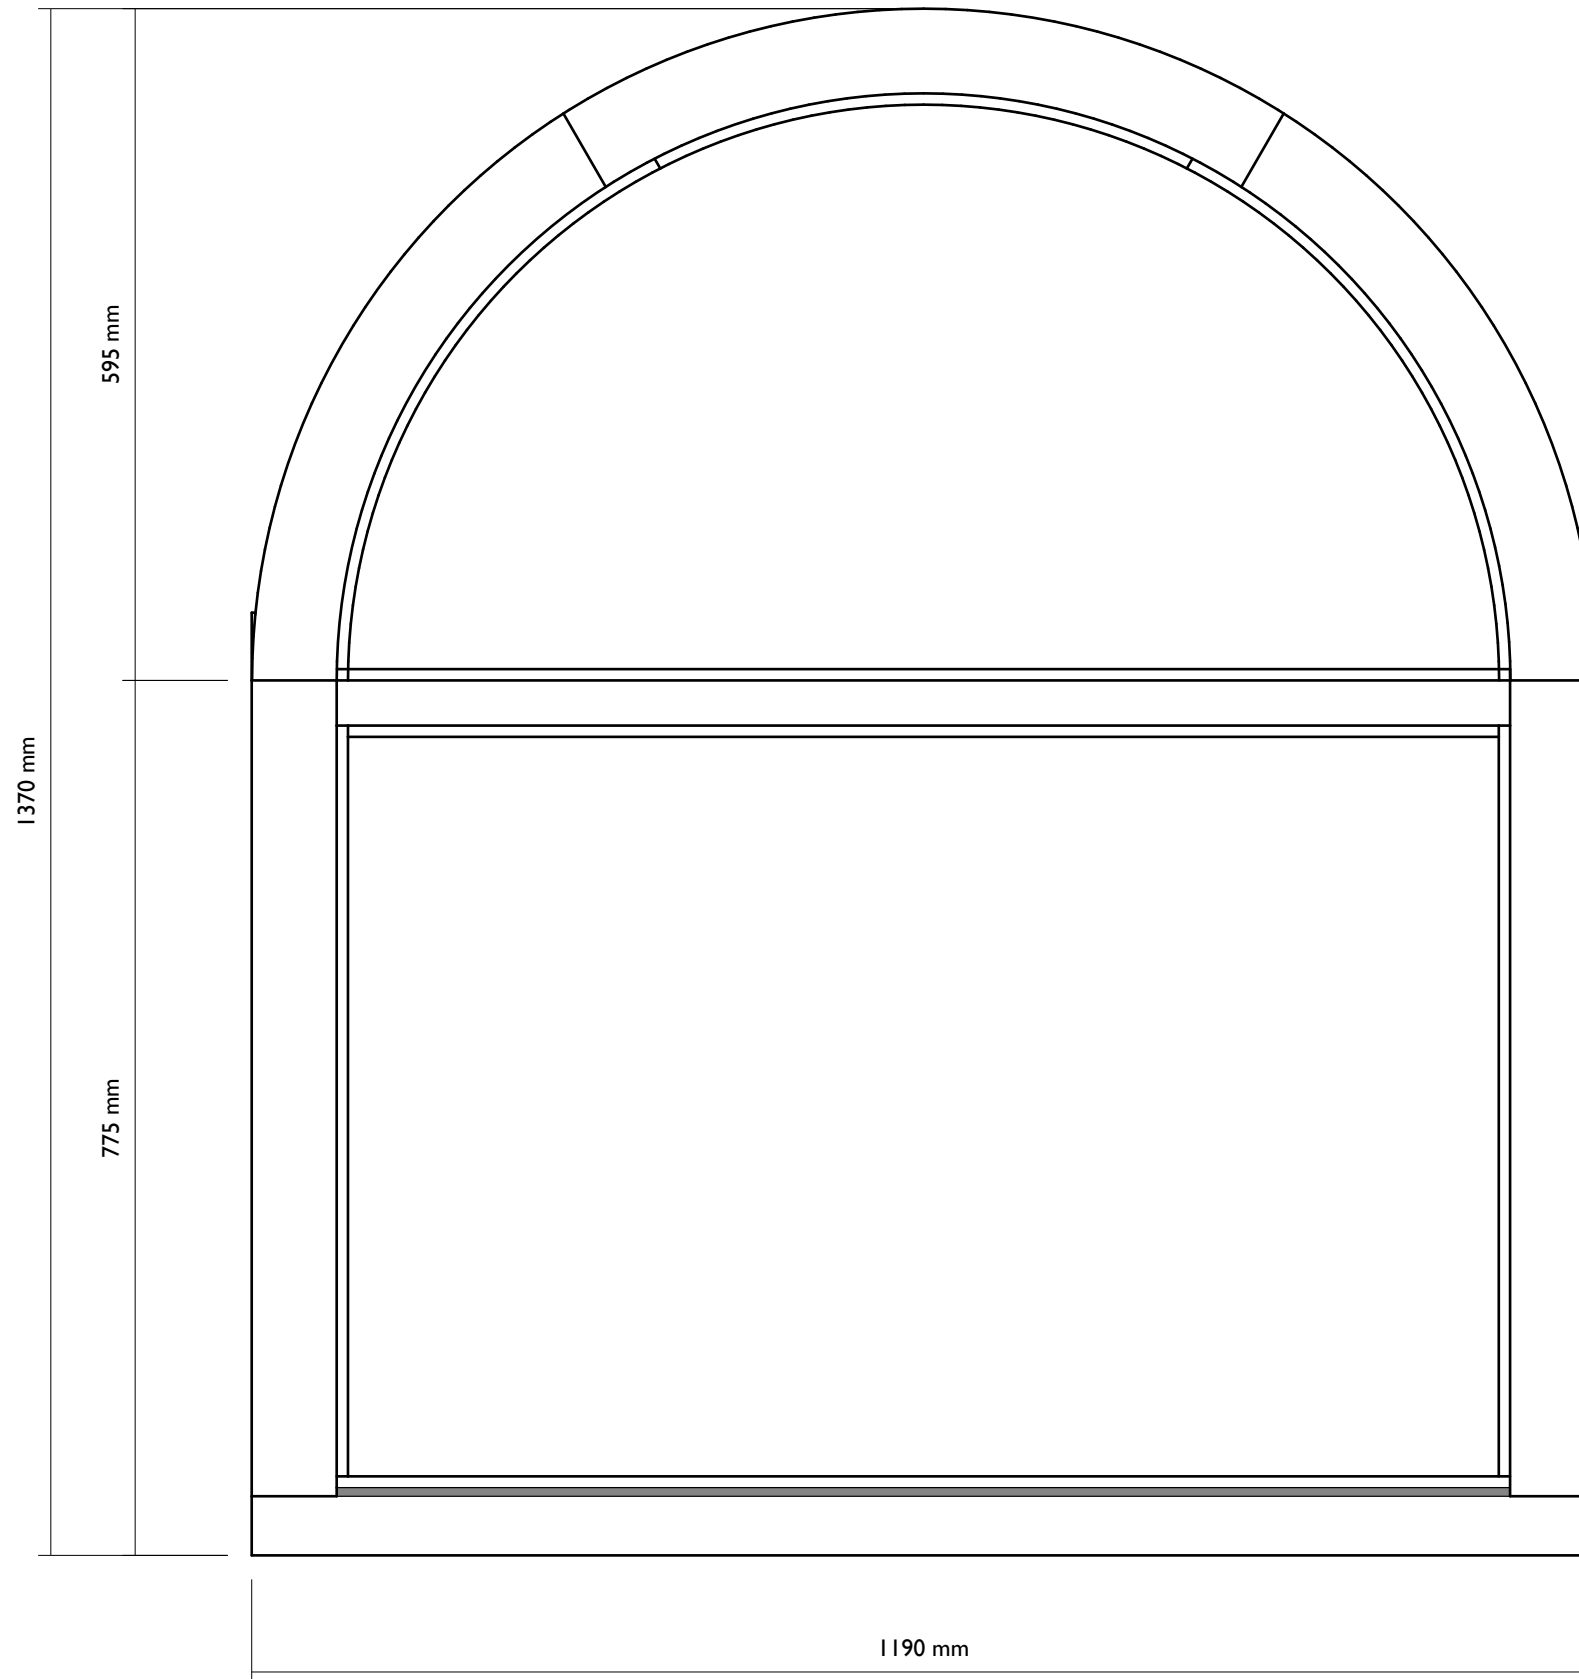

Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk


Arched Window

Frame Assembly

ernest rose
HERITAGE JOINERY AND CARPENTRY

02

A


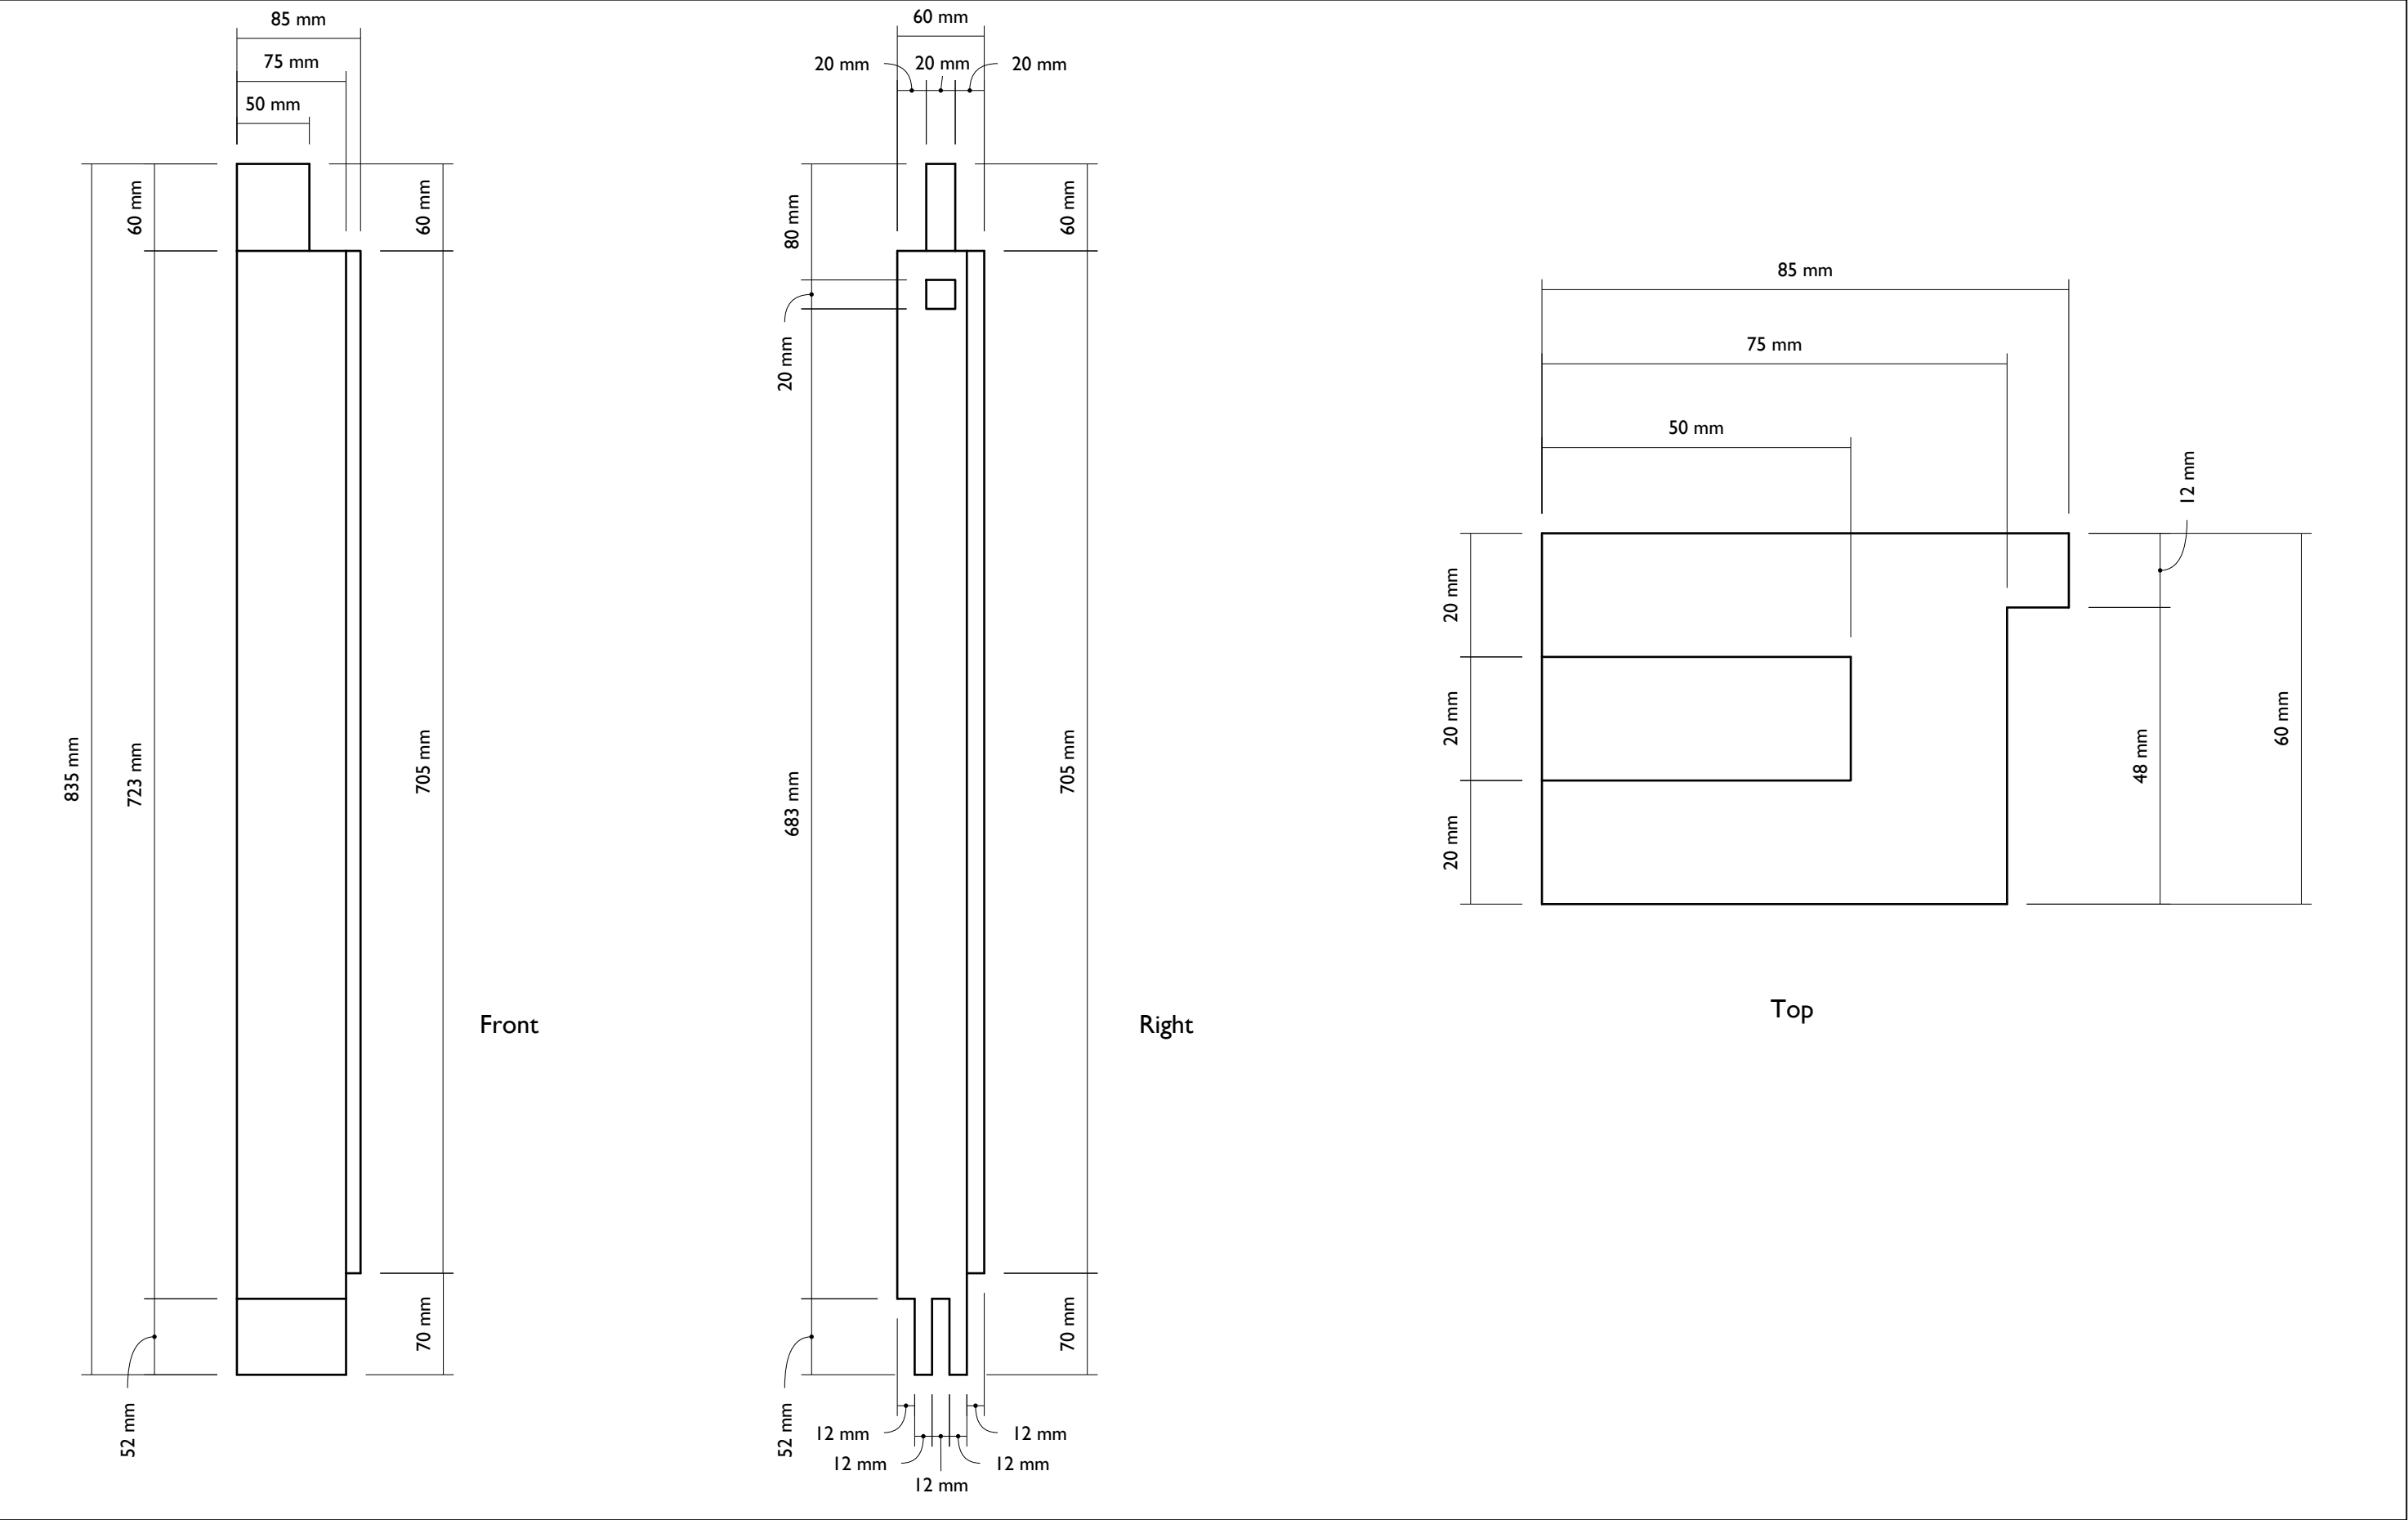


Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk

Arched Window

Jamb

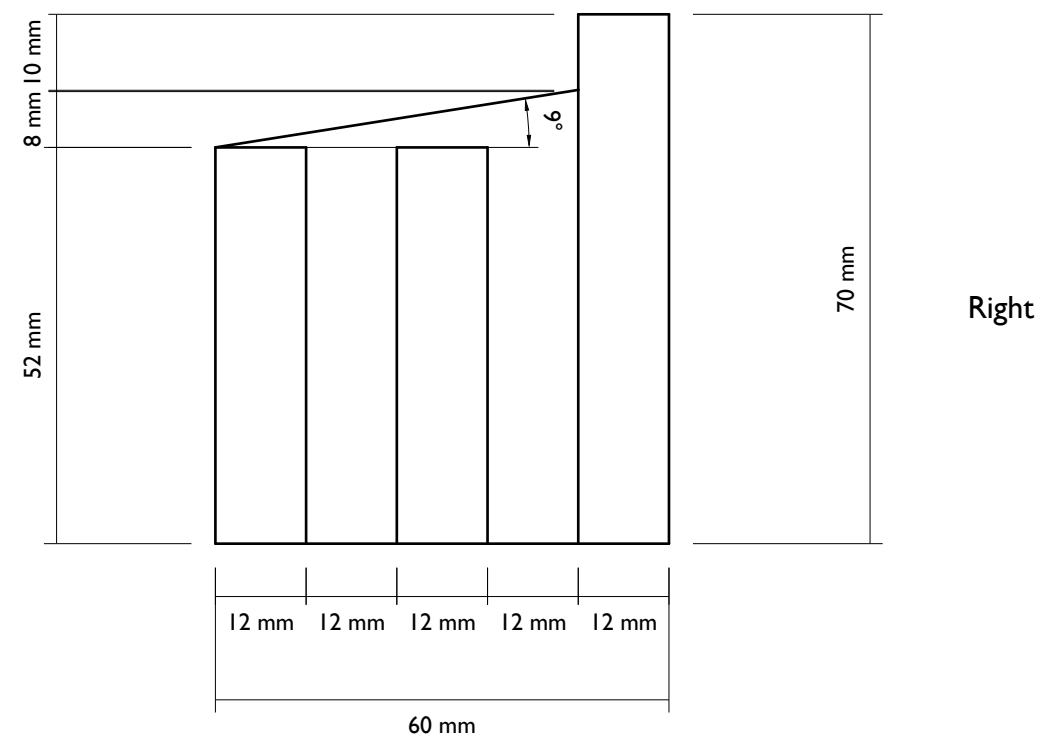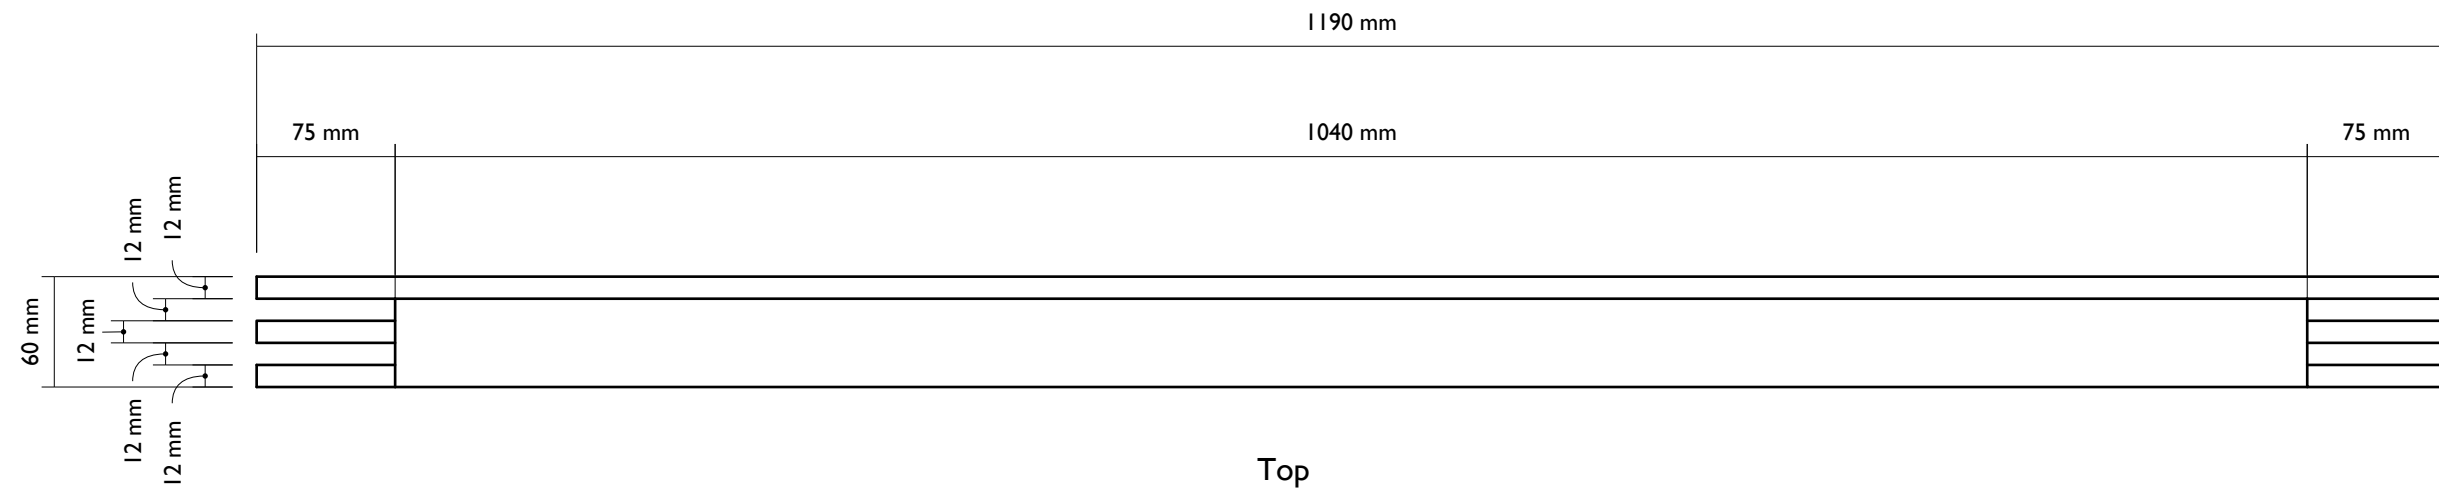

Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk


Arched Window

Cill


ernest rose
HERITAGE JOINERY AND CARPENTRY

04

A

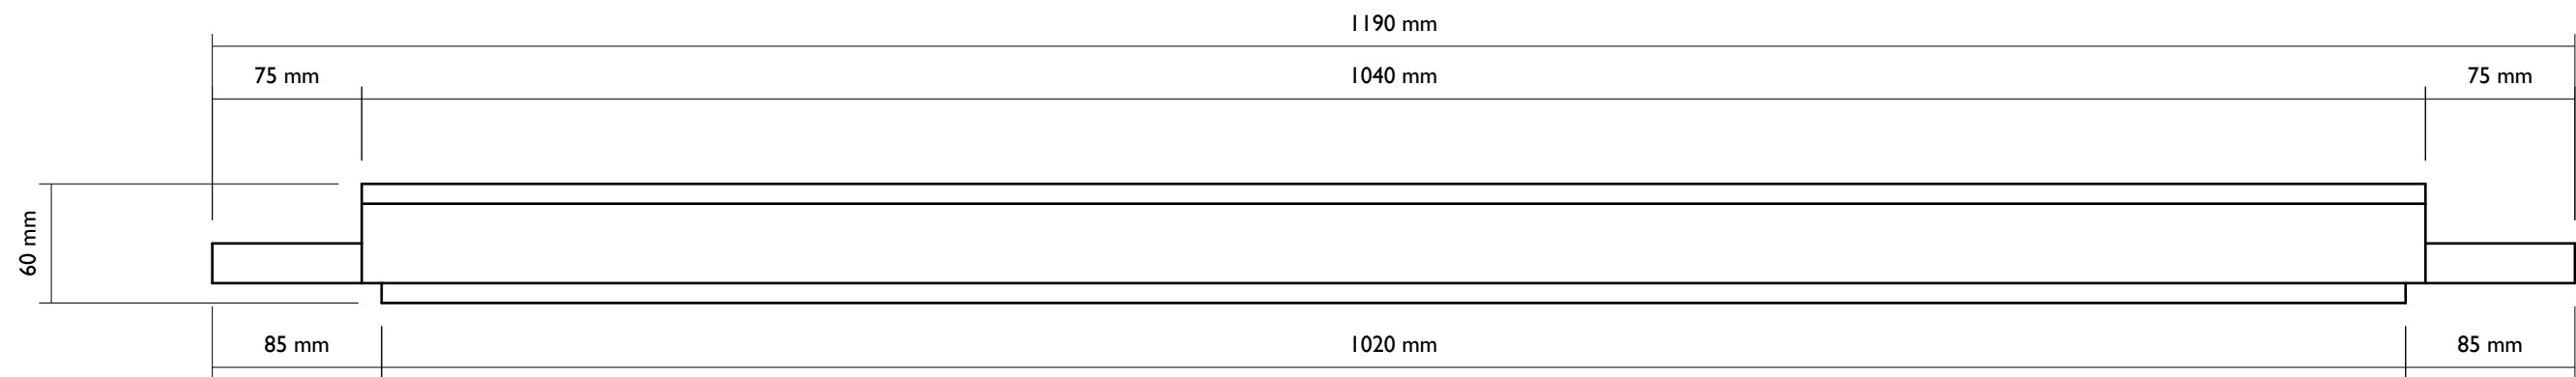

Front

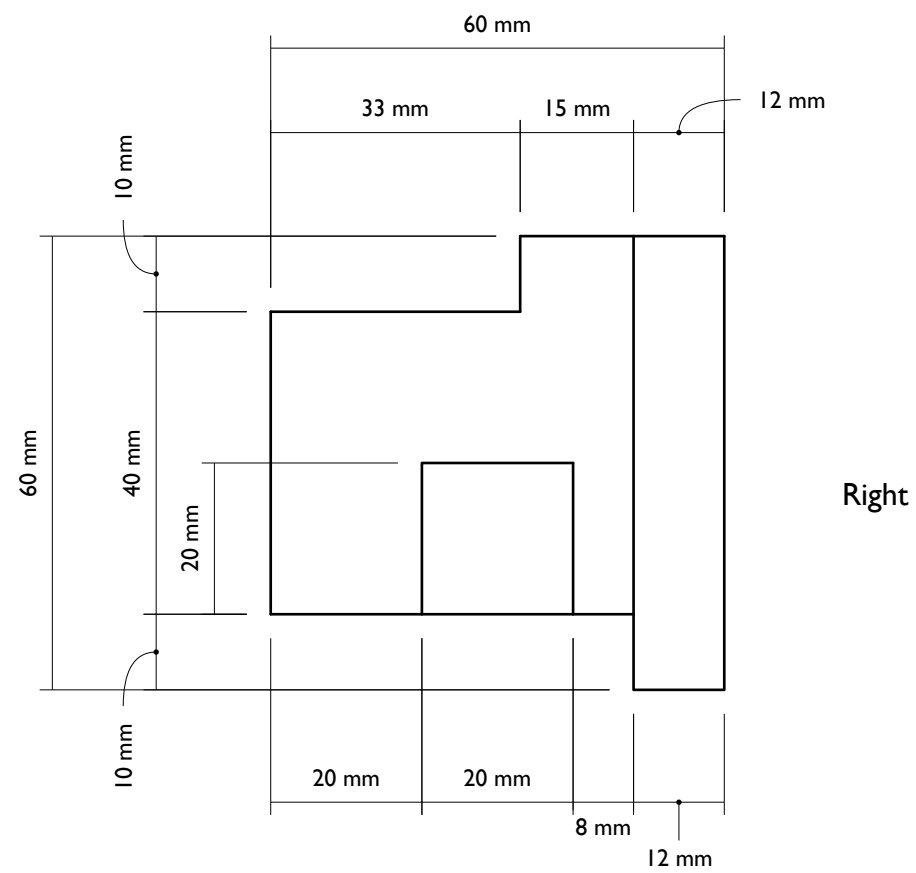

Right

Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk


Arched Window

Rail

ernest rose
HERITAGE JOINERY AND CARPENTRY

05

A

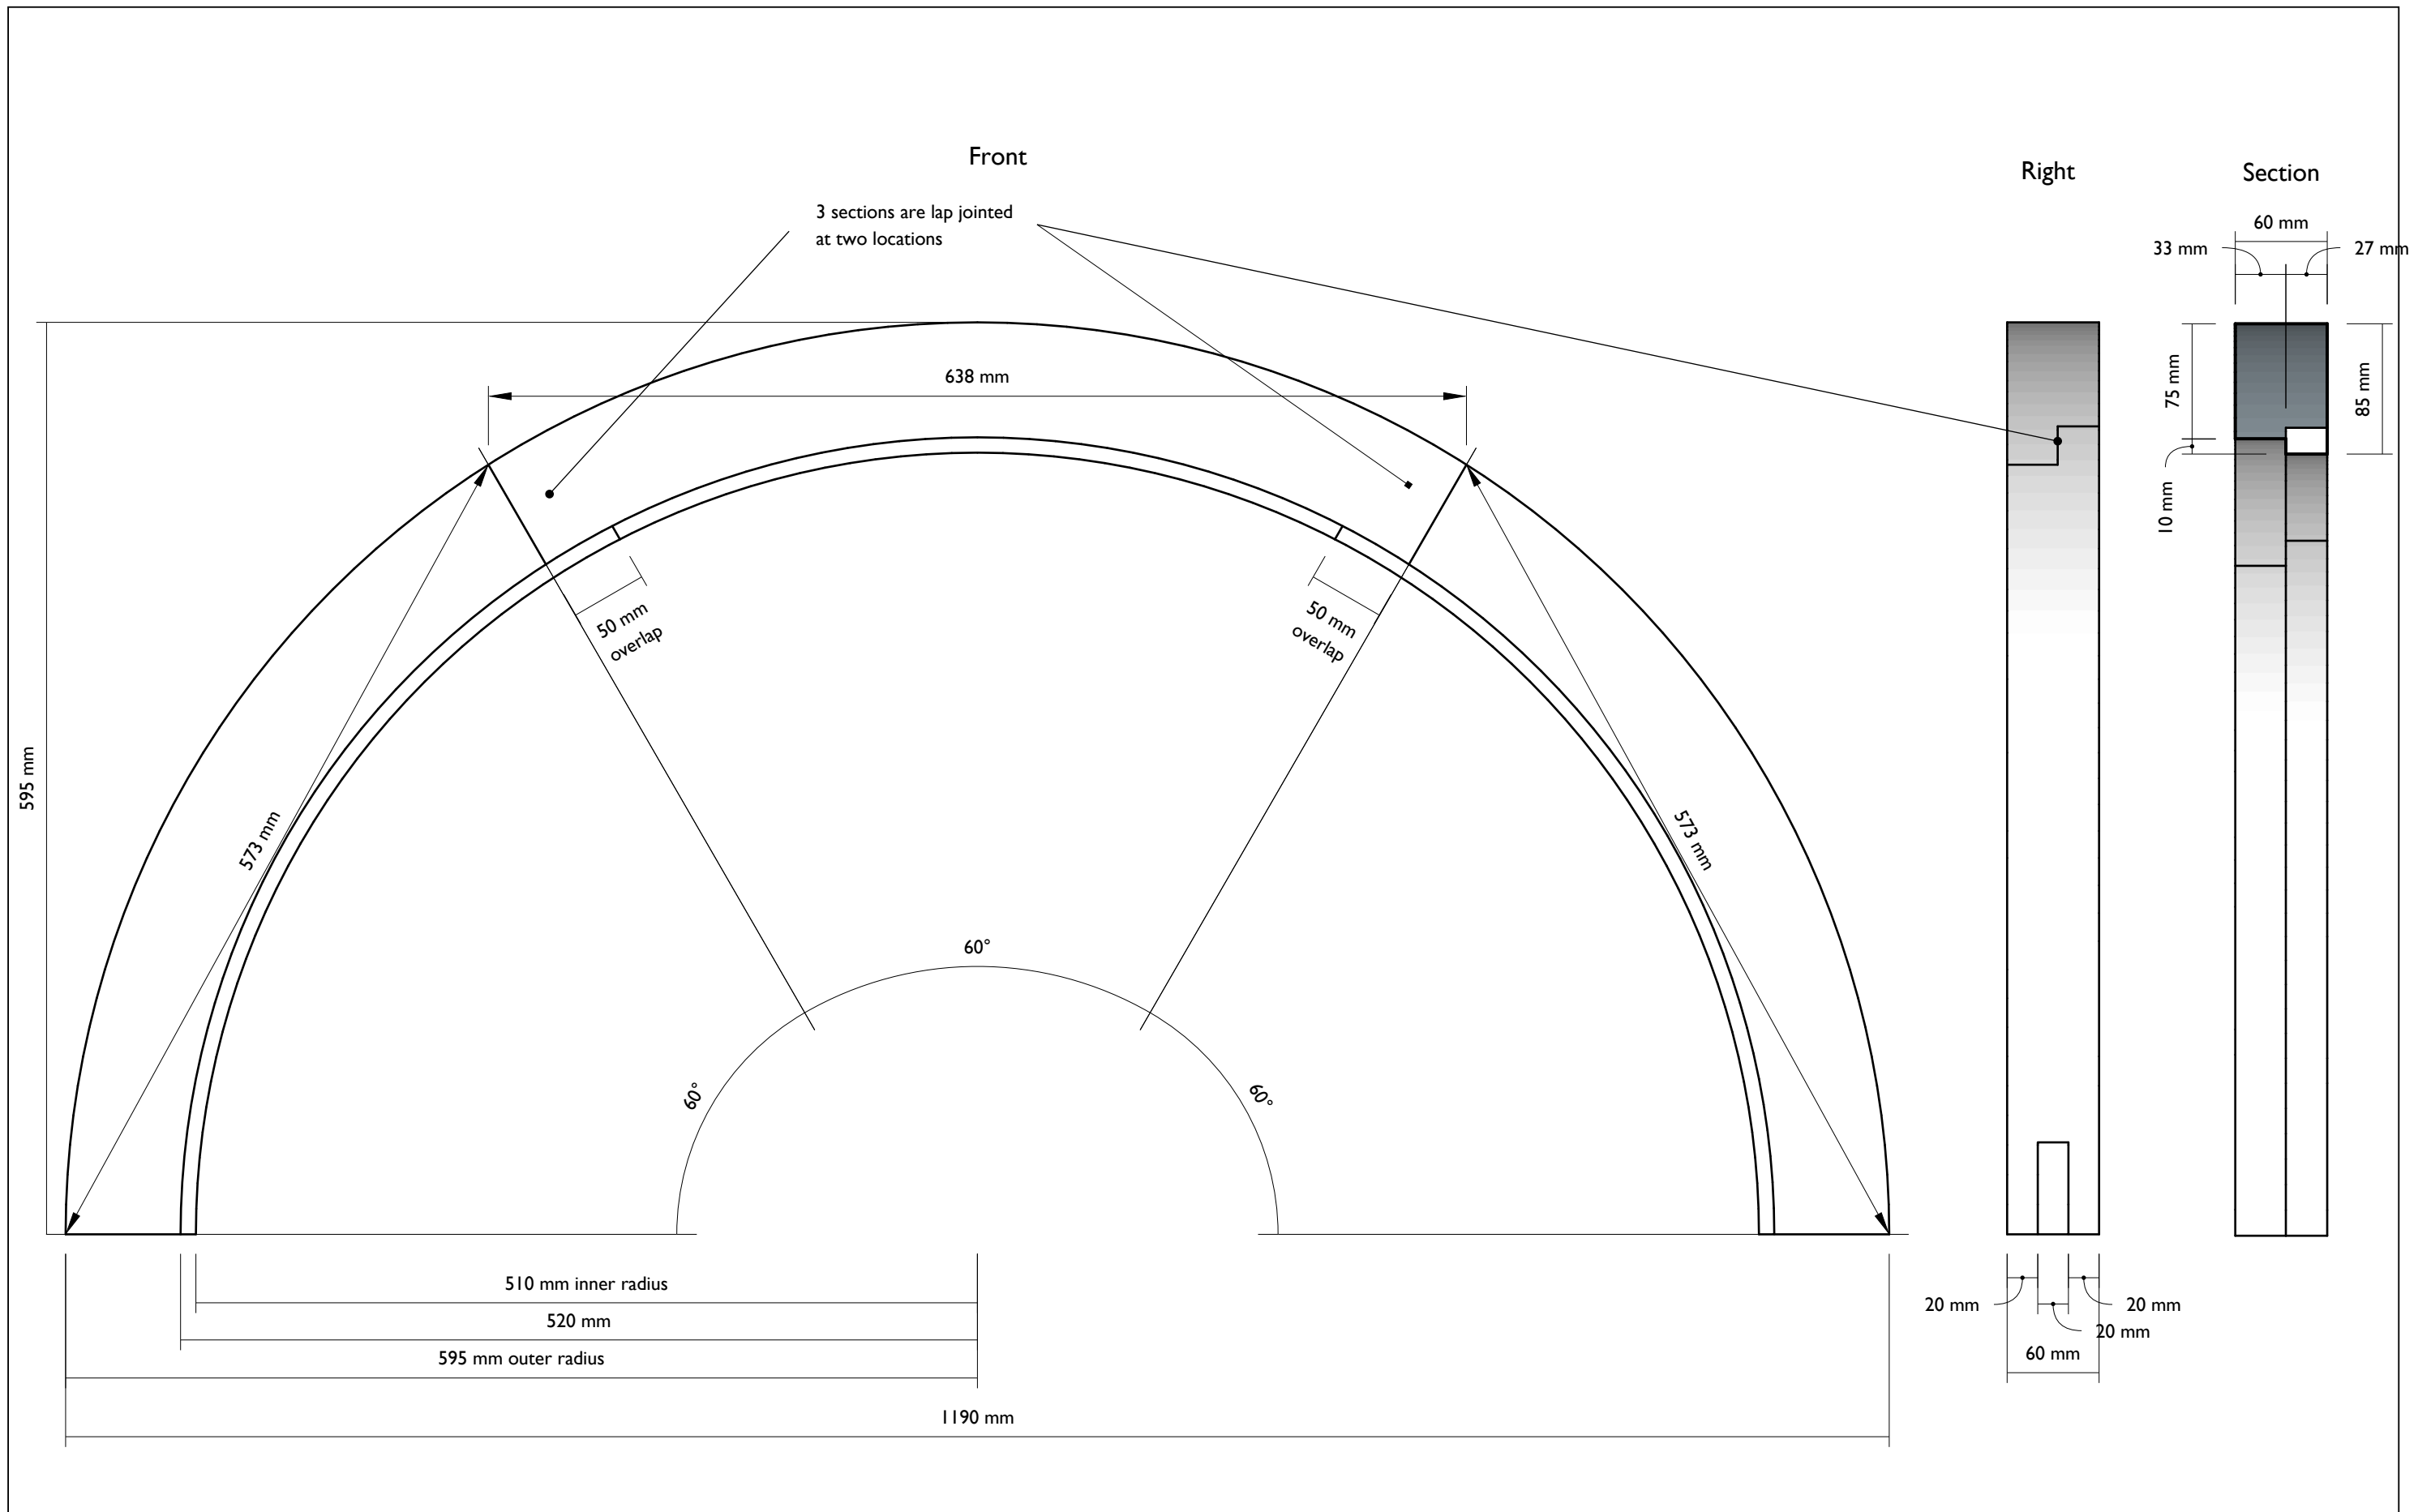

Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk


Arched Window

Arch Assembly

ernest rose
HERITAGE JOINERY AND CARPENTRY

06

A

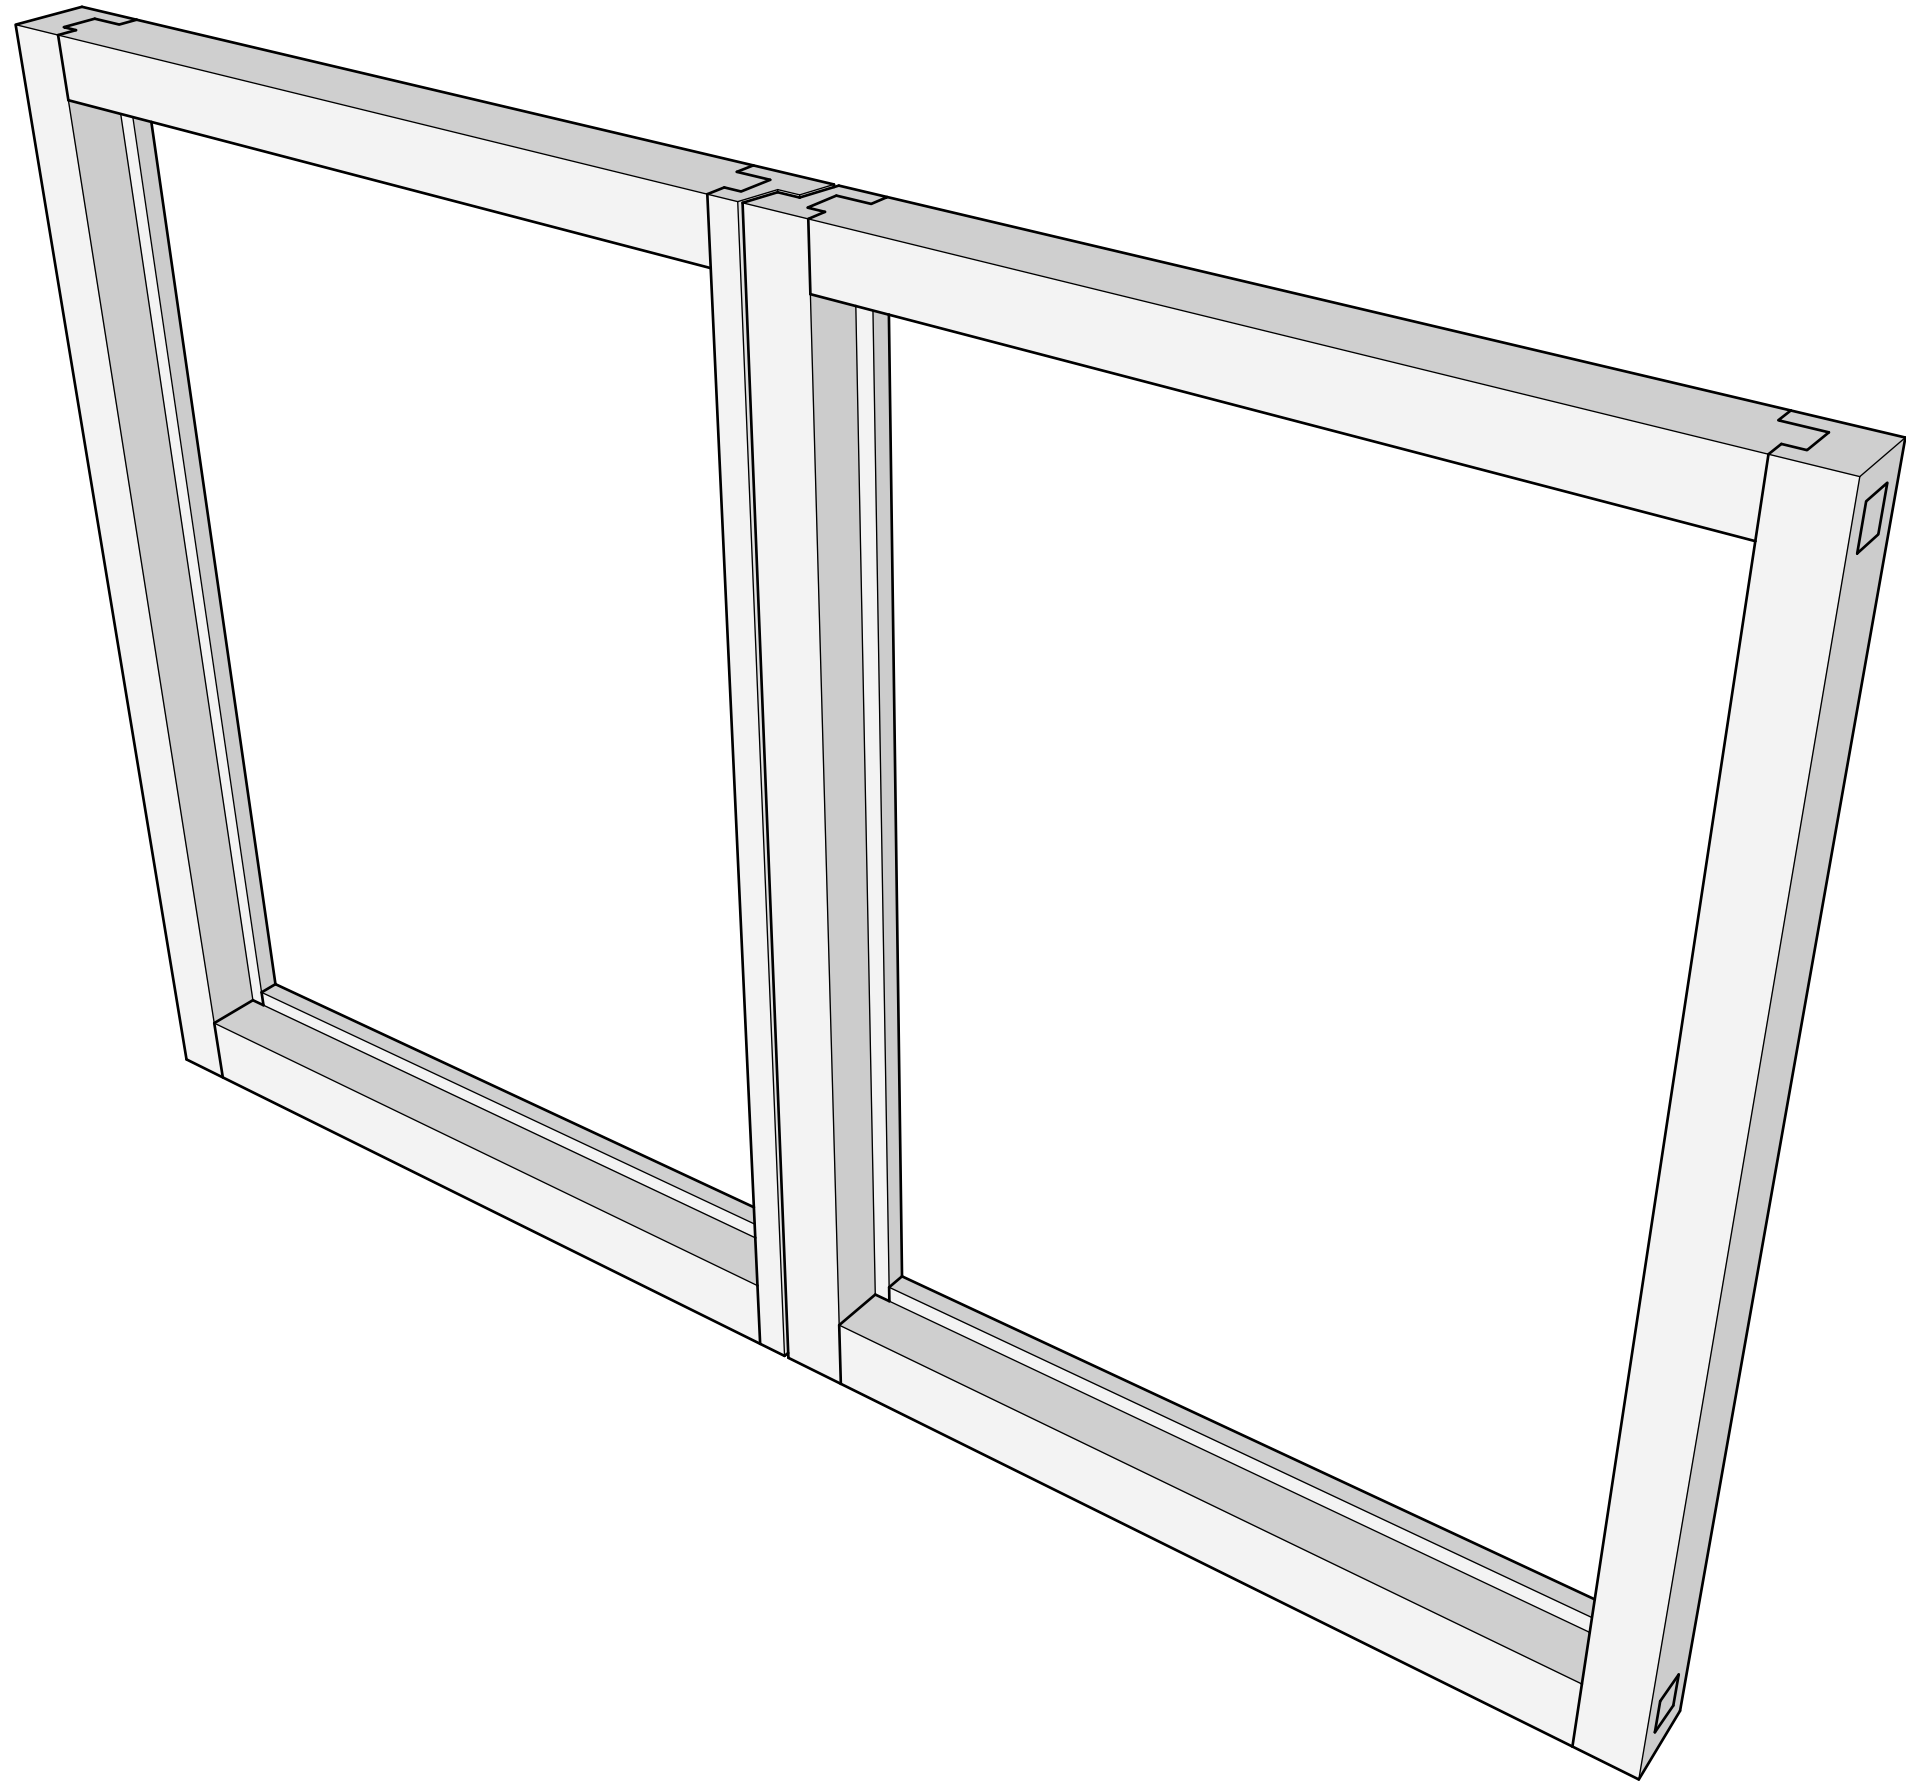

Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk



Arched Window

Sash Assemblies



ernest rose
HERITAGE JOINERY AND CARPENTRY

07


A

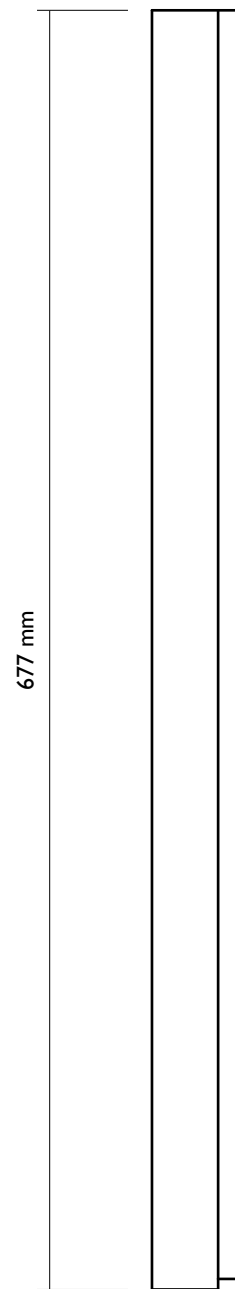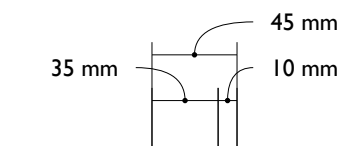

Front

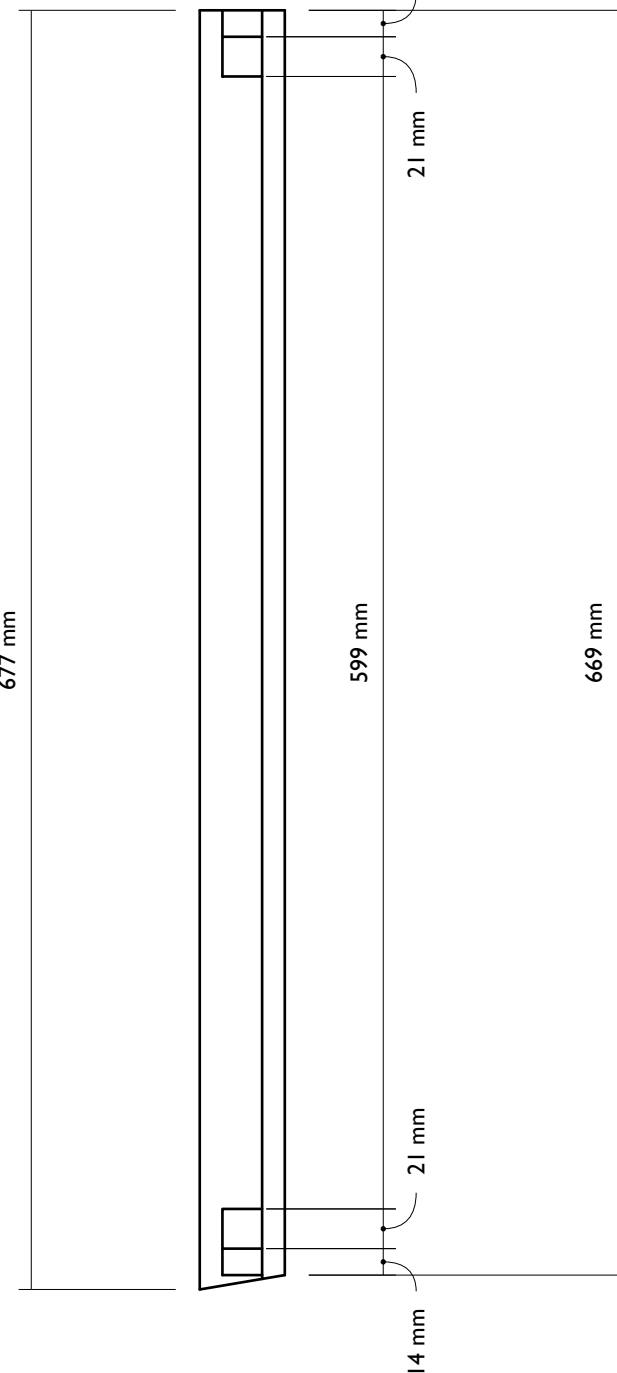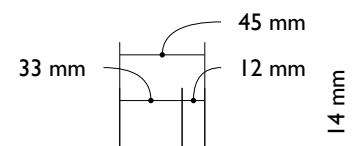

Right

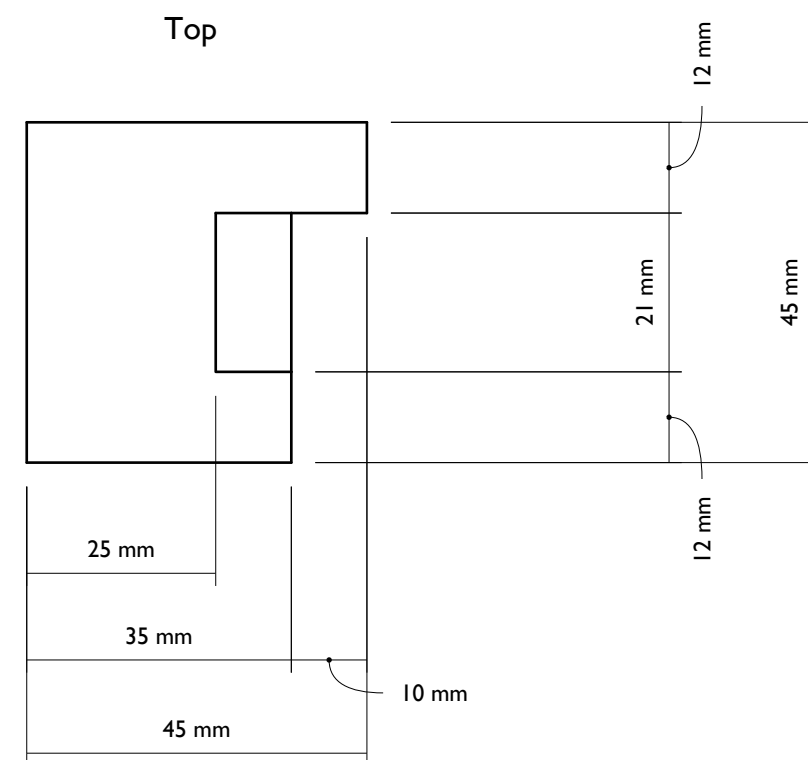

Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk


Arched Window

Left & right outer stiles

ernest rose
HERITAGE JOINERY AND CARPENTRY

08

A

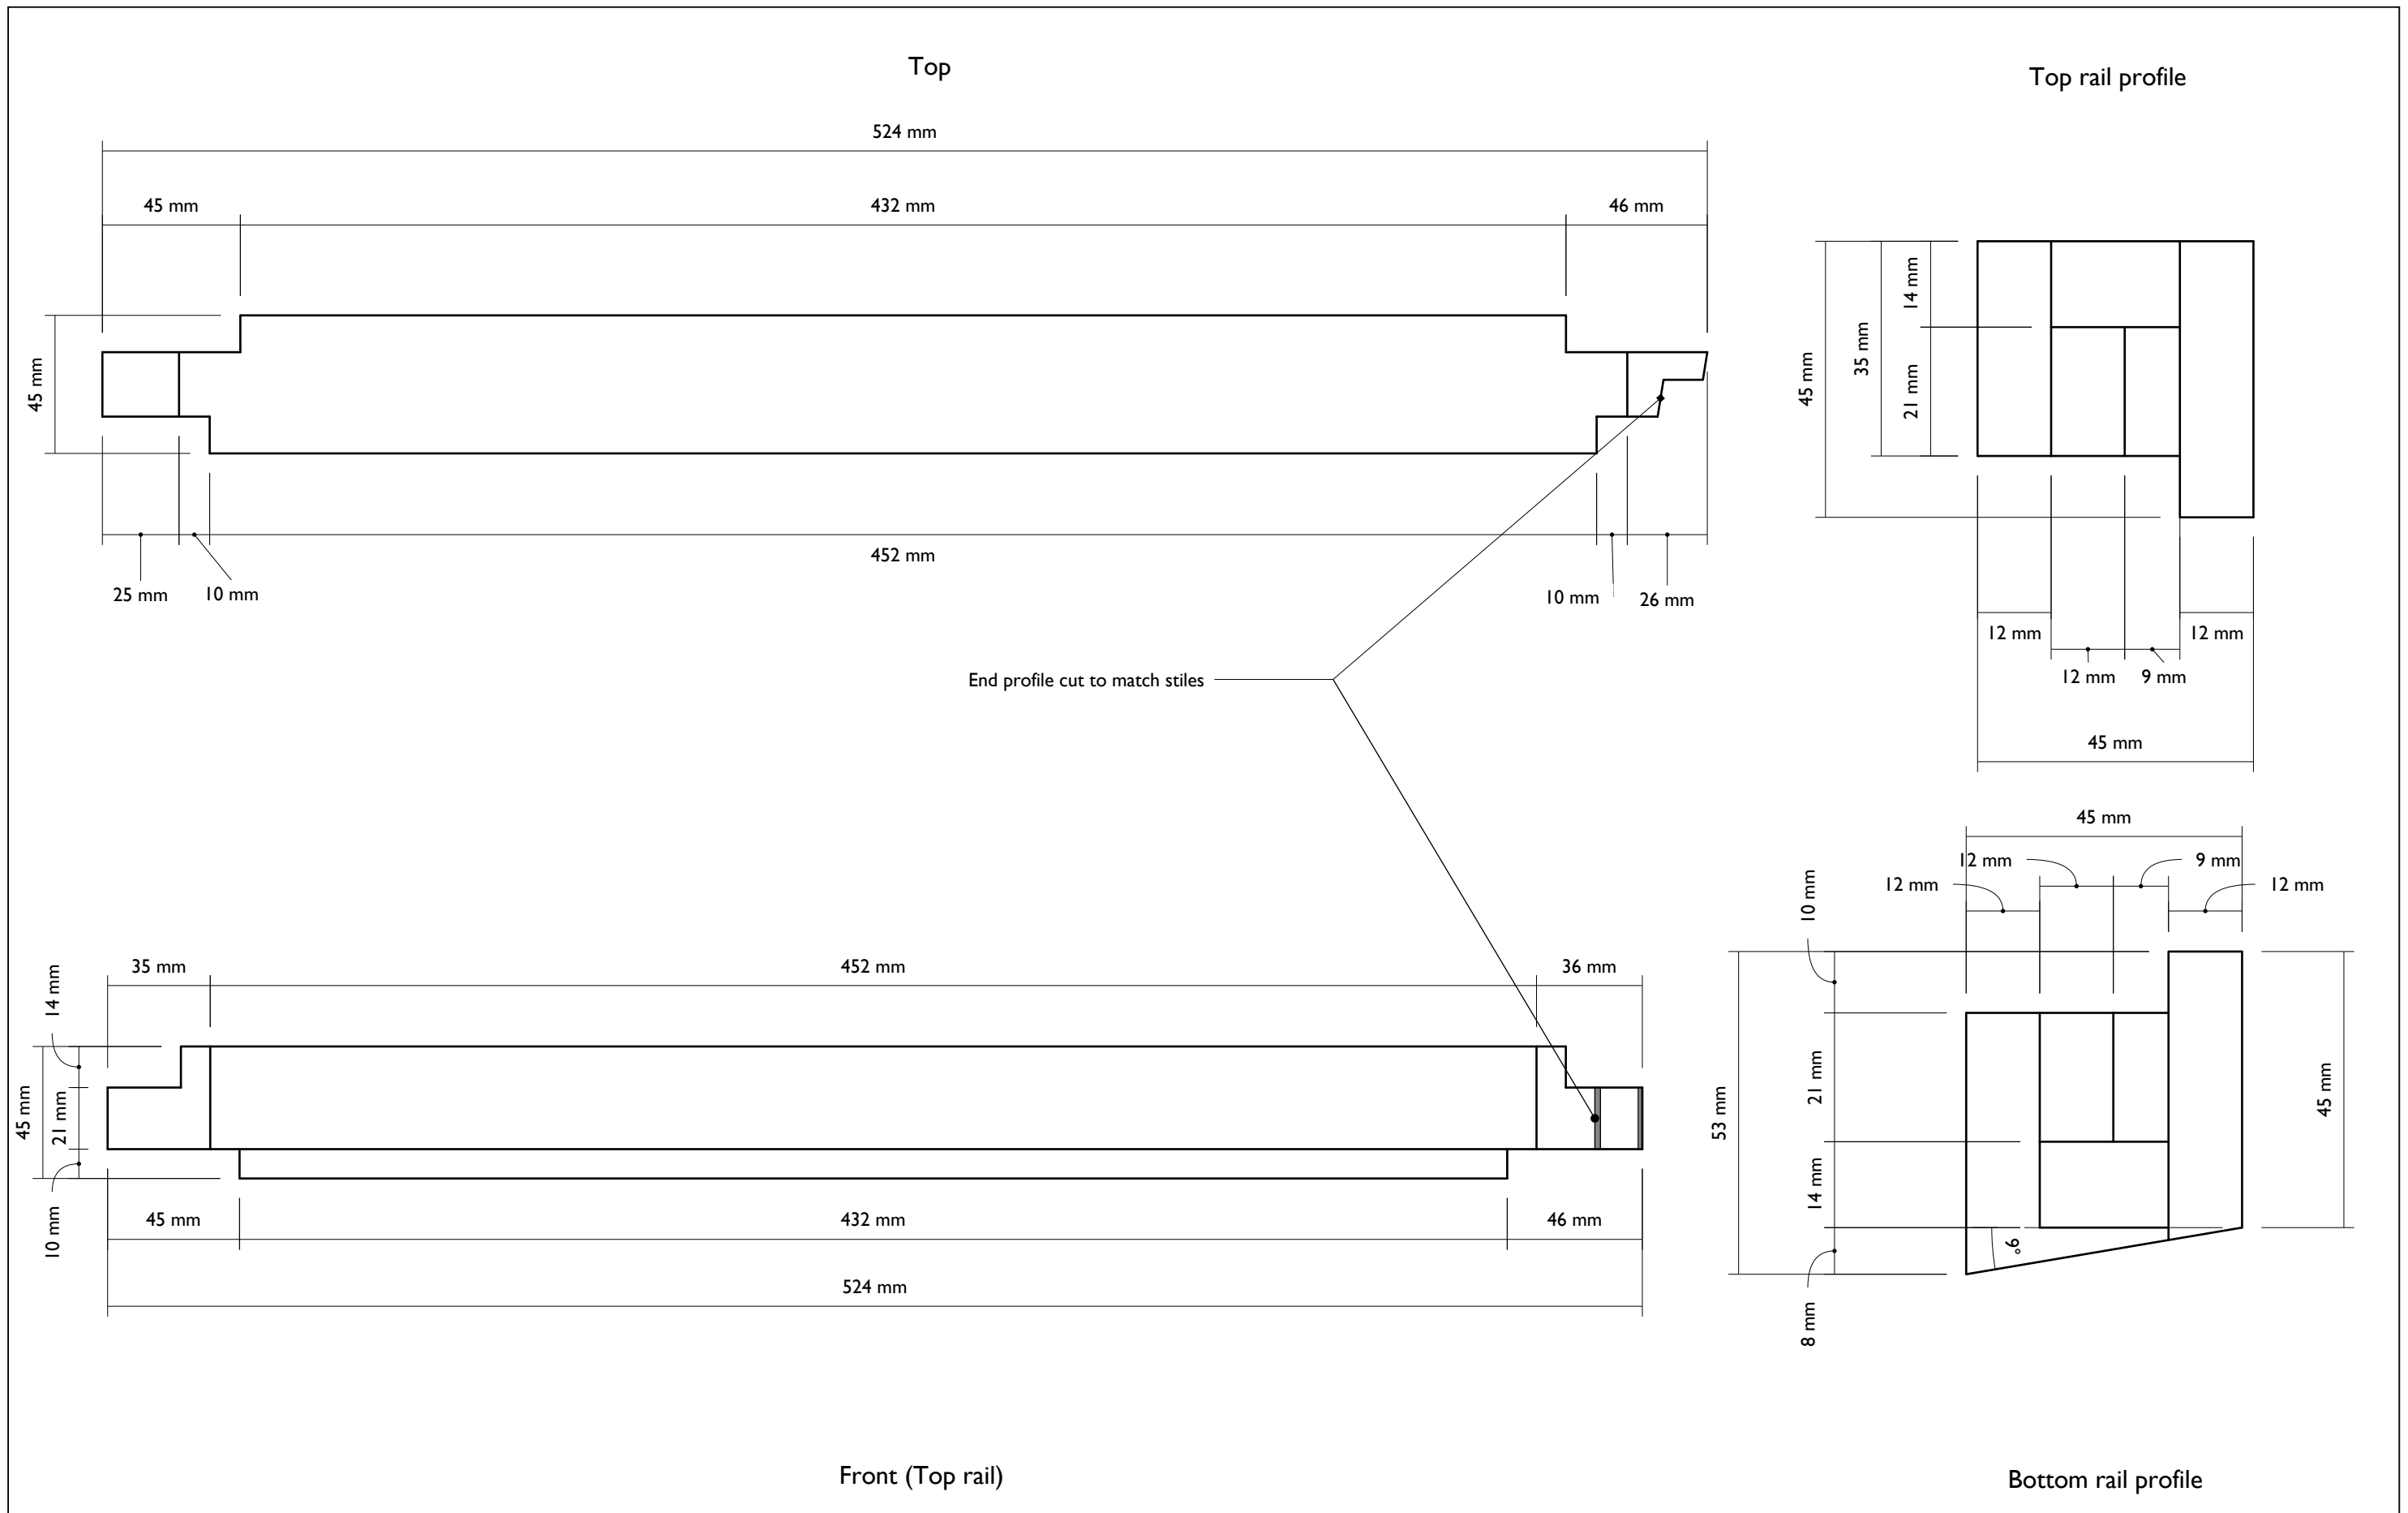

Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk


Arched Window

Left hand sash rails

ernest rose
HERITAGE JOINERY AND CARPENTRY

11

A

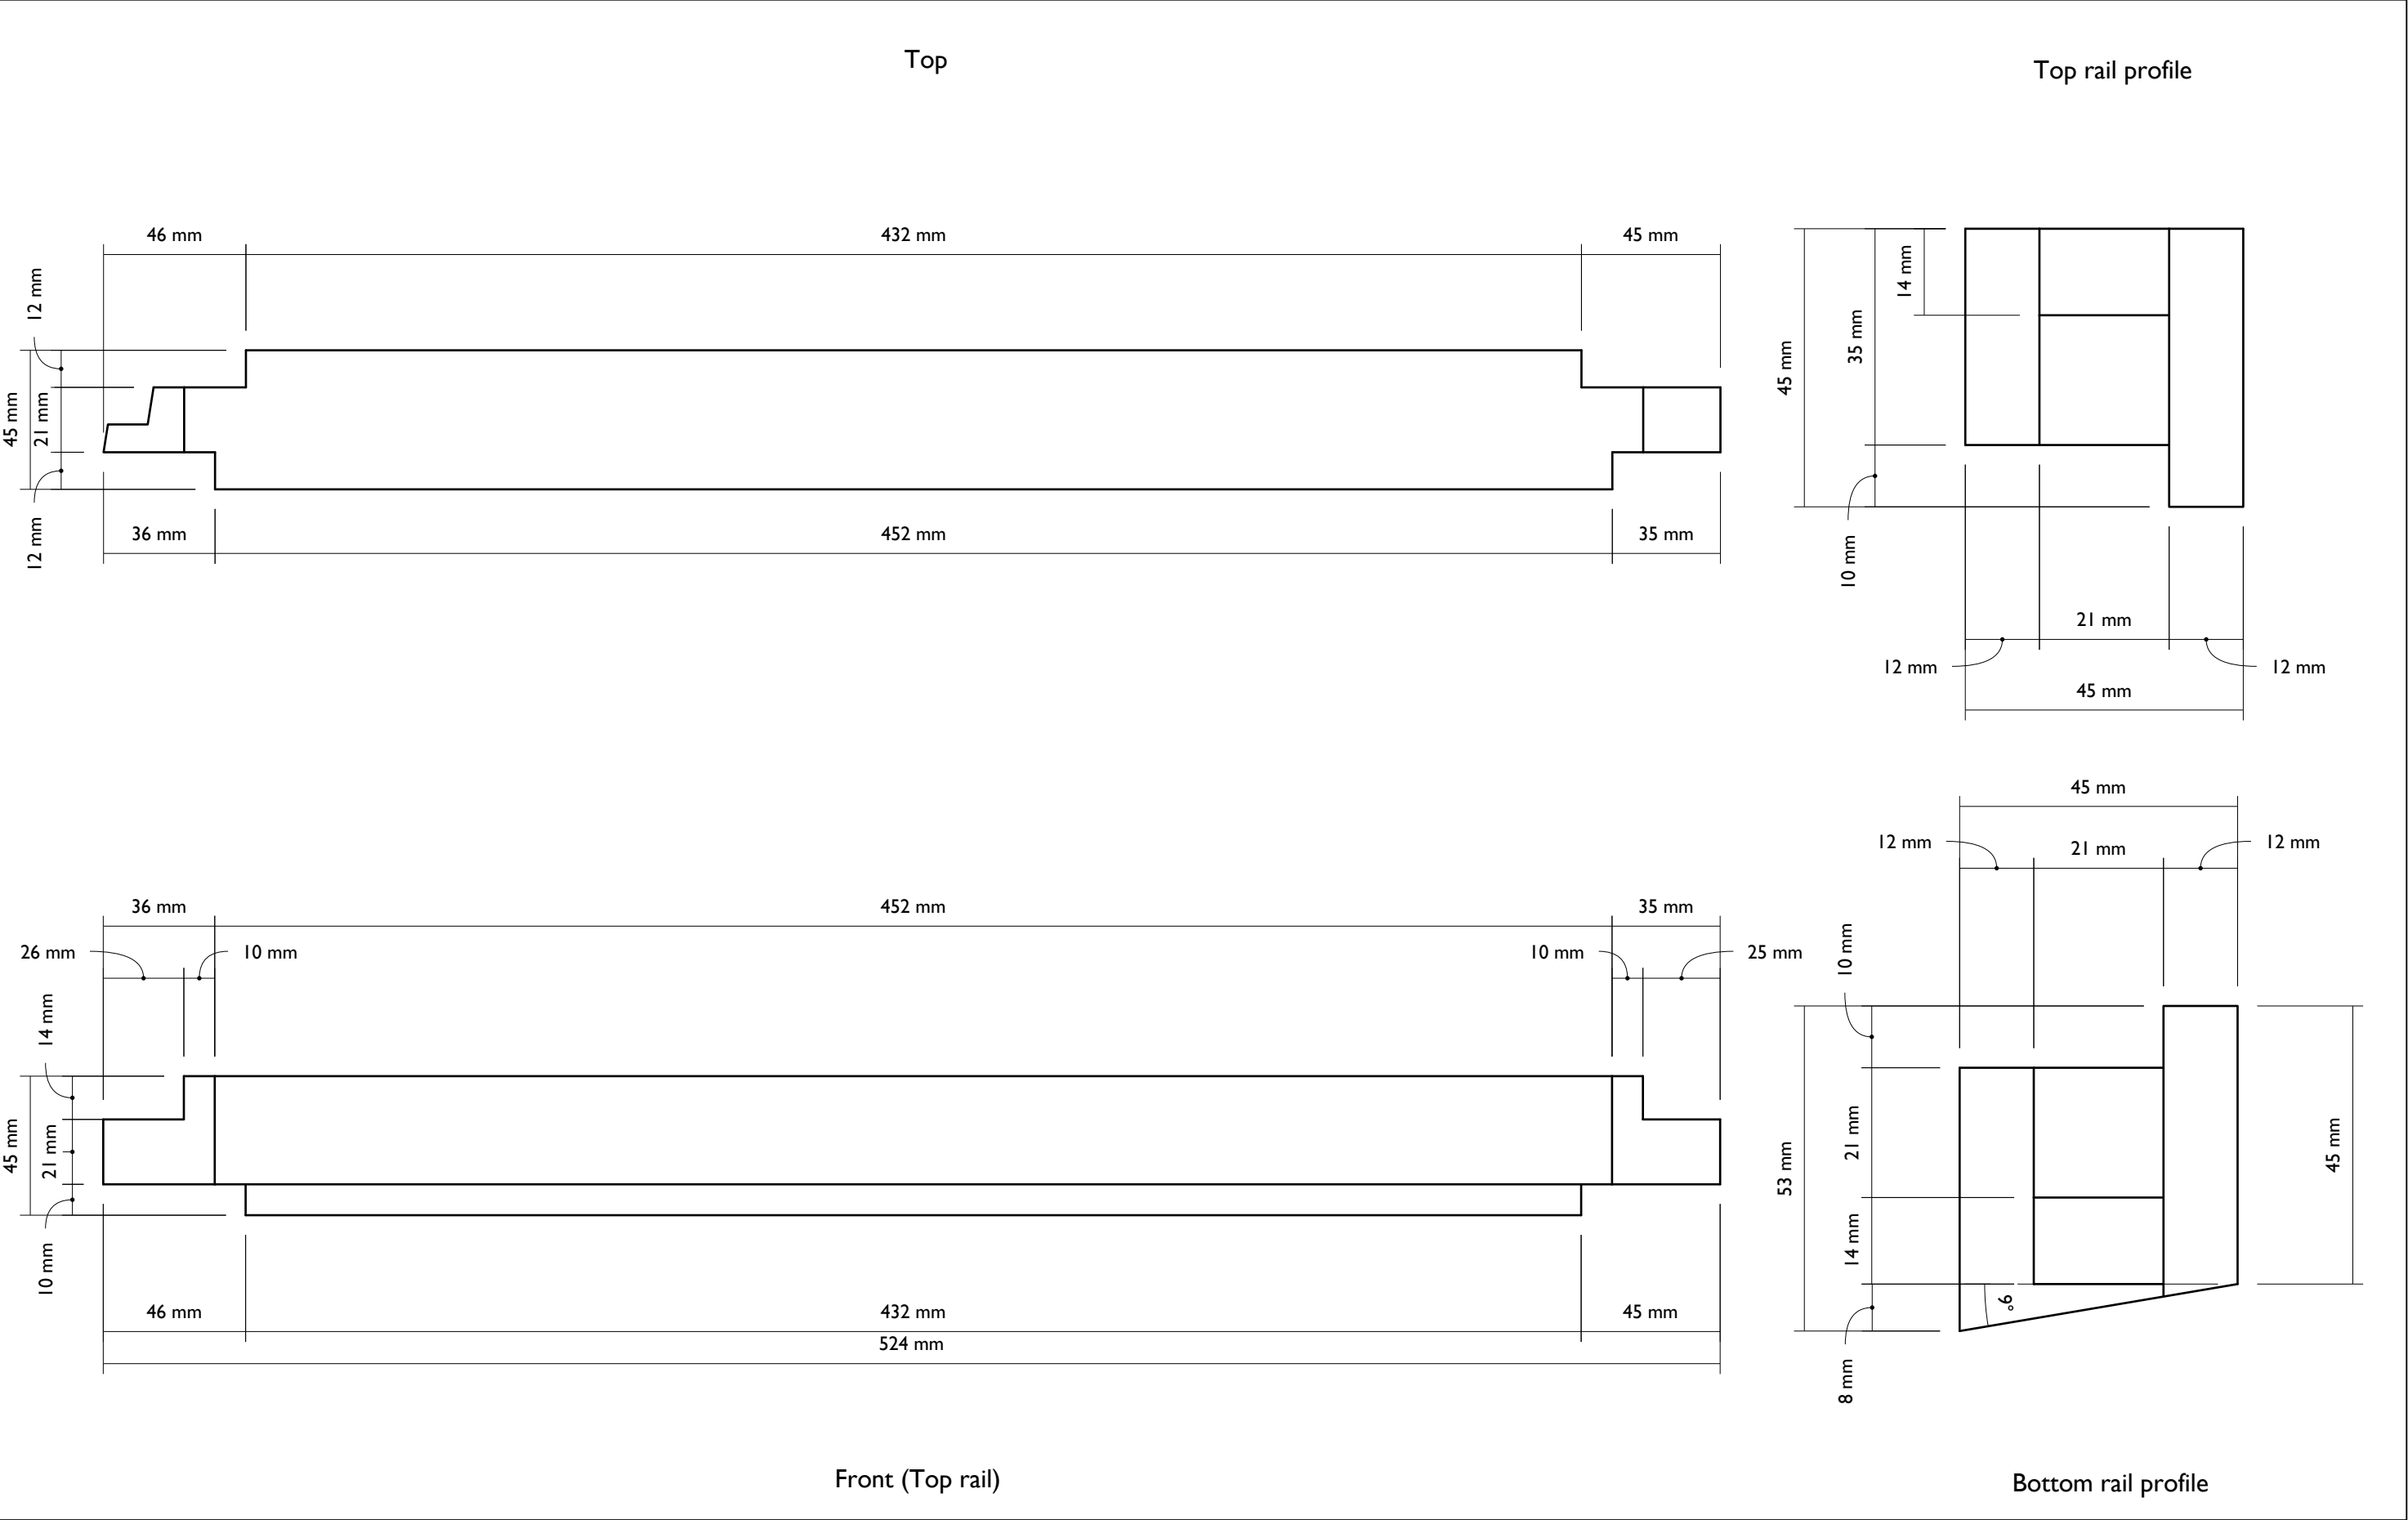

Client: John & Jan Bullock
Address: Syke House Farm,
Hollingworth Rd,
Littleborough. OL15 0HA

Contact: john@bulltrans.co.uk

Arched Window

Right hand sash rails