


Arboricultural Implications Study- Borrowdale Road, Rochdale

TREE SURVEY SCHEDULE

Arboricultural Data Sheet:					Date of Survey: 22/04/21				Surveyor: C. Salisbury				
Tree No.	Species	DBH (mm)	Height (m)	Age	Crown Spread (m)				Crown clearance	Condition rating	Comments and preliminary management recommendations	Estimated remaining contribution	Tree quality category rating
					N	E	S	W					
T1	Willow	190 avg.	5.80	EM	4.1	4.2	4.1	4.2	1.20	B/C	A self-seeded multi-stemmed specimen with poor form situated adjacent to a highway.	10 – 20	C2
T2	Willow	240	5.60	EM	3.6	3.5	3.7	2.0	0.20	B/C	A self-seeded multi-stemmed specimen with poor form situated adjacent to a highway.	10 – 20	C2
T3	Birch	530	14.20	EM	4.2	3.9	4.1	4.5	3.00	B	An individual specimen with reasonable form situated off-site.	40 – 60	B2
T4	Willow	370	8.60	EM	4.3	4.0	4.1	3.6	4.20	C/D	An individual specimen in extensive decline situated off-site.	0 – 10	U
G1	Cherry, Willow & Damson	180 avg.	5.20	EM	-	-	-	-	0.00	B/C	A linear poor-quality group situated adjacent to a highway.	10 – 20	C2
G2	Birch, Alder, Ash & Maple	270 avg.	11.60	SM/E M	-	-	-	-	1.00	B/C	A mixed species belt situated along the site boundary. Early signs of Ash Dieback are evident in this group.	40 – 60	B2
G3	Ash	260 avg.	10.40	SM/E M	-	-	-	-	0.80	B	A single species group.	60 – 80	B2
G4	Alder, Willow & London Plane	330 avg.	12.60	SM/E M	-	-	-	-	0.80	B/C	A mixed species belt situated along the site boundary. – Fell 1 x Willow with extensive basal decay	60 – 80	B2
G5	2 x Maple & 1 x Alder	240 avg.	12.20	SM	-	-	-	-	3.00	B/C	A linear group with poor form due to adjacent trees.	20 – 40	C2

Arboricultural Implications Study- Borrowdale Road, Rochdale

Arboricultural Data Sheet:					Date of Survey: 22/04/21				Surveyor: C. Salisbury				
Tree No.	Species	DBH (mm)	Height (m)	Age	Crown Spread (m)				Crown clearance	Condition rating	Comments and preliminary management recommendations	Estimated remaining contribution	Tree quality category rating
					N	E	S	W					
G6	Birch & Alder	300 avg.	12.60	SM/E M	-	-	-	-	0.20	B/C	A mixed species group with reasonable form situated adjacent to a highway.	40 – 60	B2
G7	Rowan	120 avg.	4.60	EM	-	-	-	-	0.40	C	A poor-quality group which has been vandalised in the past. The trees are showing evidence of decline.	0 – 10	C2
G8	Lime, Whitebeam & Robinia	360 avg.	11.80	EM	-	-	-	-	4.00	B/C	A mixed species group with reasonable form situated off-site.	40 – 60	B2
H1	Hawthorn, Oak & Maple	90<	2.20	EM	-	-	-	-	0.00	B/C	A poorly maintained perimeter hedge. – Fell 1 x dead standing tree	40 – 60	B2

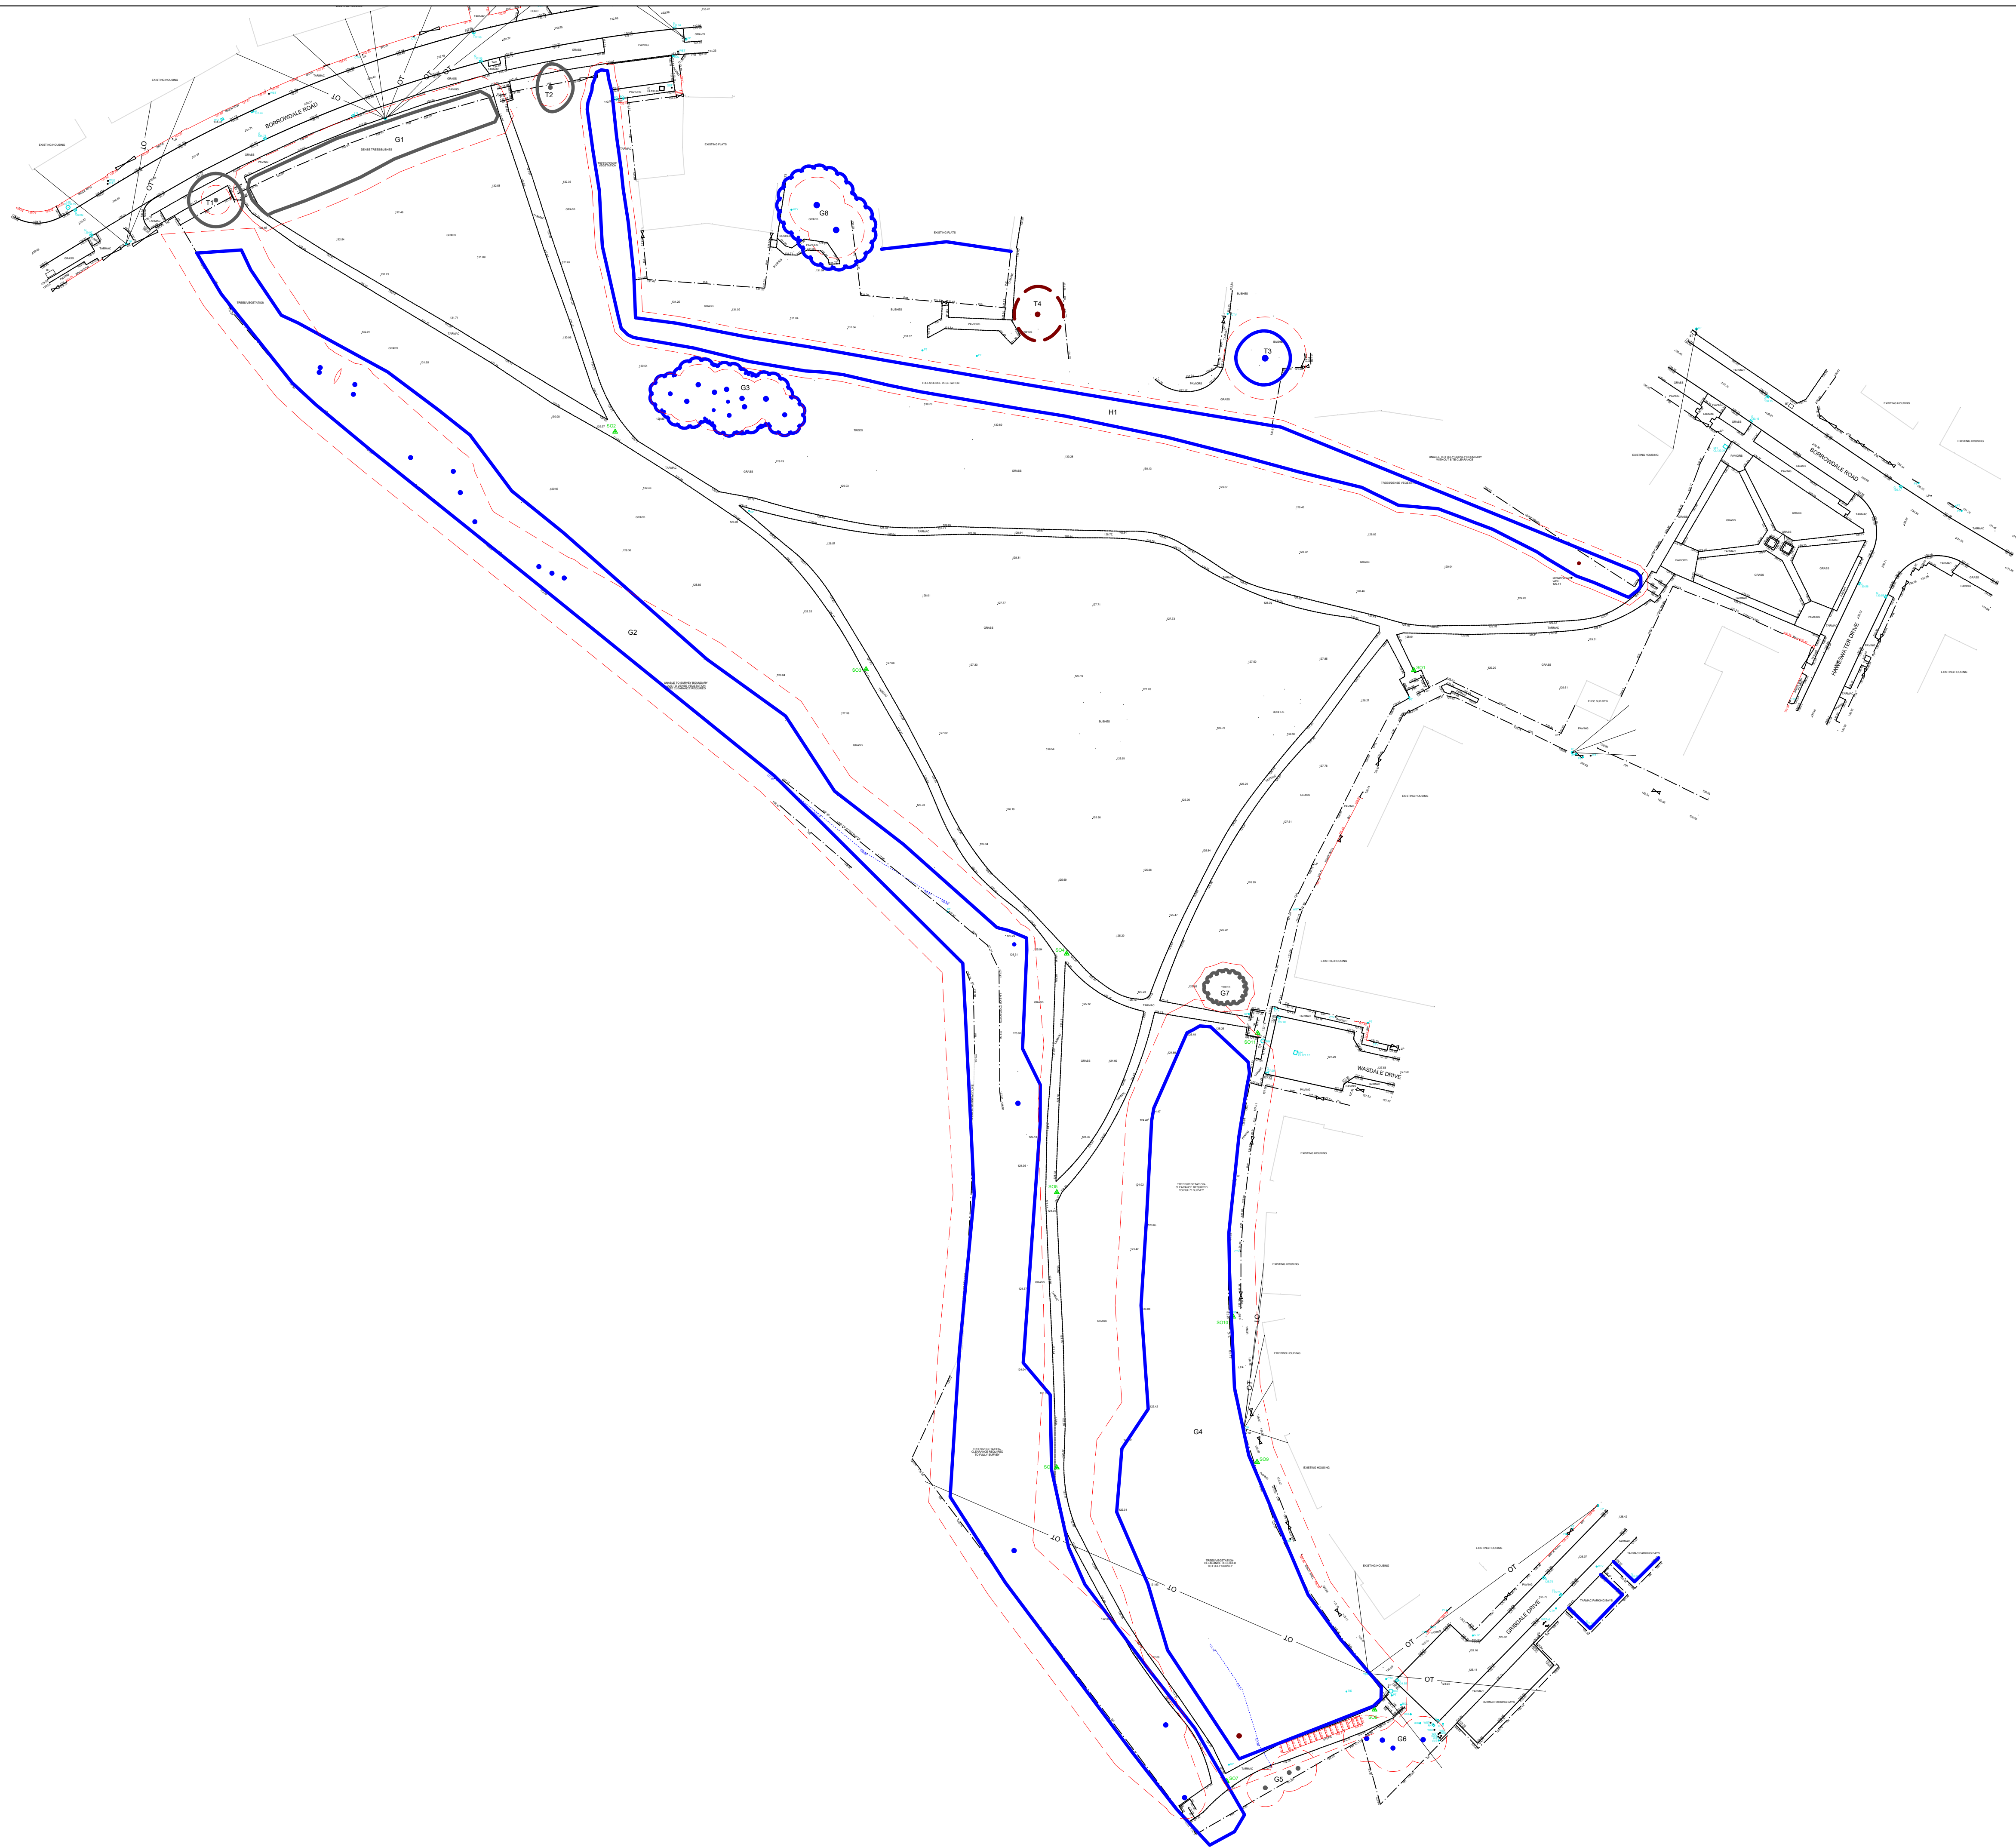

-  Category A Trees
-  Category B Trees
-  Category C Trees
-  Category U Trees
-  Root protection area

Mulberry TMC
Adamson House
Towers Business Park
Wilmslow Road
Didsbury
M20 2YY

Tel: 0161 955 3628
Email: info@mulberrytmc.co.uk

Site Address:
Borrowdale Road
Rochdale

Drawing Title:
BS5837 Plan

Drawing No:
BRR/BS/01 Rev. A

Date: 06/05/2021 Scale: 1:500@A1 Drawn by: CS

Note: Dimensions are not to be scaled from this drawing.
All written measurements are to be checked on site by the contractor. Copyright Mulberry TMC.
Note: All rights described in Chapter IV of the Copyright Design & Patents Act 1988 have generally been asserted.