

LYONS STONEMASONRY

Stone survey report



Edgar Wood Trough

Heywood Old Rd

Middleton

OL10 2QL

Site visit Friday 1st September


Observations-

The existing structure is in reasonable condition. There is evidence that the structure has suffered impact damage from possibly vehicles. There is an outward lean too the structure of approx 80mm. The central shaft of the structure has rotated possibly due to impact.

The majority of the stones have small sections of stone missing which are not structural, there is only one number stone that requires replacing in full due to the structural integrity of the unit. One number stone requires indenting due to the location becoming a water trap.

Weather condition –

At the time of the survey the weather condition was sunny with a temperature of 24 degrees.

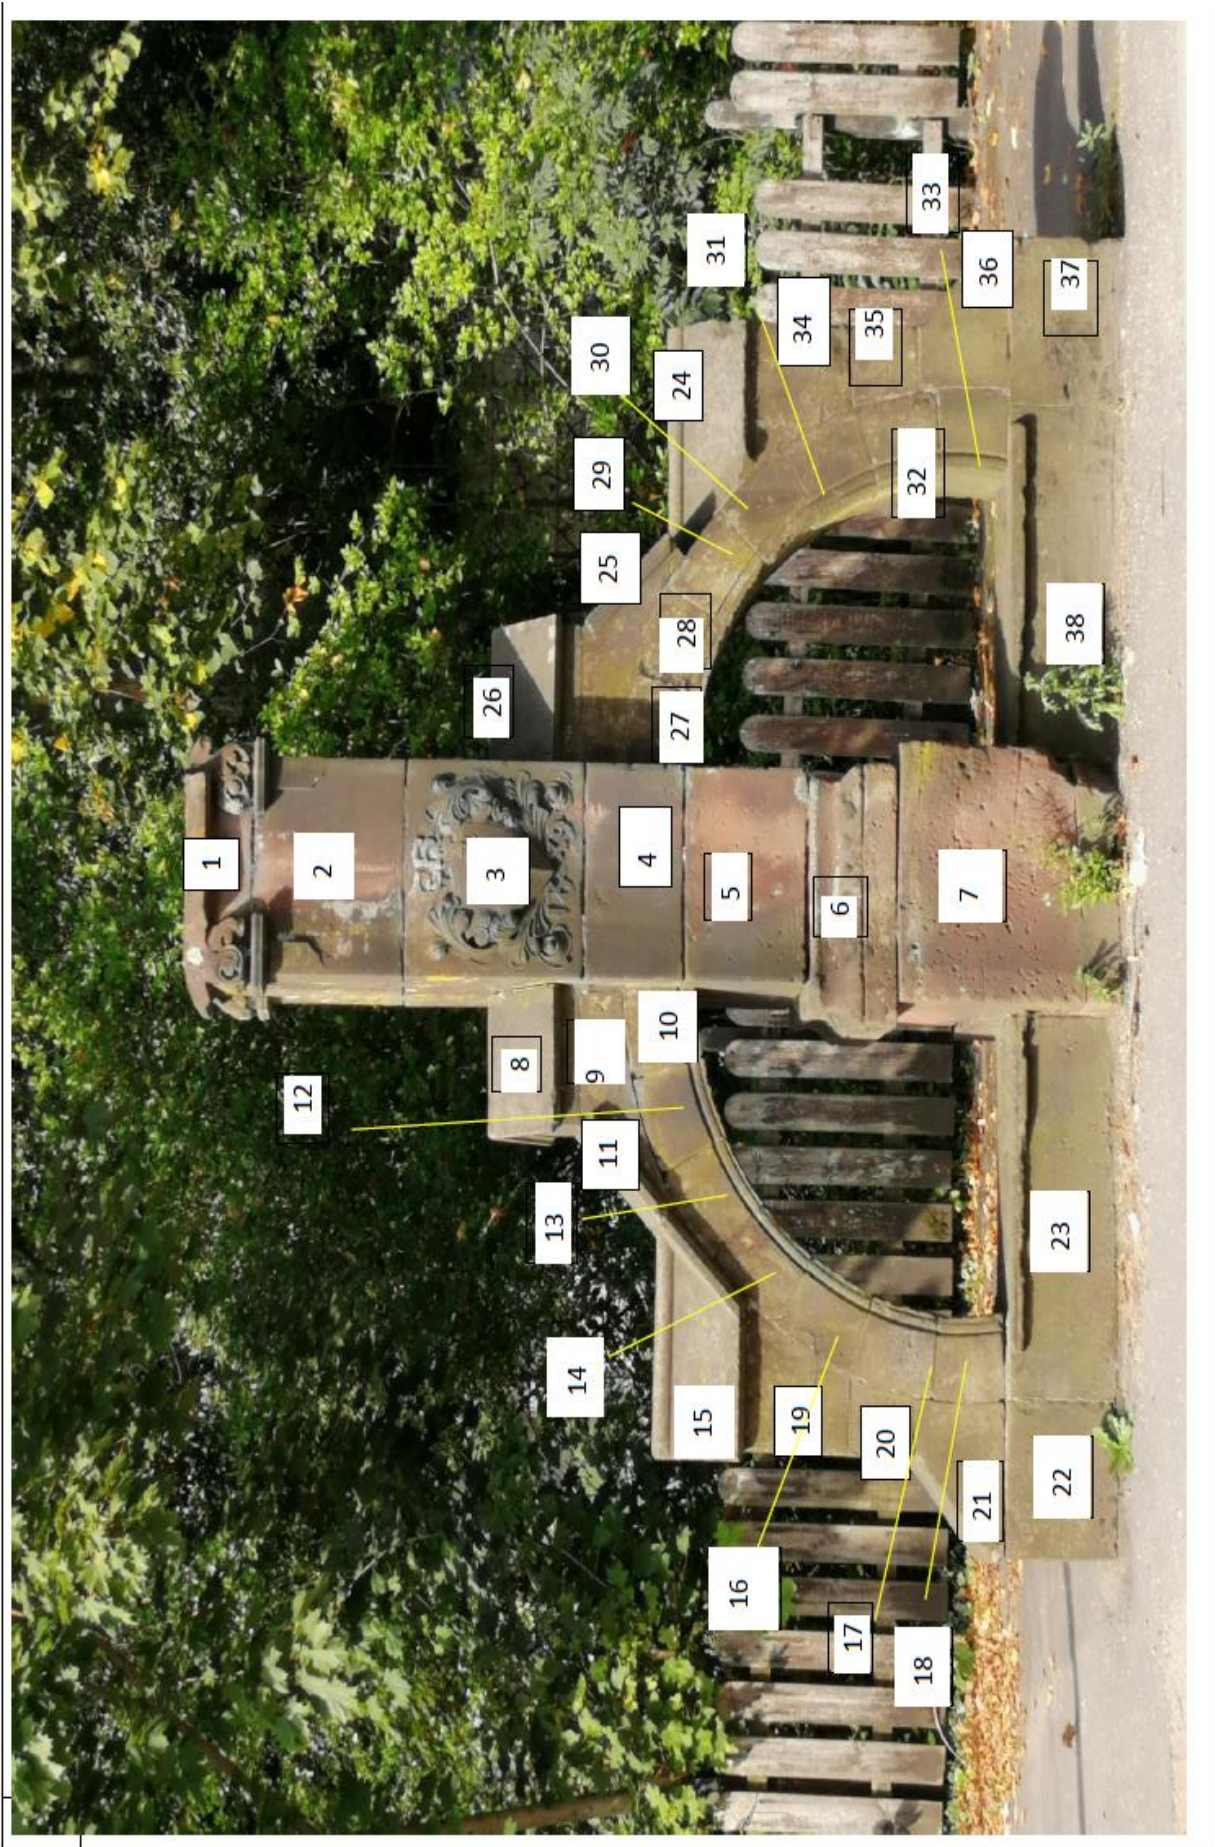



Stone number 1- Missing mouldings no work required.



Stone number 2- Radius profile to front face, corner mouldings. No work required.



Stone number 3- Radius profile to front face with coat of arms. No work required.



Stones 4&5- Radius profile to front face. No work required.



Stone number 6- Plinth dislodged. Moulded profile. No work required.



Stone number 7- Radius profile to front face. Multiple fractures to rear face and sides. Replace stone like for like 600x 600 x 640.



Stone number 8 – Coping stone with moulded profiles to 3 faces. No work required.



Stone number 9 & 11 – Coping with moulded detail on 2 faces incorporating radius ashlar. No work required.



Stones numbered 10 & 12 – Voussoir stones profiled on 2 faces. No work required.



Stones numbers 13, 14 & 16-Voussoir stones profiled on 2 faces. No work required.



Stone number 15 – Kneeler stone profiled on 3 faces. No work required



Stone numbers 17 &18- Voussoir stones profiled on 2 faces. No work required.



Stone numbers 19&20- Ashlar return stones. No work required.



Stone number 21 – Kneeler stone profiled to 1 face. No work required.



Stone number 22- Ashlar return. No work required.



Stone number23- Plinth stone profiles missing on 2 faces. No work required.



Stone number 24- Kneeler stone profiled on 2 faces. Angled section missing. Indent section 280 x 180x50



Stone number 25- Coping with moulded detail on 2 faces incorporating radius ashlar. No work



Stone number 26— Coping stone with moulded profiles to 3 faces. No work required.



Stones numbered 27-30 - Voussoir stones profiled on 2 faces. No work required.



Stones numbered 31-33 - Voussoir stones profiled on 2 faces. No work required.



Stones numbered 34-35- Ashlar return stones. No work required.



Stone number 36 - Kneeler stone profiled to 1 face. No work required.



Stone number 37- - Ashlar return. No work required.



Stone numbered 38- Plinth stone profiles missing on 2 faces. No work required