


Outline of existing raised dias / stage at first floor level.
Timber to be dismantled temporarily to allow the insertion of temporary props and access to allow the installation of the new supporting frames.
Reconstruct the stage following installation of the new structural steelwork.

2 No New structural steel frames to be fabricated using twin 90x90x8 rsa's with 8mm gusset plates and M10 black bolts.

Spreader beam to be 100x100x8 rsa bolted to the existing first floor with M8 coach screws at 300mm

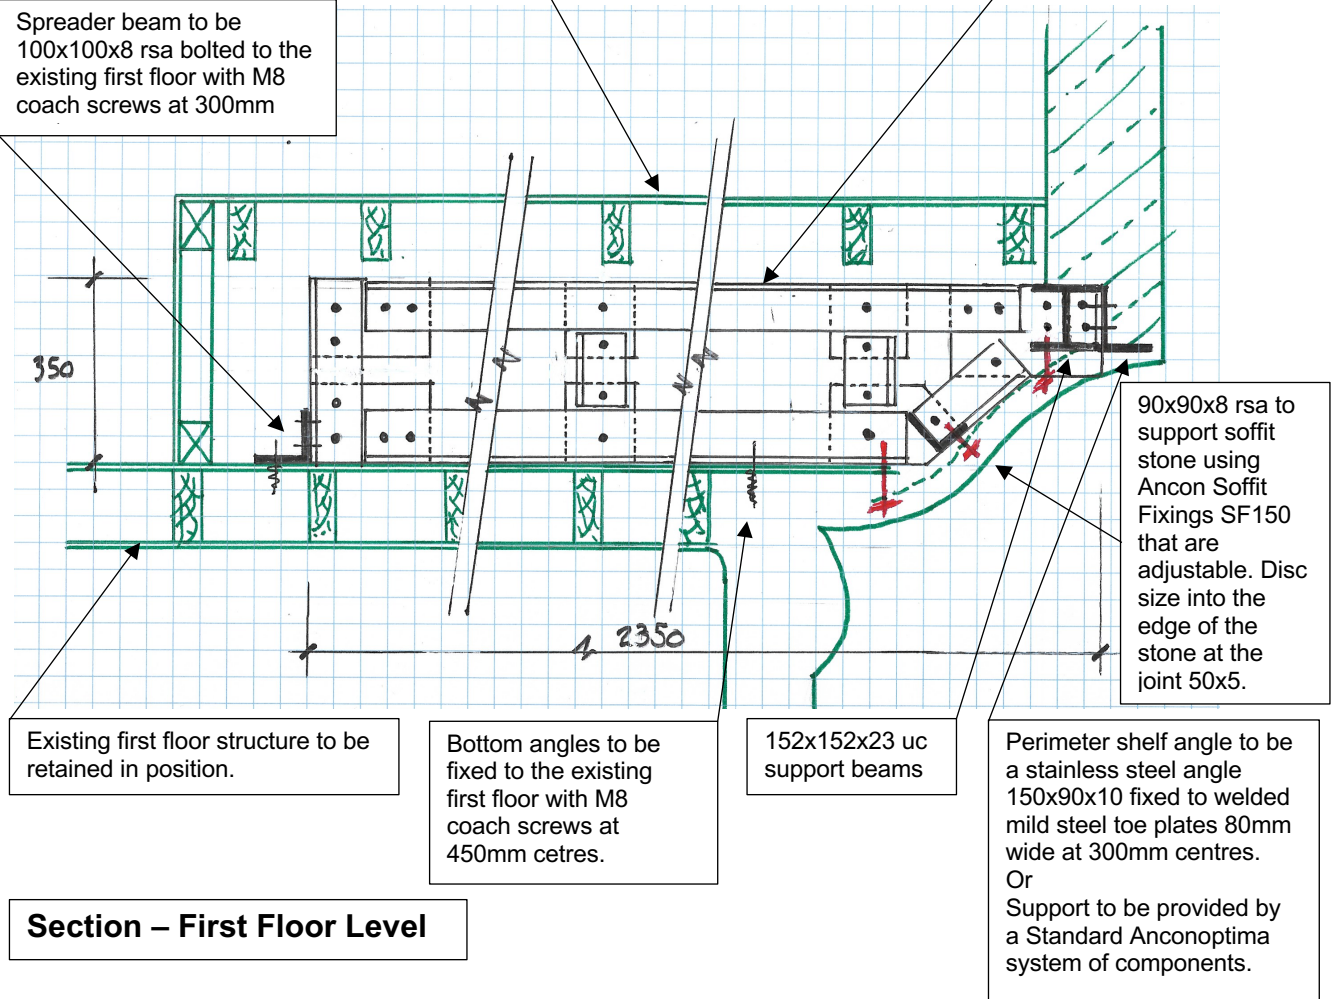

Rev A July 2023 – Issued for tender purposes.



Blackett-Ord Conservation Engineering

5th Floor, Horton House, Exchange Flags, Liverpool, L2 3PF
Tel: 0151 353 7130 - email: ian@blackett-ordconservation.co.uk

Milnrow Library
Oriol Window Repairs
New Support Details - Section

Job No: Z59 Date: June 2023 Drg No SK16 Rev A