
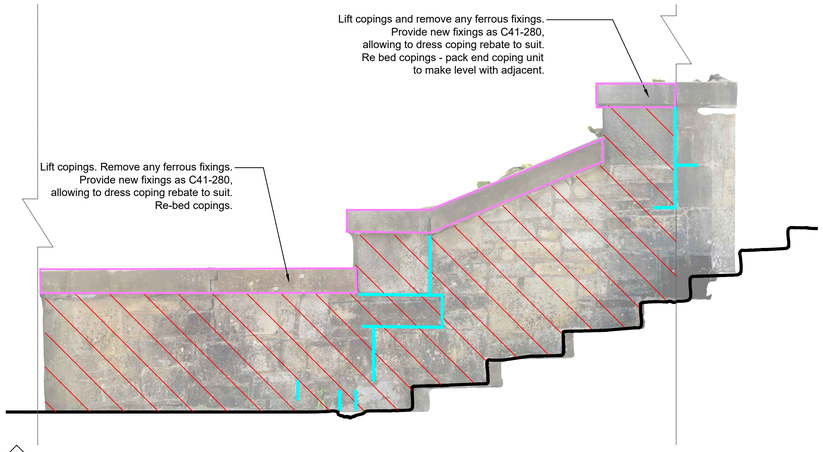


01
1:20

02
1:20

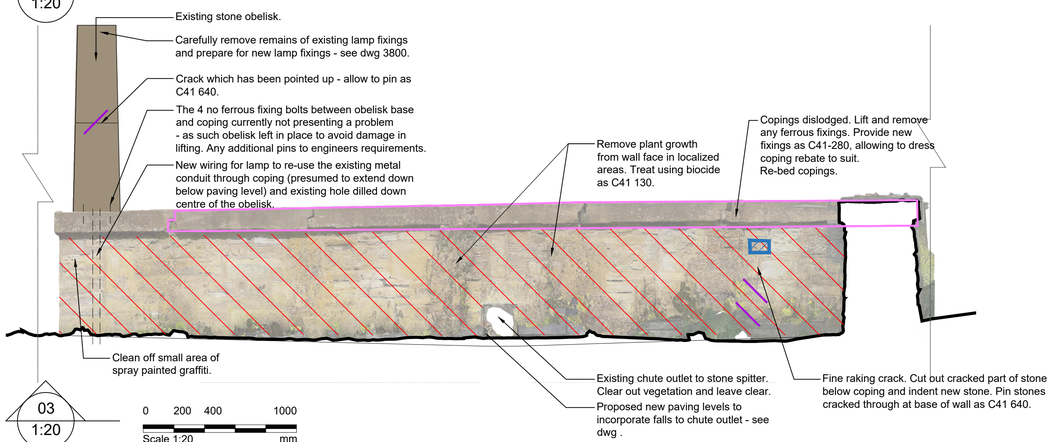


03
1:20

0 200 400 1000
Scale 1:20 mm

KEY

- Record positions of stones as C41 140 and 141, carefully take down wall as C41 310 and F20 110 and set aside stone for rebuilding. Rebuild wall as C41 320 and F20 325
- Cut out defective stonework and indent new matching stone, profiled and tooled to match existing as C41 395
- Cut out defective stone and add new stone, profiled and tooled to match existing C41 340
- Carefully rake all pointing or cement based pointing by hand without damaging areas of stone or brickwork as C41 810 and 815. Redress stone where applicable and repoint in lime mortar as approved sample panel (C41 809) and as C41 840 and 860.
- Light dress back of friable stone surface.
- Open joint with mortar loss - deep pack repoint as C41 841.
- Carefully remove stone and re-bed.
- Crack in masonry - rake out and repoint using lime based mortar. Monitor periodically.
- Crack in masonry - pin as C41 640.

KEY PLAN 1:200

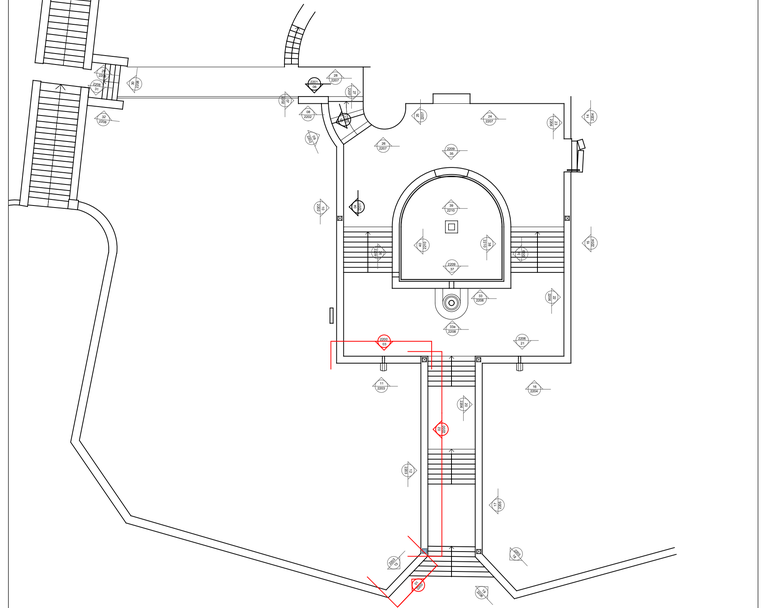

Notes

1. Any dwg format drawing is to be read in conjunction with and at the scale of the accompanying pdf.
2. Where colours other than black or grey are used, the drawing must be plotted in colour.
3. For status 'C' (Construction) drawings all dimensions are to be checked on site by the contractor, scaling is for Local Authority purposes only.
4. Unless otherwise indicated, all dimensions are in millimeters.
5. All information on this drawing is to be read in conjunction with the relevant Donald Insall Associates specification and trade contractors' drawings and information by specialists.
6. In the event of any discrepancy, please contact us immediately.
7. This drawing may contain survey information by others and is to be used solely for the purposes for which it was issued.
8. These are uncontrolled documents issued for information purposes only. If you have any queries regarding the drawings, please contact DIA immediately.
9. Please note DIA cannot be held responsible for any errors arising from changes made to an uncontrolled dwg file.

© 2019 DONALD INSALL ASSOCIATES LTD

Drawing Status

- **F** Feasibility
- **S** Sketch Design
- **P** Planning
- **B** Building Control
- **D** Developed Design
- **M** Measurement
- **T** Tender
- **C** Construction
- **R** Record

Rev	Date	Dwn	Auth	Revision
1	18-10-2024	MDP	CXD	Tender Issue
0	30-09-2024	MDP	CXD	Draft Issue

Rev	Date	Dwn	Auth	Revision

Donald Insall Associates
Chartered Architects and Historic Building Consultants

Bridgegate House, 5 Bridge Place
Chester CH1 1SA
(+44) 01244 350 063
chester@insall-architects.co.uk

Packer Spout, Broadfield Park Slopes, Rochdale

Elevations - Repairs as Proposed
Sheet 1 of 11

Project	No
RTH.05	2200

Scale (A1)	Status	Revision
1:20	T	1