

Large cement patch. Renew step.

Delaminated. Existing —
indent failed. Renew step.

Delaminated. Renew step.

Wide joint filled with _____
cement, which has cracked;
delaminated. Renew step.

- Top step has moved - lift and re-set.

— Delaminated - renew step.

— Delaminated - renew step.

- Remove cement patch and cut out and provide stone indent.

— Existing indent; surface exfoliation ponding water - renew step.

- Existing indent; surface exfoliation ponding water; undersized indent failed - renew step.


- Existing indent and crack, review on site but allow to retain step.

Remove all cement pointing and patching. Deep pack and repoint using lime based mortar - spec tbc.

- Large cement mortar patch; delaminated to back - renew step.

Unless stated the existing stone indents were sound at time of survey. Note that indent thickness is undersized in some cases.

7 no.steps.
Step riser = 160mm av.
Step going = 330mm av

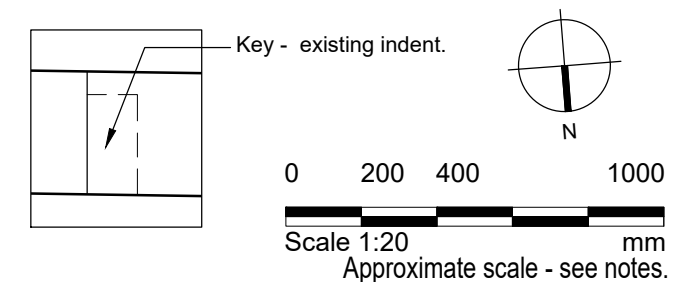

01	Plan as existing
1004	1:20 @ A3

[illegible]