



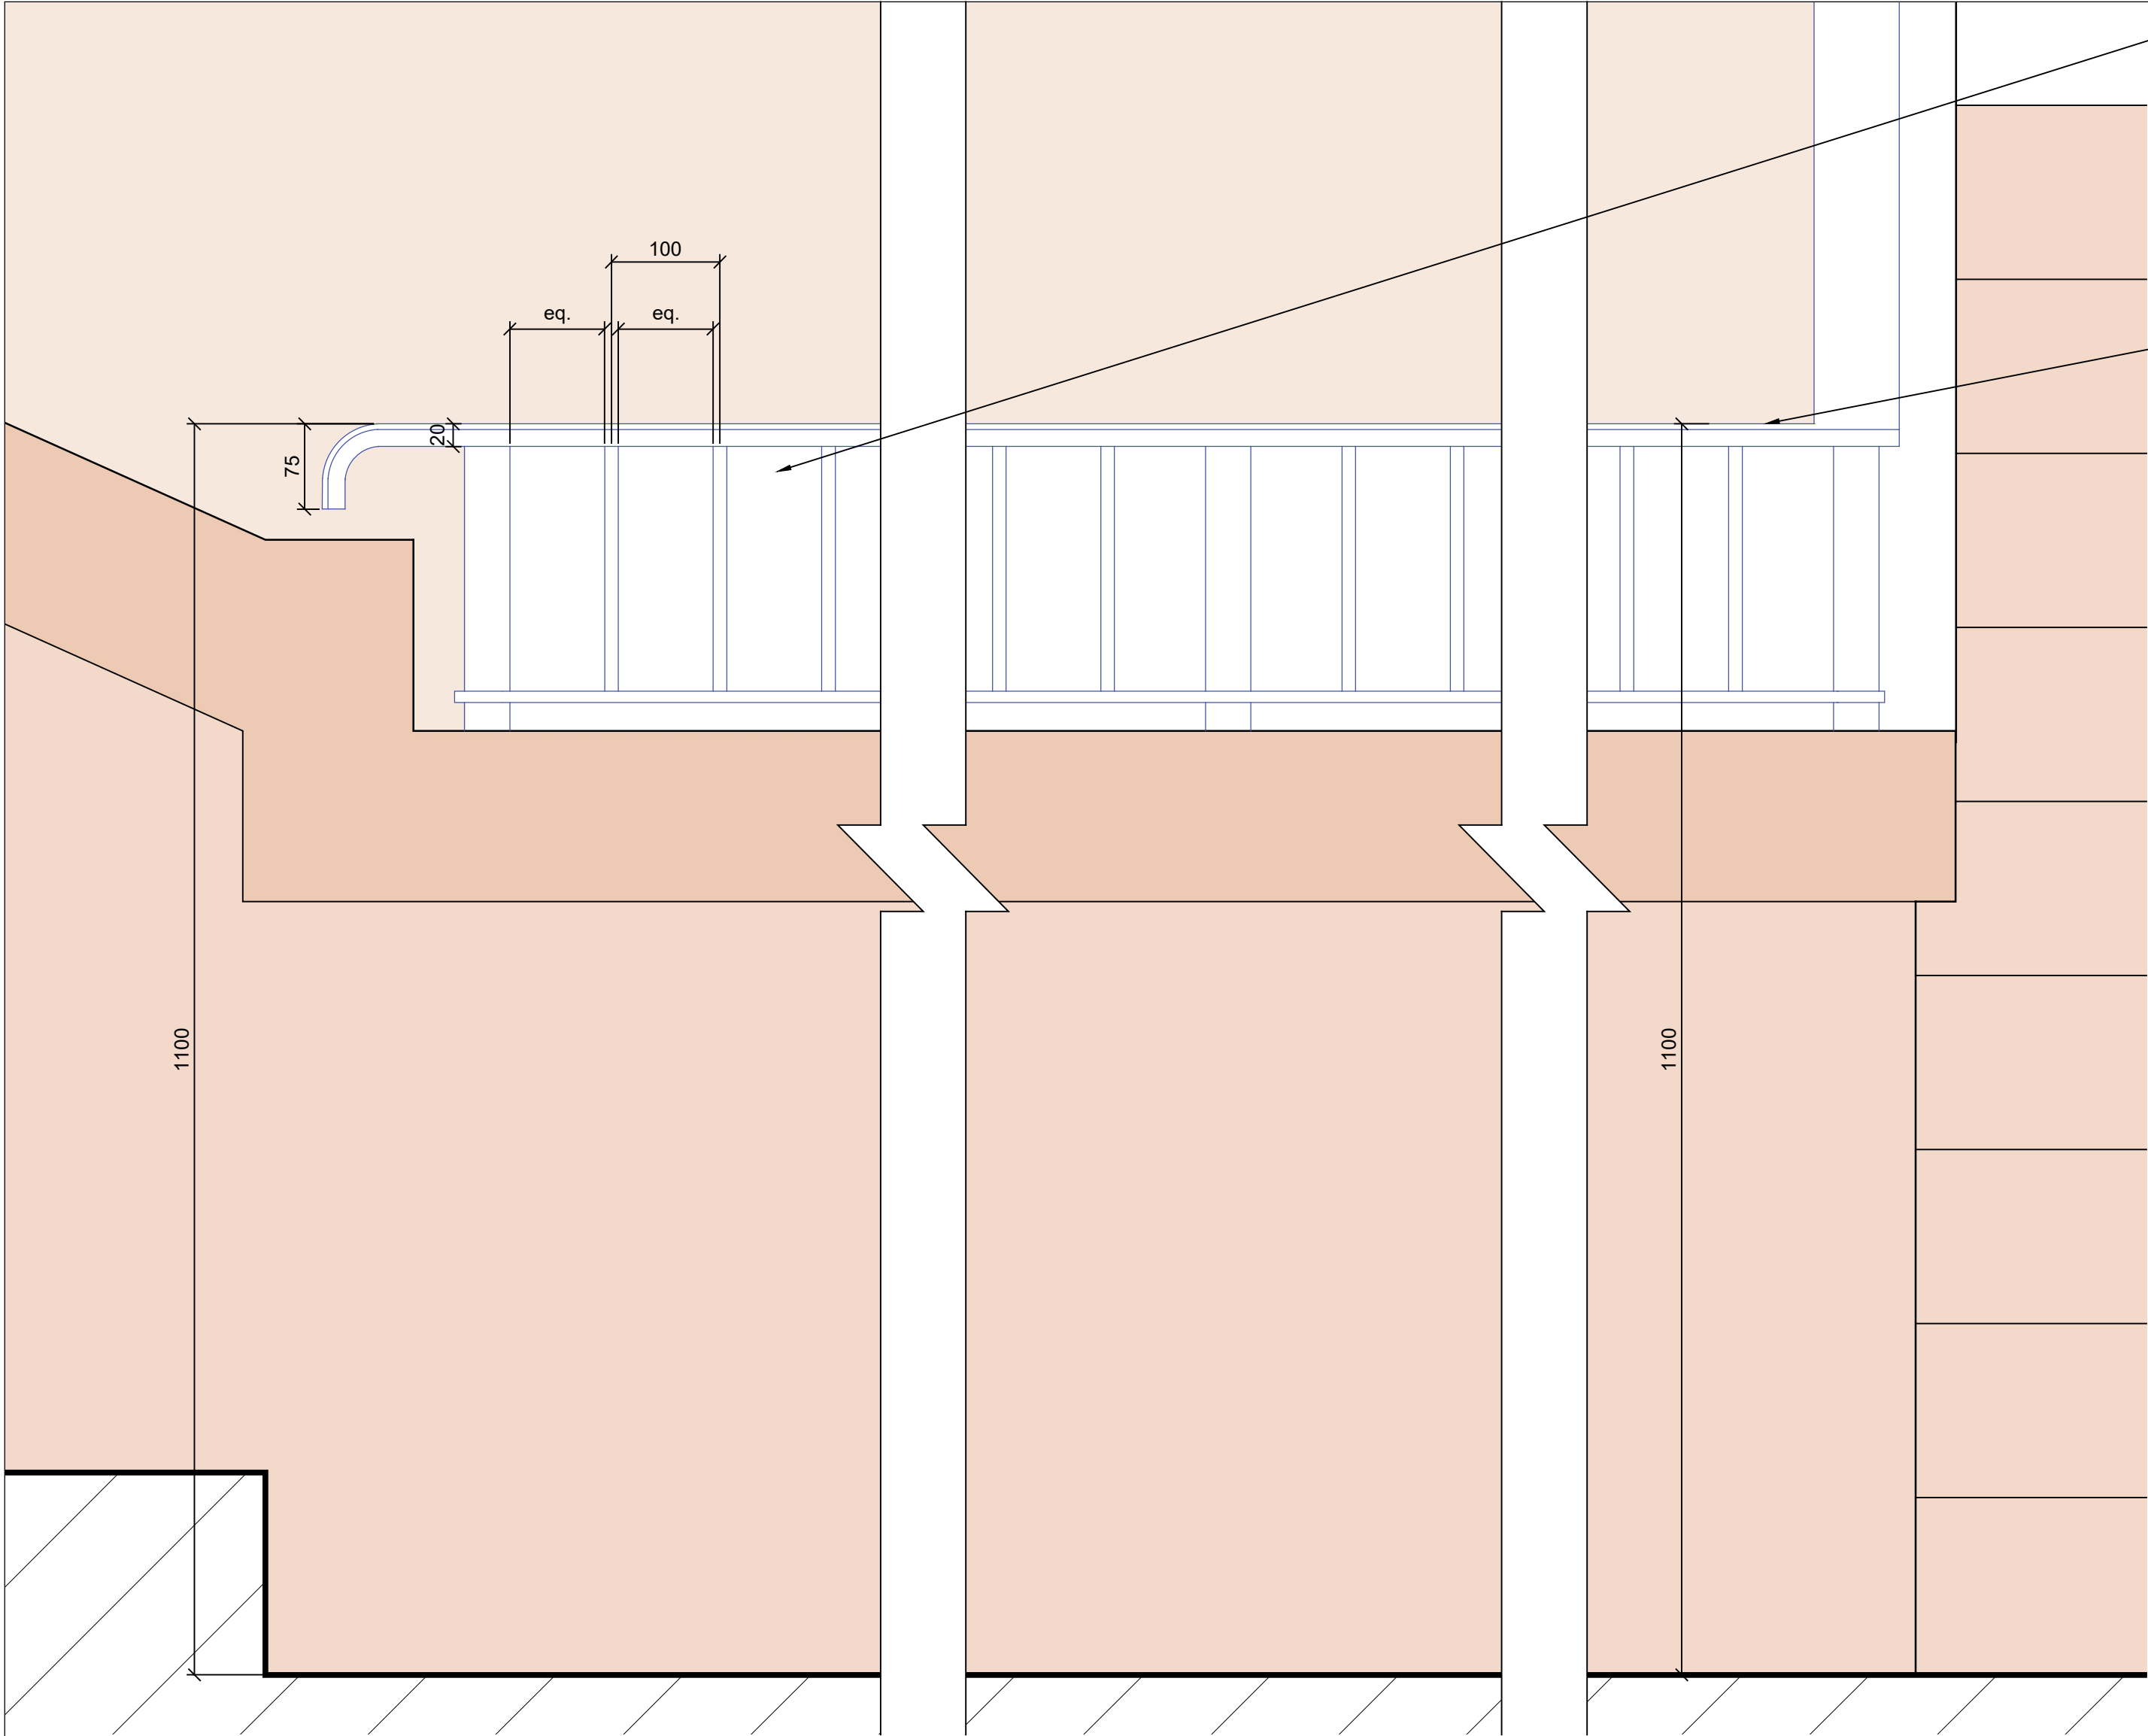

01 Elevation - Railings
3600 1:5 @ A1

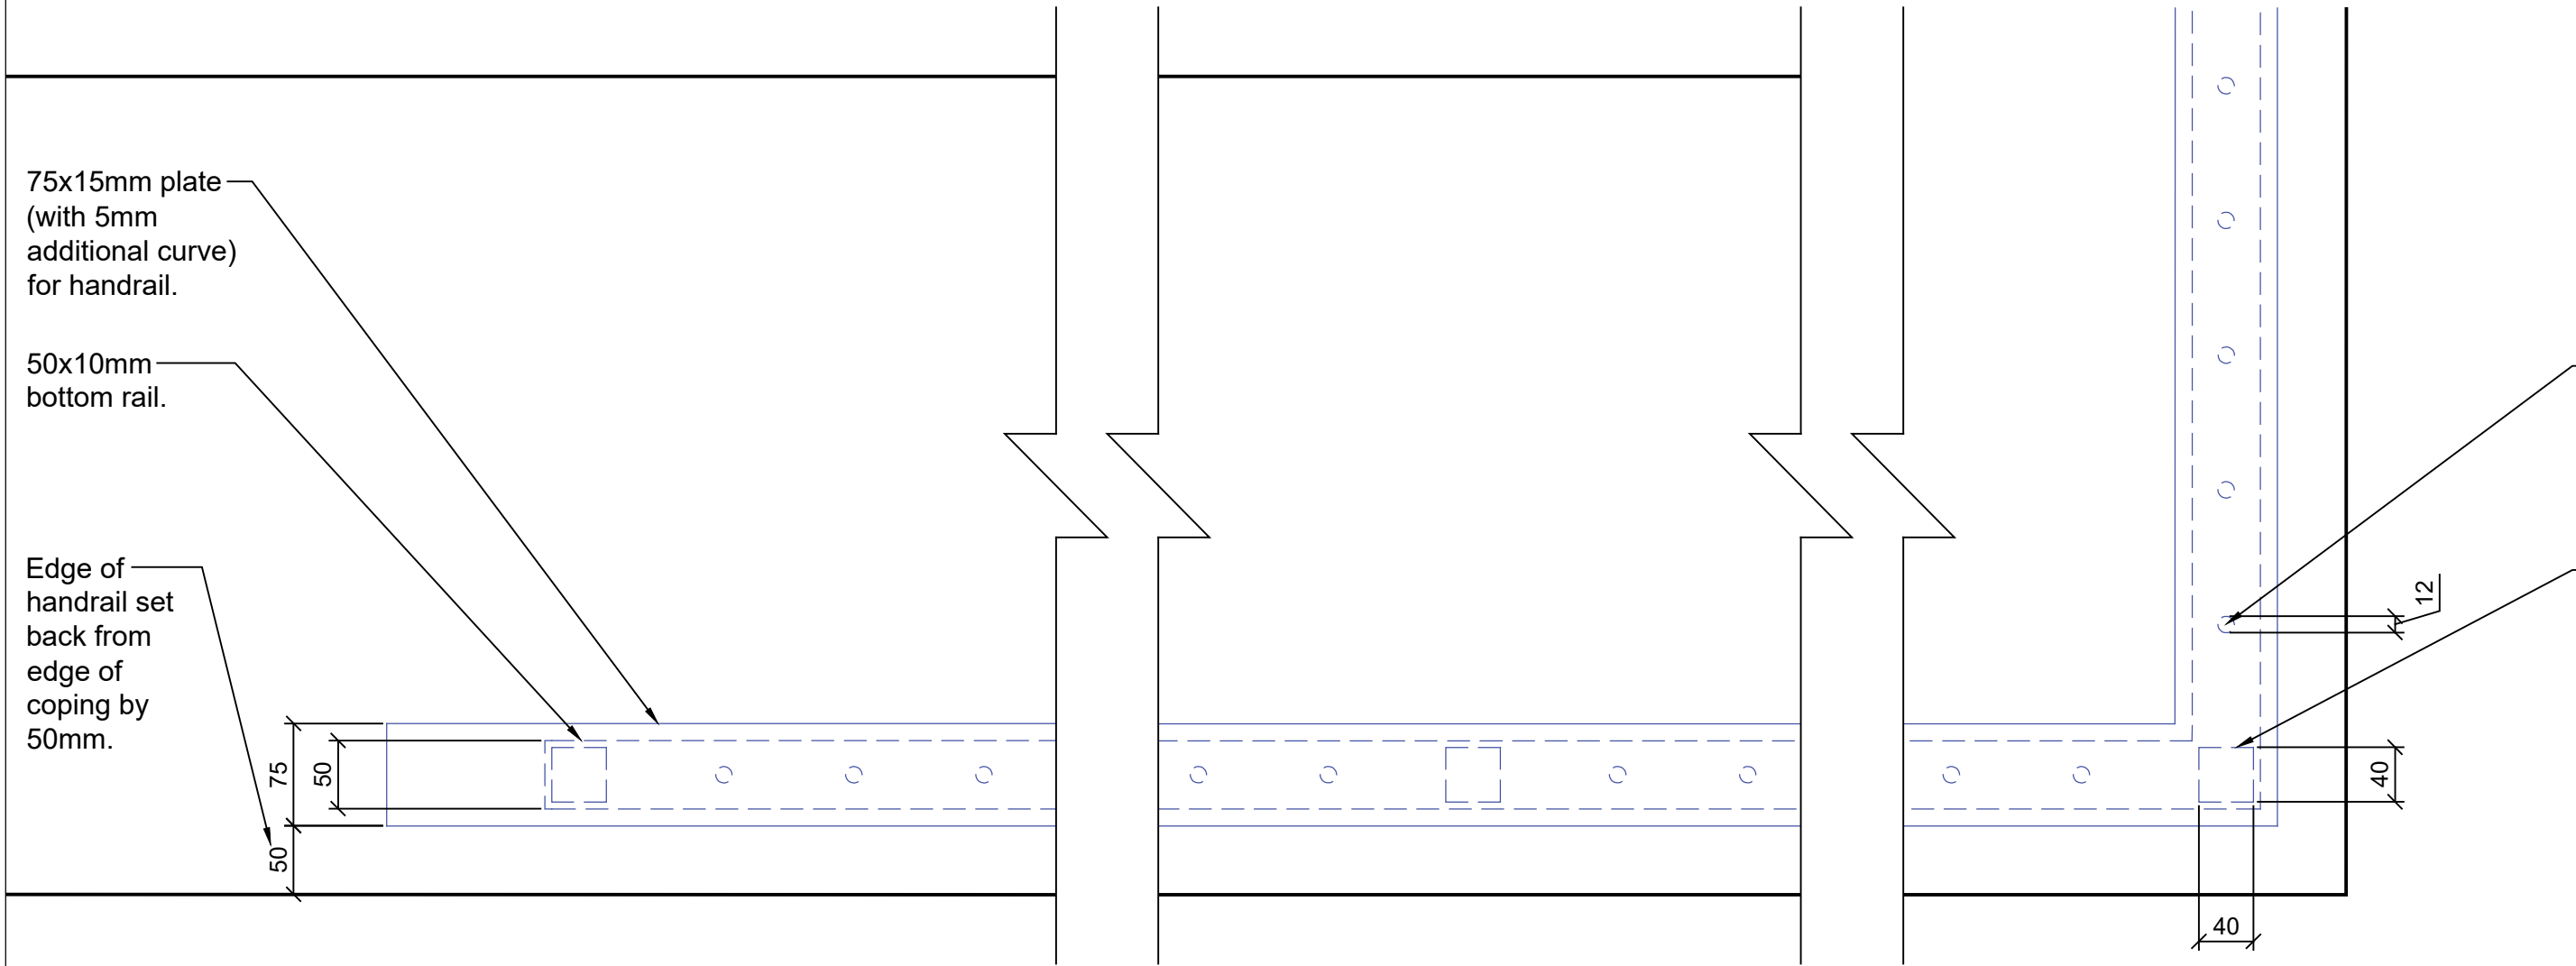


02 Plan - Railings
3600 1:5 @ A1


Gaps between railing uprights and intermediate bars to be equal.
Contractor to produce fabrication drawings for review by Architect prior to manufacture. Ensure gaps are less than 100mm.

New railing to minimum 1100mm from FFL to top of handrail. Height of railing varies, to respond to the shape of the existing fountain and to run parallel with top of coping stones.

L30 / 550 M60 / 131

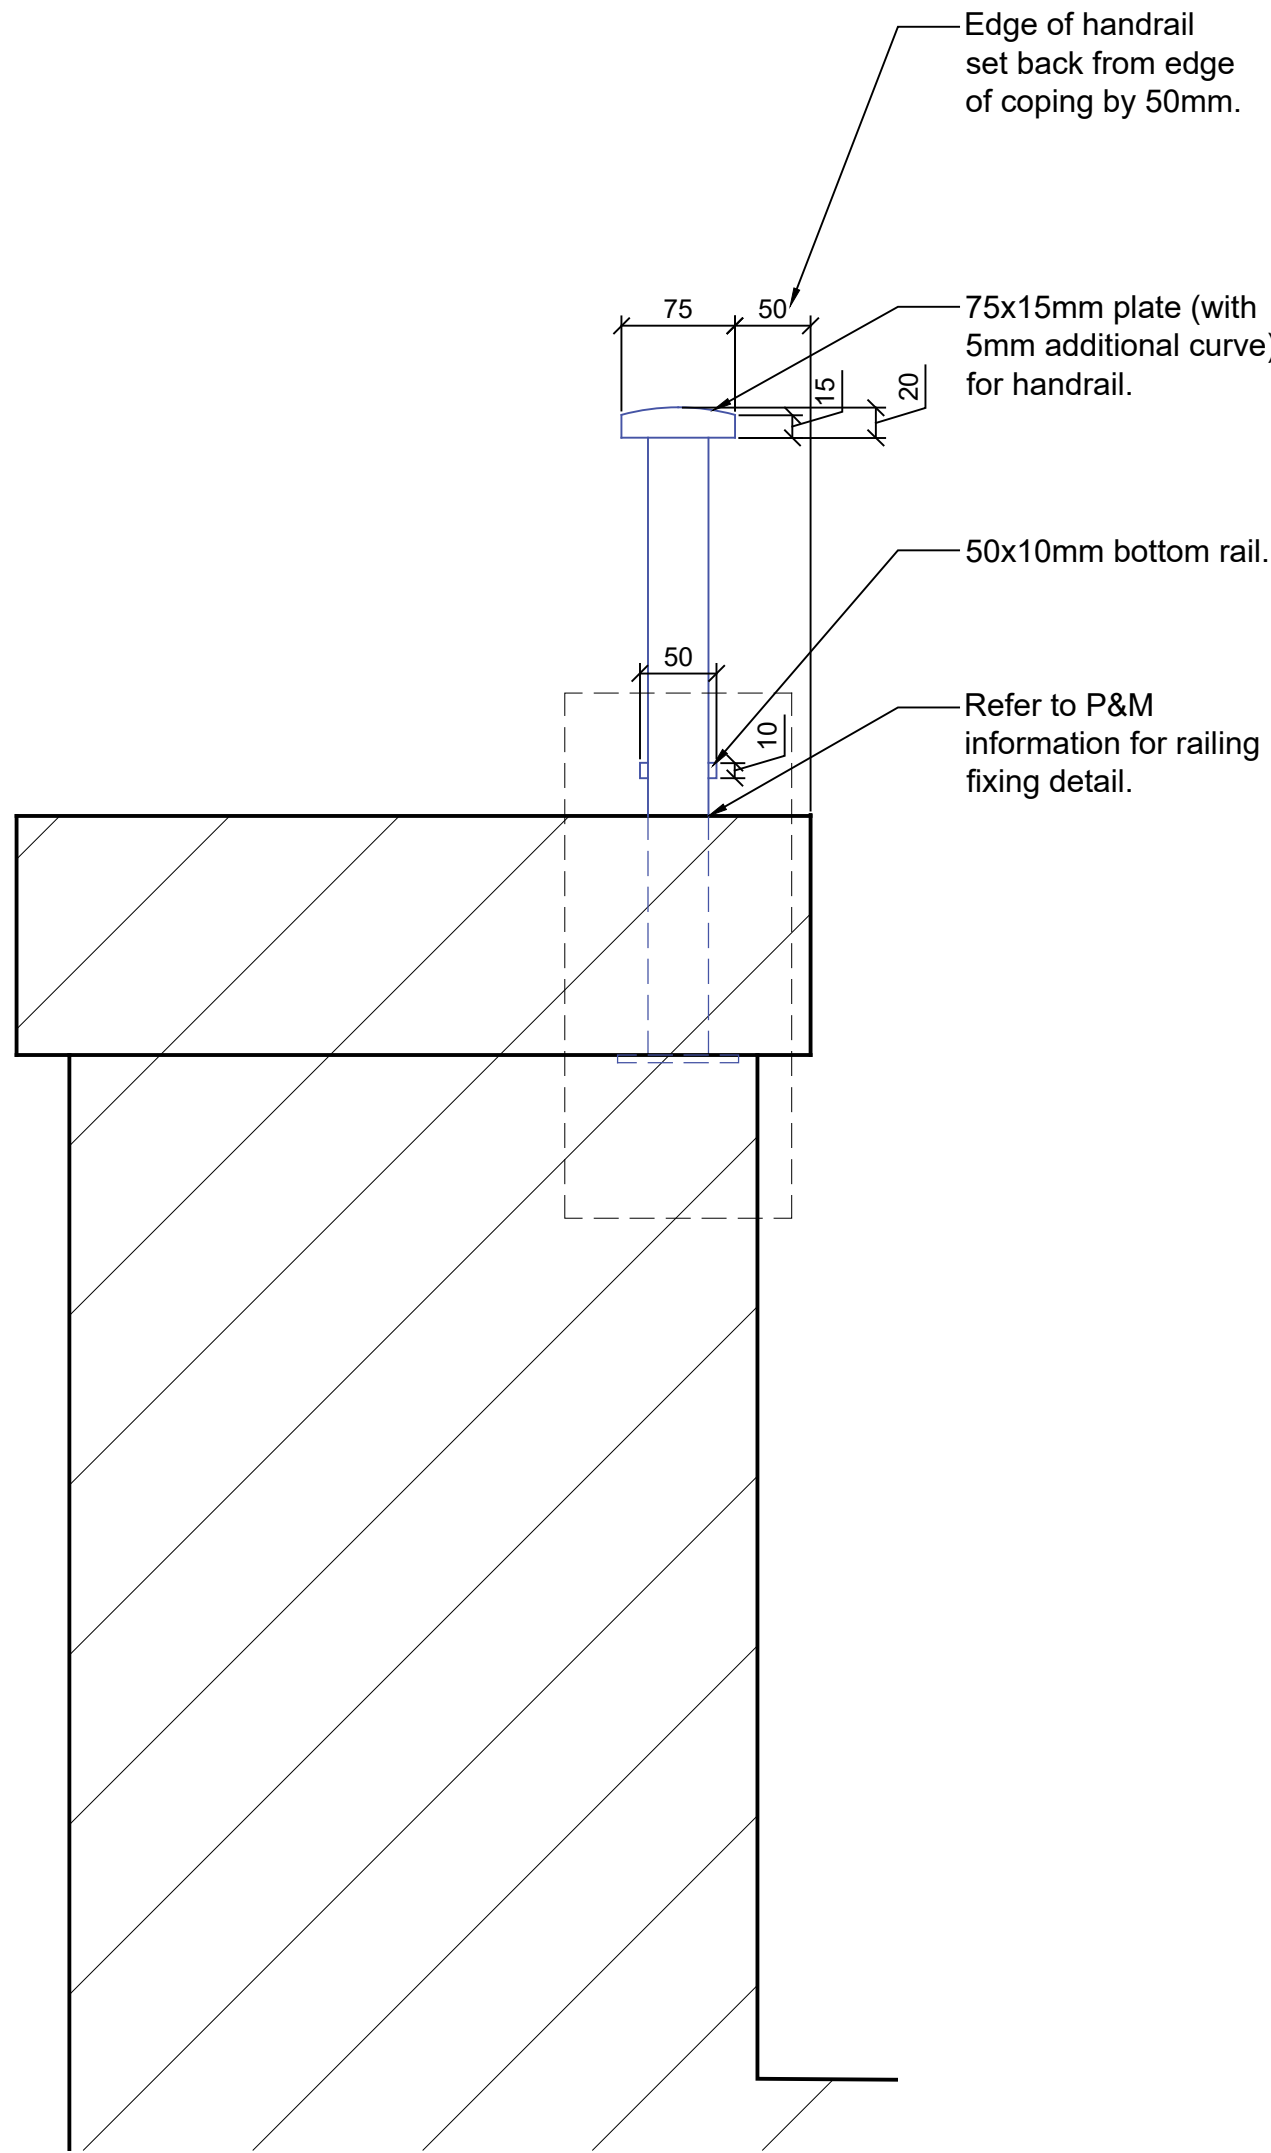

03 Section - Railings
3600 1:5 @ A1

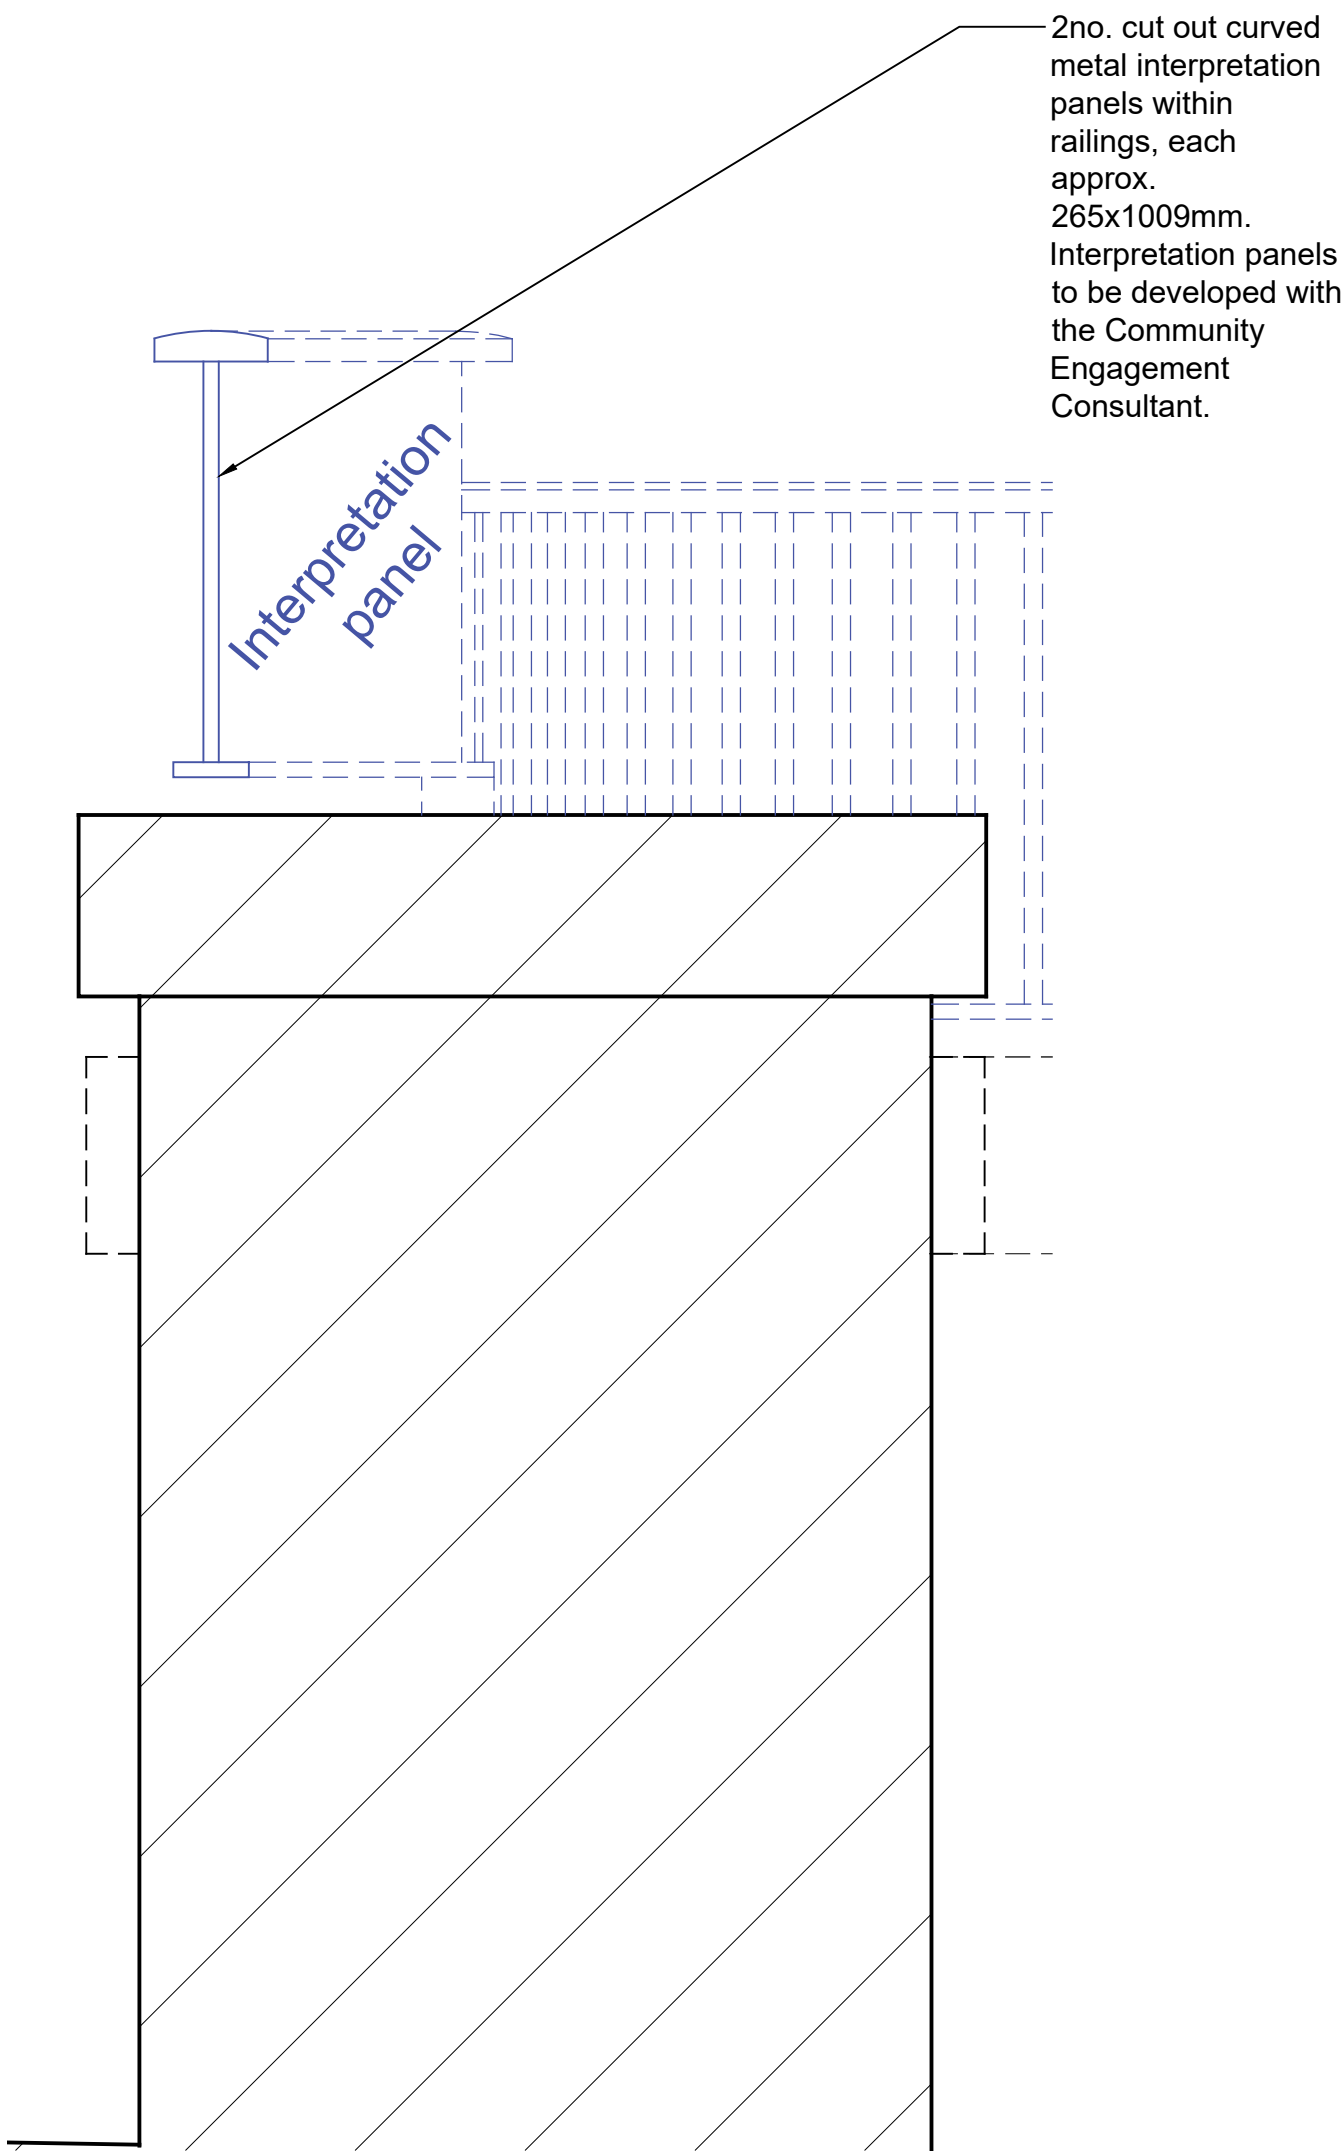

04 Section - Railings (Interpretation Panel)
3600 1:5 @ A1

GENERAL NOTES

Contractor to site measure prior to production of fabrication drawings for handrails and railings.

Unless otherwise stated existing elevations are formed from locally sourced yellow-white sandstone. New interventions are painted galvanised mild steel (refer specification sections L30/550, L30/570, M60/131, colour RAL 7022).

Repairs

Repairs to be carried-out in accordance with the Donald Insall Associates drawings 2200-2210. Repairs are not indicated on this drawing. **All existing fabric to be retained and protected unless indicated otherwise.**

Other

Drawings to be read in conjunction with Landscape Architect, Engineers, Archaeologist & Consultant information. For all structural/ civil interventions and additions refer to information provided by Price and Myers

CONFIRM ALL EXISTING DIMENSIONS ONSITE, PARTICULARLY DUE TO IRREGULARITY OF EXISTING FABRIC. THESE DRAWINGS ARE INDICATIVE ONLY

- Notes
- Any dwg format drawing is to be read in conjunction with and at the scale of the accompanying pdf.
 - Where colours other than black or grey are used, the drawing must be plotted in colour.
 - For status 'C' (Construction) drawings all dimensions are to be checked on site by the contractor, scaling is for Local Authority purposes only.
 - Unless otherwise indicated, all dimensions are in millimeters.
 - All information on this drawing is to be read in conjunction with the relevant Donald Insall Associates specification and trade contractors' drawings and information by specialists.
 - In the event of any discrepancy, please contact us immediately.
 - This drawing may contain survey information by others and is to be used solely for the purposes for which it was issued.
 - These are uncontrolled documents issued for information purposes only. If you have any queries regarding the drawings, please contact DIA immediately.
 - Please note DIA cannot be held responsible for any errors arising from changes made to an uncontrolled dwg file.

Drawing Status
F Feasibility
S Sketch Design
P Planning
B Building Control
D Developed Design
M Measurement
T Tender
C Construction
R Record

Rev	Date	Dwn	Auth	Revision
2	22-10-24	SZG	CXD	Specification clauses cross referenced on drawings.
1	18-10-24	SZG	CXD	Issued for Tender
0	30-09-24	SZG	CXD	Initial Issue - Draft tender issue.
Rev	Date	Dwn	Auth	Revision

Donald Insall Associates
Chartered Architects and Historic Building Consultants

Bridgegate House, 5 Bridge Place
Chester CH1 1SA
(+44) 01244 350 063
chester@insall-architects.co.uk

The South Slope Project, Broadfield Park

Packer Spout Railings
Proposed Details

Project	No	
RTH.05	3600	
Scale (A1)	Status	Revision
1:5	4T	2