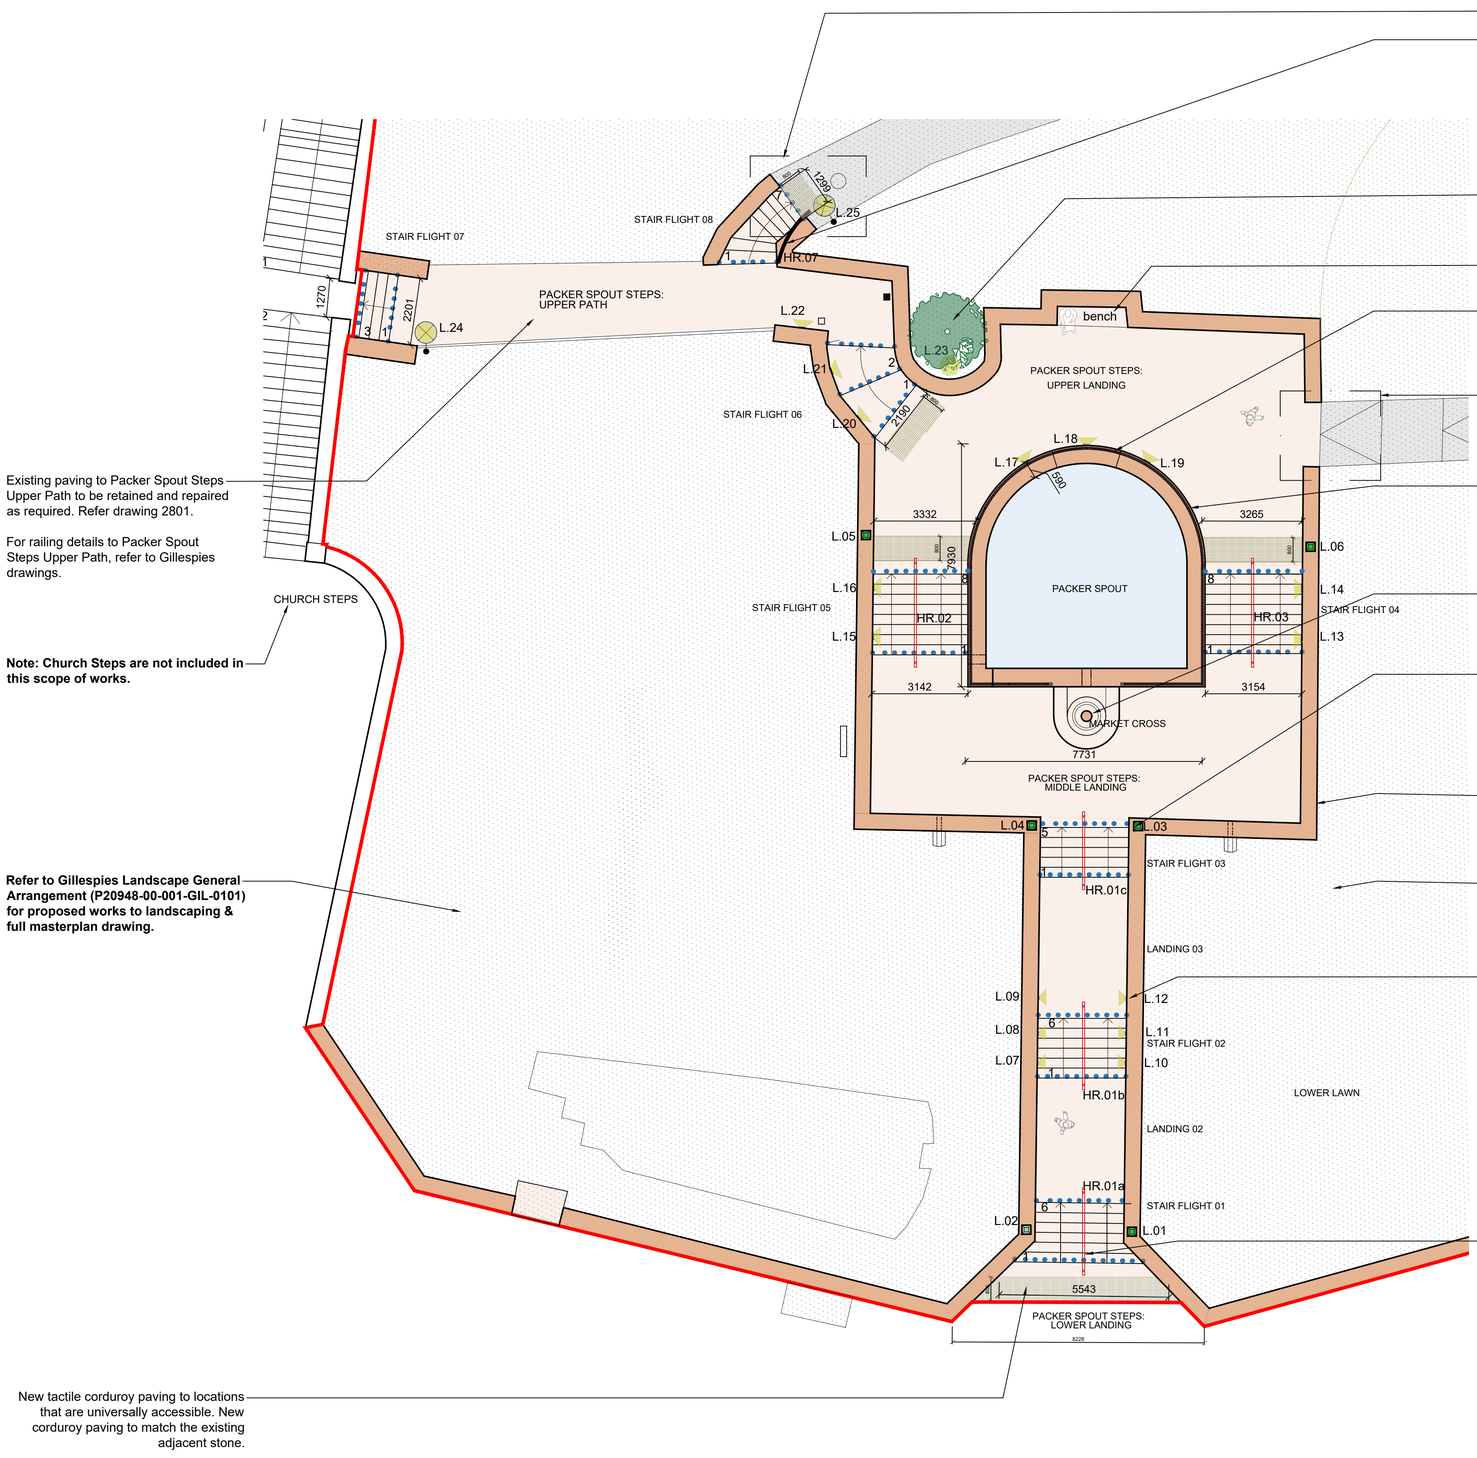


Transition from existing stone steps to new pathway.

Existing handrail at HR.07 to be retained, repaired, ensure stable and adequately fixed, and painted to match new proposed handrails.

Existing Stair Flight 08 retained and repaired as required. Refer drawing 2507.

New tree to Landscape Architect requirements, refer to Trees and Grass Planting Plan (P20948-00-001-GIL-0403). New proposed lighting to meet Lighting Consultant requirements.

Existing stone bench with decorative crest to be retained and repaired. Refer drawing 2207 (Elevation 24).

Cut out metal interpretation panels to railings, refer drawing 3600 (Section 04). Interpration panels to be developed further with Community Engagement Consultant.

Transition from existing stone landing to new pathway. For detail of ramp refer to Gillespies drawing Upper Access Ramp (P20948-00-001-GIL-0313).

Existing paving to Packer Spout Steps Upper Path to be retained and repaired as required. Refer drawing 2801.

For railing details to Packer Spout Steps Upper Path, refer to Gillespies drawings.

Existing railings removed and affected areas made good as required, refer drawings 2209 and 2210. New proposed railing installed to Packer Spout, with 2no. integrated interpretation panels to be developed with the Community Engagement Consultant. Refer drawings 2101, 2102 and 2103.

The Market Cross is a GII Listed structure. To be retained onsite and repaired as required. Refer drawing 2208 (Elevation 33a).

Note: Church Steps are not included in this scope of works.

Missing historic light fitting to existing obelisks to be replaced with new, refer to Lighting Consultant information for details. Lighting at L.04/ L.03 to be arranged to illuminate the Market Cross.

Refer to Price & Myers detail for proposed underpinning to Packer Spout walls.

Refer to Gillespies Landscape General Arrangement (P20948-00-001-GIL-0101) for proposed works to landscaping & full masterplan drawing.

Refer to Gillespies Landscape General Arrangement (P20948-00-001-GIL-0101) for proposed works to landscaping & full masterplan drawing.

New surface mounted lighting to side walls of stairs to meet Lighting Consultant requirements. Refer to the Lighting Consultant for information.

New central handrail to Stair Flight 01-03 and 04-05.

New tactile corduroy paving to locations that are universally accessible. New corduroy paving to match the existing adjacent stone.

GENERAL NOTES

Unless otherwise stated existing elevations are formed from locally sourced yellow-white sandstone. New interventions are painted galvanised mild steel.

Limited access available at time of survey. All elements to be assessed by fingertip survey upon provision of access.

Other
Drawings to be read in conjunction with all Consultant information. For structural/ civil interventions and additions refer to information provided by Price and Myers.

CONFIRM ALL EXISTING DIMENSIONS ONSITE, PARTICULARLY DUE TO IRREGULARITY OF EXISTING FABRIC. THESE DRAWINGS ARE INDICATIVE ONLY

NEW INTERVENTION KEY

Metal to all interventions to coordinated finish (handrails, railings, signage, lighting etc). Painted galvanised mild steel.

Existing fabric (primarily stone)
To be retained and repaired unless noted otherwise. Repairs to be carried-out in accordance with the Donald Insall Associates drawings 2200-2210. Repairs are not indicated on this drawings.

New Proposed Landscaping Works
Refer to Gillespies' Masterplan for detail.

Existing railings to Packer Spout Fountain to be removed and new tactile high-quality railings to painted metal finish to be instated (RAL 7022). Opportunity for interpretation at the railings to be developed with the Community Engagement Consultant.

HR.XX New tactile high-quality handrail to stairs, metal to painted finish (RAL 7022). Refer to drawings for general information.

L.01, L.03 - L.06 Existing sandstone obelisk with new light to top. Refer to the Lighting Consultant for further information.

L.02 New sandstone obelisk to replace missing, to match existing adjacent. New light to top to match adjacent. Refer to the Lighting Consultant for further information.

L.07 - L25 New proposed lighting. Refer to the Lighting Consultant for further information.

Key intersection of new landscaping design and existing historic fabric.

Packer Spout reinstated, to Landscape Architect design.

New tactile 'corduroy' paving, to finish to match adjacent stone. **Q25/320**.

New proposed metal disks to highlight nosings, fixed to surface of indicated step goings. **Q25/490**.

Note: new interpretation to be developed in coordination with the Public Engagement Consultant. Interpretation is not indicated on this drawing.

Note: Refer to the Lighting Consultant information for full details of the new proposed lighting.

SITE LOCATION PLAN

Notes
1. Any dwg format drawing is to be read in conjunction with and at the scale of the accompanying pdf.
2. Where colours other than black or grey are used, the drawing must be plotted in colour.
3. For status 'C' (Construction) drawings all dimensions are to be checked on site by the contractor, scaling is for Local Authority purposes only.
4. Unless otherwise indicated, all dimensions are in millimeters.
5. All information on this drawing is to be read in conjunction with the relevant Donald Insall Associates specification and trade contractors' drawings and information by specialists.
6. In the event of any discrepancy, please contact us immediately.
7. This drawing may contain survey information by others and is to be used solely for the purposes for which it was issued.
8. These are uncontrolled documents issued for information purposes only. If you have any queries regarding the drawings, please contact DIA immediately.
9. Please note DIA cannot be held responsible for any errors arising from changes made to an uncontrolled dwg file.

© 2019 DONALD INSALL ASSOCIATES LTD

Drawing Status
F Feasibility
S Sketch Design
P Planning
B Building Control
D Developed Design
M Measurement
T Tender
C Construction
R Record

Rev	Date	Dwn	Auth	Revision
8	18-10-24	SZG	CXD	Issued for Tender
7	30-09-24	SZG	CXD	Draft tender issue.
6	18-09-24	SZG	CXD	Issued for Coordination
5	22-12-23	SRS	CXD	Issued for Planning
4	16-10-23	SRS	CXD	Lighting updated
3	09-10-23	SRS	CXD	NLHF R2 Design Freeze - Issued for review and comment
2	16-08-23	SRS	CXD	Refer to drawing
1	04-07-23	SRS	CXD	For information only, WORK IN PROGRESS
1	21-06-23	ECL	CXD	Initial Issue
0	16-06-23	SRS	CXD	Initial Issue

Donald Insall Associates
Chartered Architects and Historic Building Consultants
Bridgegate House, 5 Bridge Place
Chester CH1 1SA
(+44) 01244 350 063
chester@insall-architects.co.uk

The South Slope Project, Broadfield Park

Packer Spout Steps & Fountain
Proposed Works _ Key Plan

Project	No
RTH.05	2003
Scale (A1)	Status / Revision
1:100	4T / 8