



Arboricultural
Impact Assessment
with
Arboricultural Method Statement

**Ashworth Valley
Ashworth Road
Rochdale
OL11 5UP**

Project No. AIA.13781.02

4th March 2024

www.godwins.co.uk
info@godwins.co.uk
0800 030 4045

SUMMARY

Twenty-seven individual trees, fifteen groups of trees and two hedges were recorded. In accordance with *BS5837:2012 Trees in relation to design, demolition and construction* one group of trees was recorded as retention category 'A'; nine individual trees and one group of trees were recorded as retention category 'B'; and a mixture of seventeen individual trees, thirteen groups of trees and two hedges were recorded as retention category 'C'.

The trees were generally found to be in good to fair condition, however, one individual tree (**T38**) was classified as retention category 'U' (unsuitable for retention).

We have been informed that trees within the survey site are protected by a Tree Preservation Order, but that the site is not located within a Conservation Area. The protected trees are located away from the proposed construction area.

The proposed development directly impacts several trees. These trees shall require removal due to their close proximity to construction activity. All the trees proposed for removal are considered to be low-quality ('C' category) specimens, many of which are self-seeded.

The retained trees will be protected to British Standard *BS5837:2012 Trees in relation to design, demolition and construction* to ensure that they remain in a healthy condition during and post-development. The *Tree Protection Plan* to the rear of this report highlights the recommended tree protection measures.

Any arboricultural work undertaken should be done so by a competent arborist in line with British Standard *BS3998:2010 Tree Work*, and after permission has been granted to do so by the local planning authority.

It is recommended that a detailed tree risk assessment is undertaken post-development to identify any potential hazards obscured during the initial tree survey and is used to inform an arboricultural management strategy. It is advisable to have trees inspected by a suitably qualified arboriculturist regularly and we would advise that trees are inspected for safety and management on an annual basis as a minimum.

CONTENTS

1. Introduction.....	1
1.1. Project outline	1
1.2. Scope of this report	1
1.3. Data collection.....	1
2. Arboricultural Constraints	2
2.1. Tree retention categories.....	2
2.2. Tree age class and condition	2
2.3. Root Protection Areas	3
2.4. Tree protection status.....	3
3. Arboricultural Impact Assessment	4
3.1. The proposed development.....	4
3.2. Proposed tree works	4
3.3. Site construction traffic.....	5
3.4. Hard surfaces within the RPA	5
3.5. Post development impacts	5
4. Arboricultural Method Statement.....	6
4.1. Tree works prior to development.....	6
4.2. Tree protection barriers.....	6
4.3. Hard surfaces within the RPA – Minimum-Dig.....	6
4.4. Services within the RPA	7
4.5. Fencing within the RPA	7
Drawing 1. Tree Constraints Plan	9
Drawing 2. Tree Protection Plan.....	10
Appendix 1. Tree Schedule	11
Appendix 2. Explanatory Notes	12
Appendix 3. Report Limitations & General Guidelines	15
Appendix 4. Protective Barrier Construction.....	17
Appendix 5. Statutory Tree Protection Check Results	20

1. Introduction

1.1. Project outline

- 1.1.1. This report has been produced in accordance with *British Standard BS5837: 2012 Trees in relation to design, demolition and construction* to achieve a harmonious and sustainable relationship where tree retention or planting is proposed in conjunction with nearby construction (site-based operations with the potential to affect existing trees).

1.2. Scope of this report


- 1.2.1. This report has been produced to comply with planning requirements where trees are to be considered as part of a proposed development. To achieve this, arboricultural constraints have been identified and a detailed plan (*Tree Constraints Plan*) has been produced showing the location, root protection areas and retention category of trees within the site.
- 1.2.2. In addition, this report provides an *Arboricultural Impact Assessment* that evaluates the direct and indirect effects of the proposed development, and where necessary makes recommendations for mitigation measures. This report also includes *Tree Protection Measures* and a *Tree Protection Plan* as part of an outline *Arboricultural Method Statement*, which demonstrates how the retained trees will be protected during construction, and where tree protection measures are to be implemented.
- 1.2.3. Recommendations for tree works within this report are specific to the construction of the proposed development. This report does not form part of a tree safety inspection or tree management strategy, and general arboricultural management works may be required post-development. To manage the safety and risk from trees it is advised that trees are inspected in detail for this purpose by an arboriculturist using a suitable risk management strategy.

1.3. Data collection

- 1.3.1. A ground-level inspection was undertaken by Godwins on 1st December 2023. As recommended by *BS5837*, the position of all trees within the site with a stem diameter of 75mm or more, measured at 1.5m above the highest adjacent ground level is recorded. The position of trees with an estimated stem diameter of 75mm or more that overhang the site or are located beyond the site boundaries within a distance of up to 12 times their estimated stem diameter was also recorded. For individual trees the crown spread was taken at four cardinal points; for tree groups, the overall extent of the canopy was recorded.
- 1.3.2. Tree positions were plotted using a topographical plan supplied by the client, which is the basis for which the *Tree Constraints Plan* has been prepared.

2. Arboricultural Constraints


2.1. Tree retention categories

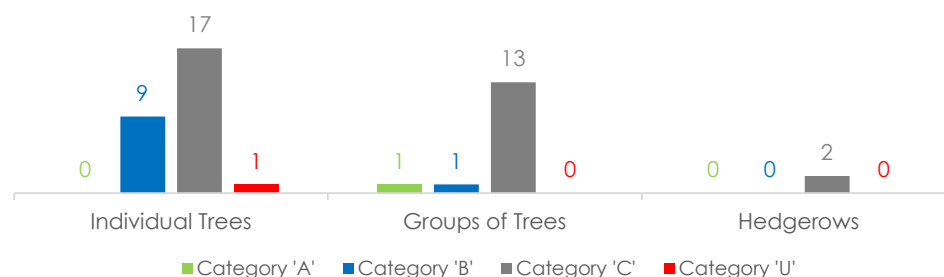

2.1.1. Twenty-seven individual trees, fifteen groups of trees and two hedges were recorded. In accordance with *BS5837:2012 Trees in relation to design, demolition and construction* one group of trees was recorded as retention category 'A'; nine individual trees and one group of trees were recorded as retention category 'B'; and a mixture of seventeen individual trees, thirteen groups of trees and two hedges were recorded as retention category 'C'.

2.1.2. The trees were generally found to be in good to fair condition, however, one individual tree (**T38**) was classified as retention category 'U' (unsuitable for retention).

2.2. Tree age class and condition

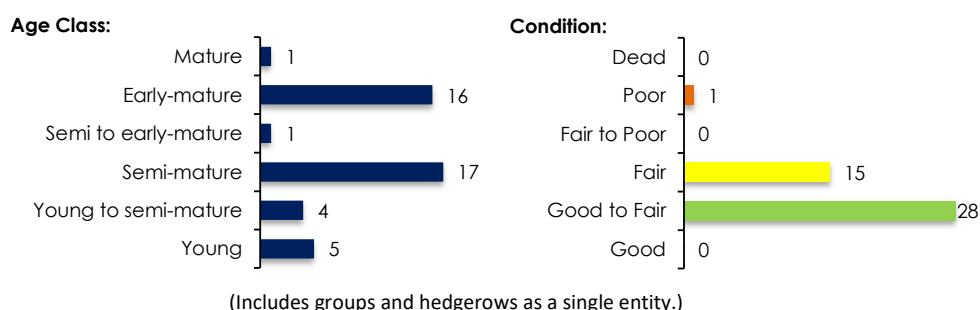

2.2.1. Please see *Appendix 1* for the detailed list of existing species, age class, dimensions and condition of trees within the site, and *Appendix 2* for an explanation of retention category criteria. Tree locations can be seen on the *Tree Constraints Plan* at the rear of this report (*Drawing 1*).

2.2.2. The inspection of several trees and groups was restricted as detailed in *Appendix 1*. The inspection of these trees was limited to a cursory observation of the parts of the trees that could be clearly observed, without obstruction, from the available vantage point. However, sufficient tree-related data was collected to fulfil the requirements detailed within the scope of this report.

- 2.2.3. Where inspections are limited by restrictions such as stem ivy, understory vegetation, limited access, epicormic growth or being located on adjacent land, any form of tree condition hazard assessment was restricted. A full assessment of the levels of risk posed by trees can only be informed by considering site use together with assessing any hazards present within a tree. Trees are dynamic structures that continue to develop and decline; in addition, changes in site use are likely to occur during and as a result of the proposed development. On this basis, it is recommended that a suitably timed, detailed tree risk assessment is undertaken post-development to identify any potential hazards obscured during the initial tree survey, and is used to inform an arboricultural management strategy.
- 2.2.4. It is advisable to have trees inspected by a suitably qualified arboriculturist regularly and we would advise that trees are inspected for safety and management on an annual basis as a minimum.

2.3. Root Protection Areas

- 2.3.1. The tree Root Protection Area (RPA) is a layout design tool indicating the area around a tree that, along with the tree stem and branches, must be considered during development. The protection of the roots and soil structure within the RPA should be treated as a priority. The RPA of each tree or group is marked on the *Tree Constraints Plan* at the rear of this report.

2.4. Tree protection status

- 2.4.1. A statutory tree protection check was made with Rochdale Borough Council on 26th February 2024. We have been informed that trees within the survey site are protected by a Tree Preservation Order, but that the site is not located within a Conservation Area. The protected trees are located away from the proposed construction area. Please see *Appendix 5* for details.
- 2.4.2. **It is essential that no tree works (including works to category 'U' trees), and no construction works that may affect retained trees, are undertaken within the site before consideration and consent of the proposed works under FULL planning approval only by the local planning authority, regardless of whether the trees are currently protected or not.**

3. Arboricultural Impact Assessment

3.1. The proposed development

- 3.1.1. A new archery facility with outdoor range and associated car is proposed. The proposed layout drawing can be seen within the *Tree Protection Plan* to the rear of this report. This drawing has been used to assess the potential direct and indirect arboricultural impacts.

3.2. Proposed tree works

- 3.2.1. The proposed development directly impacts several trees. These trees shall require removal due to their close proximity to construction activity. All the trees proposed for removal are considered to be low-quality ('C' category) specimens, many of which are self-seeded. Please see the table below for the proposed tree removal details.

	Category 'A'	Category 'B'	Category 'C'
Trees to be removed to enable the construction of the proposed development	None	None	G9, T12, G17 (section), G23, G26 (section), G36 (section), G37 (section) & H39 (section)

- 3.2.2. The impact of the tree loss on the wider amenity of the area is considered to be low. If the precautions to protect the retained trees are implemented through the arboricultural method statement included in this report, the development proposal will have no adverse impact on the contribution of trees to local amenity or character.
- 3.2.3. The formative pruning of trees **T24** and **T25** will be required to ensure sufficient clearance between the proposed structure and adjacent branches. The proposed pruning works relate to the crown lifting/pruning of small tertiary branches. The overall shape of the trees from the proposed pruning works would not be affected. In addition, the proposed pruning works will have no adverse impacts on tree health and longevity.
- 3.2.4. Several trees may benefit from general arboricultural works as part of a practical post-development arboricultural management strategy; however, these works are not covered within the scope of this report. Within *Appendix 1* the term 'No action required' relates specifically to those tree works required to enable the proposed development and does not mean that general post-development arboricultural management works are not required.
- 3.2.5. However, general remedial pruning works have been recommended in this instance, please see *Appendix 1* for full details. The proposed works involve the removal of deadwood and the removal of poor/dead specimens within groups.

3.3. Site construction traffic

- 3.3.1. To protect the trees from construction site traffic the remaining trees should be protected by a temporary protective barrier (see *Section 4.2*), put in place before any construction activity. The barrier will ensure that the trees remain in a healthy condition during and after development.
- 3.3.2. Several of the retained trees are located beyond topographical site features, existing boundary fencing or away from the proposed development area. As such, these trees shall not require protection via temporary protective barriers as they are already protected due to their inaccessible location that is remote from the proposed construction activity.

3.4. Hard surfaces within the RPA

- 3.4.1. Minor sections of RPA from trees within **G10, T24, T25** and **G29** extend beyond the protective barrier and into the area where the existing hard surface is to be replaced. It should be noted that these RPAs are currently located beneath an existing hard surface storage area and that its replacement with a new similar hard surface would not cause any harm to the adjacent trees. However, given the potential area of RPA disturbance, it is recommended that the removal and reinstatement of the hard surface be undertaken using techniques sympathetic to tree roots.

3.5. Post development impacts

- 3.5.1. No soil samples were taken during the site visit. It is recommended that soil assessment is undertaken by a competent person to determine whether the soil is shrinkable, and that foundation design is undertaken to consider the soil type. It is essential that consideration is also given by a suitably qualified professional to how the proposed tree removal may affect soil conditions and the stability of any future foundations.

4. Arboricultural Method Statement

4.1. Tree works prior to development

- 4.1.1. Care should be taken to ensure during tree removal or remedial work that damage to the retained trees and disturbance to the RPA is avoided. All tree works, as described in *Appendix 1*, should be carried out under *BS 3998: 2010 Recommendations for tree work*, and after permission has been granted to do so by the local planning authority. It is essential that those appointed to undertake any tree works carry out adequate checks to ensure that no statutory laws are contravened during tree work operations.


4.2. Tree protection barriers

- 4.2.1. Once the tree works have been completed, all trees that may be affected by construction activity and are being retained on site should be protected by barriers before any materials or machinery are brought onto the site, and before any demolition, development or stripping of soil commences. No hardcore, rubble or soil from groundworks should be located within the protective barriers. It should be confirmed by an arboriculturist or the local authority that the barriers have been correctly set out on site, before the commencement of any other operations.
- 4.2.2. The protected area should be regarded as off limits, and once installed barriers should not be removed or altered without prior recommendation by an arboriculturist and, where necessary, approval from the local planning authority.
- 4.2.3. Please see *Appendix 4* for suggested barrier construction detail. It is recommended that in this instance the protective barrier shown in *Figure 2* would be appropriate. The suggested location for protective fencing is shown on the *Tree Protection Plan (Drawing 2)*.
- 4.2.4. Only when the development phase is complete and the site machinery has been removed, the local planning authority should be invited to inspect the site to approve the removal of the tree protection measures.

4.3. Hard surfaces within the RPA – Minimum-Dig

- 4.3.1. It is recommended that the proposed hard surfaces within the RPAs of **G10**, **T24**, **T25** and **G29** are constructed in a manner that would not cause the adjacent trees any long-term harm. In this instance, it is recommended that a 'Minimum-Dig' method is used. Initially, the removal of the existing hard surface within the RPAs *must only* be undertaken by hand.
- 4.3.2. Excavations within the RPA must only be undertaken by hand to establish the presence of roots. Any tree roots exposed within the RPA must be left as intact as careful digging with hand tools will allow, avoiding the use of heavy machinery within the RPA.

- 4.3.3. No more than 100mm of soil should be removed before the ground is inspected for roots. Depending on the presence of roots it may then be acceptable to remove a further 50mm of soil down to the required depth.
- 4.3.4. During excavations roots smaller than 25mm diameter may be pruned back, making a clean cut with a suitable sharp tool (e.g. bypass secateurs or handsaw), except where they occur in clumps. Roots occurring in clumps or of 25mm diameter and over should be severed only following consultation with an arboriculturist as such roots might be essential to the tree's health and stability.
- 4.3.5. Any roots exposed during excavations should immediately be wrapped or covered in damp hessian to prevent desiccation and to protect them from rapid temperature changes. Any wrapping should be removed before backfilling, which should take place as soon as possible. Before backfilling, retained roots should be surrounded with topsoil or un-compacted sharp sand (builders' sand should not be used because of its high salt content, which is toxic to tree roots), or other loose inert granular fill, before soil or other suitable material is replaced.

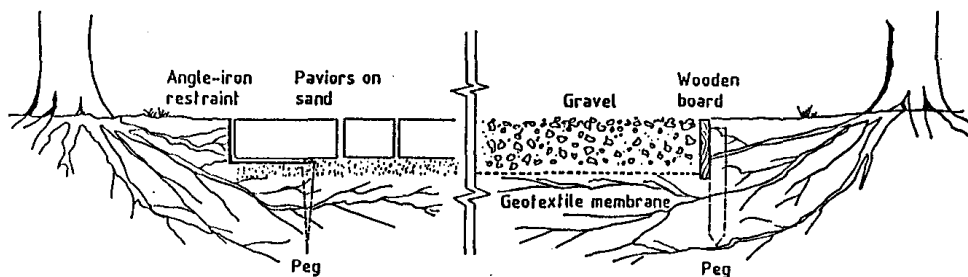

Example of a light-duty drive constructed using the *Minimum Dig Method*.

4.4. Services within the RPA

- 4.4.1. Wherever possible, underground services should be routed outside of the RPA of retained trees, and plans showing the proposed route should be drawn up. Where excavations may be required hand-held tools might be acceptable for shallow service runs, using the hand-dig technique detailed in *Section 4.3 above*.

4.5. Fencing within the RPA

- 4.5.1. Where the proposed boundary fence lies within the RPAs of retained trees it is essential that the post holes are excavated by hand. It is recommended that initial trial holes are dug using a hand-held auger to establish the presence and size of any adjacent tree roots.
- 4.5.2. On this basis, for fixed length fencing it is recommended that all footing locations are identified before committing to their final locations. All post locations must be as narrow as possible, with a suggested maximum diameter of 300mm. Excavations must only be undertaken as detailed in *Section 4.3 above*.

Client: Rochdale Company of Archers Ltd.
Project No: AIA.13781
Issue: 02

Date Issued: 4th March 2024
Status: FINAL

Signed on behalf of Godwins Arboricultural Limited:

R Godwin

Robert Godwin MSc, MArborA.
Arboriculturist




Contact Details:

Godwins Tree Surveys
82 King Street
Manchester
M2 4WQ

www.godwins.co.uk
info@godwins.co.uk
0800 030 4045

Drawing 1. Tree Constraints Plan

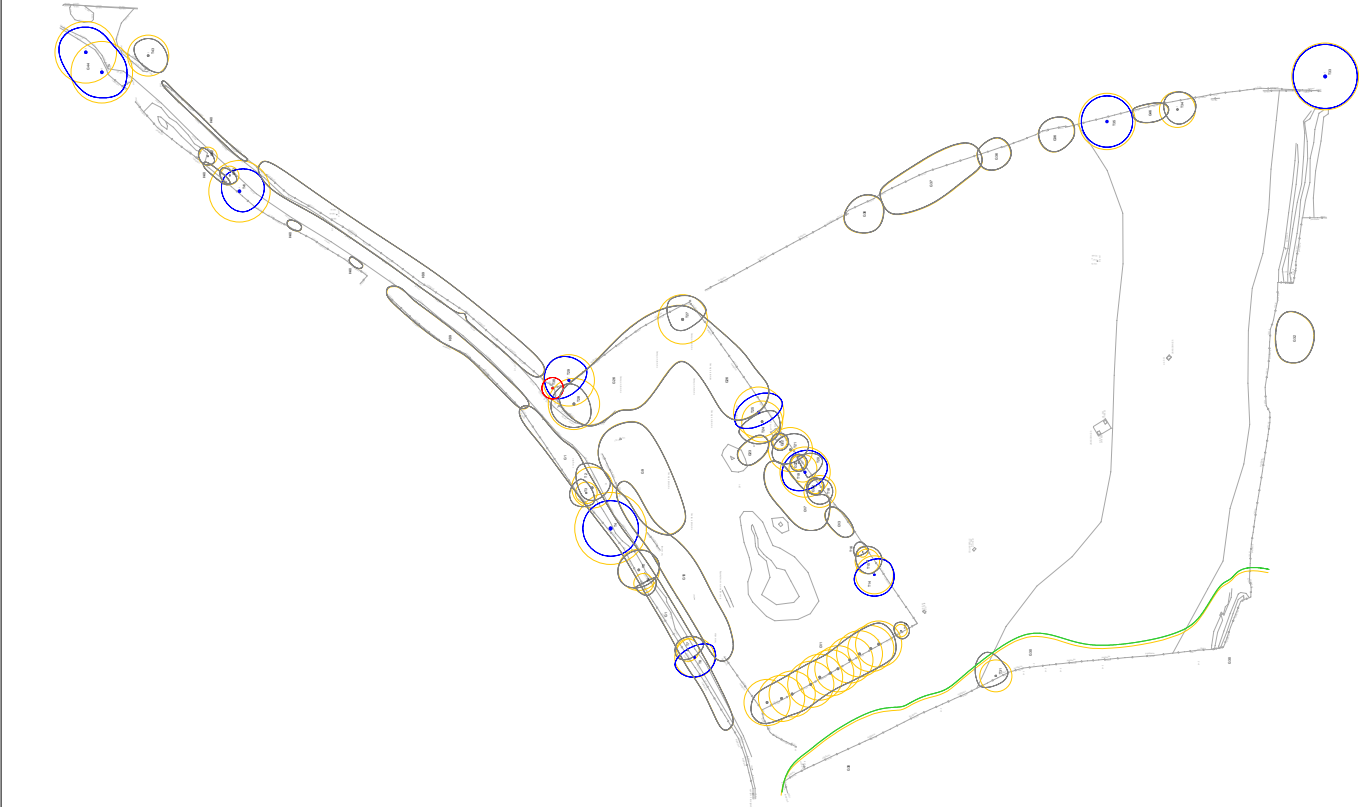

T	G	H	W	S
INDIVIDUAL TREE	GROUP OF TREES	HEDGE/ROW	WOODLAND GROUP	SHRUB

EXISTING LAYOUT

TREE QUALITY ASSESSMENT CATEGORY
CATEGORY 'A' HIGH QUALITY
CATEGORY 'B' MODERATE QUALITY
CATEGORY 'C' LOW QUALITY
CATEGORY 'U' UNSUITABLE FOR RETENTION

Based on British Standard BS397:2017, Table 1.
Please refer to Appendix 2 of the arboricultural report for more detailed category definitions.

ROOT PROTECTION AREA (RPA)

The Root Protection Area (RPA) is a layout design tool highlighting the underground tree constraints. Along with the tree stem and branches the RPA must be considered prior to and during development.

Written consent must be obtained from Godwins Arboricultural Limited before copying or using the data within this drawing on any other time for the purpose it was originally supplied.
Do not scale from this drawing.

GODWINS ARBORICULTURAL LIMITED
www.godwins.co.uk
info@godwins.co.uk
17 Wood Street
Barnsley
S70 2JH
0800 030 4045

PROJECT TITLE: Ashworth Valley, Ashworth Road, Rochdale, OL11 5UP	
DRAWING TITLE: TREE CONSTRAINTS PLAN	SCALE: 1:1250 @ A3
DRAWING NUMBER: TCP.13781	ISSUE DATE: 04.03.24
	REVISION: .02
	DRAWN BY: RG

Drawing 2. Tree Protection Plan



T	G	H	W	S
INDIVIDUAL TREE	GROUP OF TREES	HEDGEROW	WOODLAND GROUP	SHRUB

	EXISTING LAYOUT
	PROPOSED LAYOUT

Please refer to Section 3 of the Aboriginal Impact Assessment for details on potential impacts.

PROJECT TITLE: Ashworth Valley, Ashworth Road, Rochdale, OL11 5JP	
DRAWING TITLE: TREE PROTECTION PLAN	SCALE: 1:500 @ A1
DRAWING NUMBER: TPP.13781	REVISION: 02
	ISSUE DATE: 04.03.24
	DRAWN BY: RG

Appendix 1. Tree Schedule

Tree No.	Species	Age	Stems at 1.5m	Stem Dia (mm)	Height (Crown Hgt) (m)	Branch Spread (m)				Observations	Cond	Life Exp	Tree Works Required to Enable Development	Root Protection Area (RPA)		Retention Category
						FSB (D) (m)	N	E	S	W				Radius (m)	Area (m²)	
G 1	Crataegus monogyna (Hawthorn), Ilex aquifolium (Holly), Quercus robur (Common Oak)	Young to semi-mature	1	150	8(0)	0(S)	2	2	2	2	Fair	40+	No action required to enable development. Remove poor/dead specimens from within group.	1.8	10.2	C
T 2		Early-mature	1	400	10(S)	5(S)	3	6	4.5	3	Fair	20+	No action required.	4.8	72.4	C
T 3	Quercus robur (Common Oak)	Semi-mature	1	210	10(2)	6(S)	4	3.5	1.5	3	Good to Fair	40+	No action required.	2.5	20.0	C
T 4		Early-mature	1	700	14(6)	6(S)	6.5	6.5	6.5	6.5	Good to Fair	40+	No action required to enable development. Remove individual dead, defective or diseased branch(es).	8.4	221.7	B
T 5	Betula pendula (Silver Birch)	Early-mature	1	400	14(6)	6(S)	5	4.5	5	4	Good to Fair	40+	No action required.	4.8	72.4	C
T 6		Semi-mature	1	190	11(6)	6(S)	2	0	3	3	Good to Fair	40+	No action required.	2.3	16.3	C
T 7	Quercus robur (Common Oak)	Semi-mature	1	220	9(4)	4(S)	3	3	4	2	Good to Fair	40+	No action required.	2.6	21.9	C
T 8		Semi-mature	1	390	10(5)	5(S)	5	2.5	5	4.5	Good to Fair	40+	No action required.	4.7	68.8	B
G 9	Salix caprea (Goat Willow)	Young to semi-mature	3	200	12(2)	6(S)	5	5	5	5	Fair	40+	Remove to enable the construction of the proposed development.	4.2	54.1	C
G 10		Semi-mature	5	100	7(0)	0(S)	3	3	3	3	Good to Fair	40+	No action required to enable development. Remove poor/dead specimens from within group.	2.7	22.7	C

Tree No.	Species	Age	Stems at 1.5m	Stem Dia (mm)	Height (Crown Hgt) (m)	Branch Spread (m)				FSB (D) (m)	Observations	Cond	Life Exp	Tree Works Required to Enable Development	Root Protection Area (RPA)		Retention Category
						N	E	S	W						Radius (m)	Area (m ²)	
G 11	X Cupressocyparis leylandii (Leyland Cypress)	Early-mature	1	450	14(0.5)	0.5(E)	4	4	4	4	Individuals crowns restricted by group. Linear boundary group.	Good to Fair	40+	No action required.	5.4	91.6	C
T 12	Sorbus aucuparia (Rowan)	Semi-mature	3	70	4(1)	1(E)	1.5	2	2	2	Unbalanced crown. Multi-stemmed from ground level. Limited inspection - dense undergrowth.	Fair	10+	Remove to enable the construction of the proposed development.	1.5	6.6	C
G 13	Prunus spinosa (Blackthorn)	Semi-mature	5	35	3(0)	0(S)	1.5	1.5	1.5	1.5	Multi-stemmed from ground level. Limited inspection - dense undergrowth. Individuals crowns restricted by group.	Fair	20+	No action required.	0.9	2.8	C
T 14	Betula pendula (Silver Birch)	Semi-mature	1	370	14(2)	2(S)	5	3.5	4.5	5	Asymmetrical crown. Limited inspection - restricted access. Limited inspection - dense undergrowth.	Good to Fair	40+	No action required.	4.4	61.9	B
T 15	Fraxinus excelsior (Ash)	Semi-mature	1	240	8(1)	1(S)	2.5	3.5	3.5	3	Asymmetrical crown. Limited inspection - restricted access. Limited inspection - dense undergrowth.	Fair	20+	No action required.	2.9	26.1	C
T 16	Betula pendula (Silver Birch)	Young	1	100	8(4)	4(E)	2	2.5	1.5	0.5	Asymmetrical crown. Limited inspection - restricted access. Limited inspection - dense undergrowth.	Fair	10+	No action required.	1.2	4.5	C
G 17	Quercus robur (Common Oak), Salix caprea (Goat Willow)	Young	1	100	6(0)	0(E)	1.5	1.5	1.5	1.5	Limited inspection - restricted access. Limited inspection - dense undergrowth. Individuals crowns restricted by group. Self-seeded specimens. Occasional poor/dead specimens	Fair	40+	Remove section to enable the construction of the proposed development.	1.2	4.5	C
T 18	X Cupressocyparis leylandii (Leyland Cypress)	Semi-mature	3	180	9(1)	1(N)	3	3	3	3	Balanced crown. Limited inspection - restricted access. Limited inspection - dense undergrowth.	Good to Fair	40+	No action required.	3.7	44.0	C
T 19	Betula pendula (Silver Birch)	Early-mature	1	490	14(2.5)	2.5(N)	5.5	5	5.5	4	Asymmetrical crown.	Good to Fair	40+	No action required.	5.9	108.6	B
T 20	Fraxinus excelsior (Ash)	Semi-mature	1	270	11(2)	2(S)	0	3	5	2.5	Unbalanced crown.	Fair	20+	No action required.	3.2	33.0	C

Tree No.	Species	Age	Stems at 1.5m	Stem Dia (mm)	Height (Crown Hgt) (m)	Branch Spread (m)				Observations	Cond	Life Exp	Tree Works Required to Enable Development	Root Protection Area (RPA)		Retention Category	
						FSB (D) (m)	N	E	S					Radius (m)	Area (m²)		
T 21	Betula pendula (Silver Birch)	Early-mature	1	430	12(2.5)	3.5(N)	4.5	3.5	4.5	3	Asymmetrical crown.	Good to Fair	40+	No action required.	5.2	83.7	C
G 22	Betula pendula (Silver Birch), Quercus robur (Common Oak)	Young	1	140	7(2)	2(N)	2	2	2	2	Asymmetrical crowns.	Fair	40+	No action required.	1.7	8.9	C
G 23	Crataegus monogyna (Hawthorn)	Semi-mature	5	90	5(0.5)	0.5(N)	2.5	2.5	2.5	2.5	Multi-stemmed from ground level. Limited inspection - dense undergrowth. Individuals crowns restricted by group.	Fair	40+	Remove to enable the construction of the proposed development.	2.4	18.3	C
T 24	Salix caprea (Goat Willow)	Early-mature	4	200	11(1.5)	1.5(N)	6	2	4	5	Asymmetrical crown. Self-seeded specimen. Multi-stemmed from ground level. Limited inspection - dense undergrowth.	Good to Fair	40+	Crown lift north canopy to ensure 1.5m clearance from the proposed development	4.8	72.4	C
T 25	Salix caprea (Goat Willow)	Mature	6	200	12(2.5)	2.5(N)	6	4	6	3	Asymmetrical crown. Self-seeded specimen. Multi-stemmed from ground level. Limited inspection - dense undergrowth.	Good to Fair	40+	Crown lift north canopy to ensure 1.5m clearance from the proposed development	5.9	108.6	B
G 26	Salix caprea (Goat Willow)	Young to semi-mature	3	200	12(1)	4(N)	5	5	5	5	Multi-stemmed from ground level. Limited inspection - restricted access & dense undergrowth. Individual crowns restricted by group. Self-seeded specimens. Occasional poor/dead specimens.	Good to Fair	40+	Remove section to enable the construction of the proposed development. Remove poor/dead specimens from remaining group.	4.2	54.1	C
T 27	Salix caprea (Goat Willow)	Early-mature	8	170	10(2)	2(S)	3	5.5	6	2.5	Asymmetrical crown. Self-seeded specimen. Multi-stemmed from ground level. Limited inspection - dense undergrowth.	Fair	40+	No action required.	5.8	104.6	C
T 28	Salix caprea (Goat Willow)	Early-mature	2	400 300	11(5)	5(S)	5.5	5	3.5	5.5	Asymmetrical crown. Self-seeded specimen. Multi-stemmed from ground level. Limited inspection - dense undergrowth. Tree RPA located within existing hard surface area.	Fair	40+	No action required.	6.0	113.1	C
T 29	Quercus robur (Common Oak)	Early-mature	1	500	11(5)	5(N)	5.5	6	5	3	Asymmetrical crown. Crown - deadwood (Equal or less than 100mm). Limited inspection - situated on adjacent land.	Good to Fair	40+	No action required.	6.0	113.1	B
G 30	Crataegus monogyna (Hawthorn), Fraxinus excelsior (Ash), Acer pseudoplatanus (Sycamore), Betula pendula (Silver Birch), Prunus sp. (Cherry), Quercus robur (Common Oak), Picea abies (Norway Spruce)	Semi-mature to early-mature	1	450	14(1)	1(E)	6	6	6	6	Not inspected - located away from the proposed development area. Individuals crowns restricted by group. Linear boundary group.	Good to Fair	40+	No action required.	5.4	91.6	A

Tree No.	Species	Age	Stems at 1.5m	Stem Dia (mm)	Height (Crown Hgt) (m)	Branch Spread (m)					FSB (D) (m)	Observations	Cond	Life Exp	Tree Works Required to Enable Development	Root Protection Area (RPA)		Retention Category
						N	E	S	W	Radius (m)						Area (m²)		
T 31	Prunus sp. (Cherry)	Semi-mature	3	180	12(2)	2(E)	4.5	6	3	2		Unbalanced crown. Multi-stemmed from ground level.	Good to Fair	40+	No action required.	3.7	44.0	C
G 32	Ilex aquifolium (Holly)	Semi-mature	3	150	7(0)	0(N)	3	3	3	3		Self-seeded specimen. Multi-stemmed from ground level. Not inspected - located away from the proposed development area.	Good to Fair	40+	No action required.	3.1	30.6	C
T 33	Quercus robur (Common Oak)	Early-mature	1	650	9(2)	2(N)	7.5	7.5	7.5	7.5		Balanced crown. Situated on adjacent land. Not inspected - located away from the proposed development area.	Good to Fair	40+	No action required.	7.8	191.2	B
T 34	Fraxinus excelsior (Ash)	Semi-mature	1	350	9(2.5)	2.5(S)	3	4	4.5	3.5		Asymmetrical crown. Crown - minor deadwood (less than 50mm).	Fair	10+	No action required.	4.2	55.4	C
T 35	Quercus robur (Common Oak)	Early-mature	1	550	10(1.5)	1.5(W)	6	6	6	6		Balanced crown.	Good to Fair	40+	No action required.	6.6	136.9	B
G 36	Ilex aquifolium (Holly), Crataegus monogyna (Hawthorn)	Semi-mature	3	100	5(0)	0(W)	2	2	2	2		Individuals crowns restricted by group. Linear boundary group. Occasional poor/dead specimens.	Fair	20+	Remove section to enable the construction of the proposed development.	2.1	13.6	C
G 37	Ilex aquifolium (Holly)	Semi-mature	5	100	6(0)	0(W)	3	3	3	3		Individuals crowns restricted by group. Linear boundary group.	Good to Fair	40+	Remove section to enable the construction of the proposed development.	2.7	22.7	C
T 38	Ilex aquifolium (Holly)	Early-mature	2	200	6(4)	4(N)	2.5	2.5	2.5	2.5		Crown - deadwood (Equal or less than 100mm). Multi-stemmed from ground level.	Poor	<10	Remove for arboricultural reasons.	3.4	36.3	U
H 39	Ilex aquifolium (Holly), Crataegus monogyna (Hawthorn), Quercus robur (Common Oak), Sambucus nigra (Elder)	Young to semi-mature	5	35	3.5(0)	0(N)	1	1	1	1		Individuals crowns restricted by group. Linear boundary group. Occasional self-seeded saplings. Maintained.	Good to Fair	40+	Remove section to enable the construction of the proposed development.	0.9	2.8	C
H 40	Crataegus monogyna (Hawthorn)	Young	1	35	2(0)	0(N)	0.75	0.75	0.75	0.75		Individuals crowns restricted by group. Linear boundary hedge.	Good to Fair	40+	No action required.	0.4	0.6	C

Tree No.	Species	Age	Stems at 1.5m	Stem Dia (mm)	Height (Crown Hgt) (m)	Branch Spread (m)					Observations	Cond	Life Exp	Tree Works Required to Enable Development	Root Protection Area (RPA)		Retention Category
						FSB (D) (m)	N	E	S	W					Radius (m)	Area (m ²)	
T 41	Quercus robur (Common Oak)	Early-mature	1	600	10(2.5)	5(S)	4	5	6	5	Asymmetrical crown. Occasional pruning wounds. Tree RPA located within existing hard surface area.	Good to Fair	40+	No action required.	7.2	162.9	B
G 42	Quercus robur (Common Oak), Acer pseudoplatanus (Sycamore)	Young	2	100,150	5(2)	3(S)	2	2.5	1	2	Asymmetrical crowns.	Good to Fair	40+	No action required.	2.2	14.7	C
T 43	Quercus robur (Common Oak)	Early-mature	1	400	7(2.5)	2.5(N)	2.5	4	4	5	Unbalanced crown. Limited inspection - dense ivy on stem/base. Limited inspection - situated on adjacent land.	Good to Fair	40+	No action required.	4.8	72.4	C
G 44	Acer pseudoplatanus (Sycamore)	Early-mature	1	600	12.5(5)	7(S)	6.5	6.5	6.5	6.5	Situated on adjacent land. Individuals crowns restricted by group. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Good to Fair	40+	No action required.	7.2	162.9	B

Appendix 2. Explanatory Notes

A2.1. Tree statistics and measurements

Survey record	Description
<i>Tree No.</i>	Unique tree reference number. (T) = Individual tree, (G) = Group of trees or woodland that form cohesive arboricultural features, (H) = Hedgerows and substantial internal or boundary hedges.
<i>Species</i>	Species listed by scientific name, with (common name).
<i>Age</i>	Life stage – Young, Semi-mature, Early-mature, Mature, Over-mature and Veteran.
<i>Stem Count</i>	The number of stems recorded at 1.5m above ground level.
<i>Stem Diameter</i>	Stem diameter recorded in millimetres at 1.5 meters above the ground. Where the tree is multiple-stemmed, each stem has been recorded.
<i>Height (Crown Height)</i>	Height of the tree in metres – to the closest 0.5m. Average canopy height in brackets, e.g. 10(3).
<i>First Significant Branch</i>	Existing height above ground level of first significant branch and direction of growth, e.g. 3(N)
<i>Branch Spread</i>	Branch spread, taken as a minimum at the four cardinal points – North, East, South and West.
<i>Observations</i>	General observations, particularly of structural and/or physiological condition (e.g. the presence of any decay, physical defect or historic pruning).
<i>Cond</i>	Condition of the tree recorded as Good, Good to Fair, Fair, Fair to Poor, Poor or Dead.
<i>Life Exp</i>	Life Expectancy - classed as less than 10 years, 10 plus years, 20 plus years, or more than 40 years.
<i>Tree Works Required to Enable Development</i>	Tree works specifically required to enable the proposed development, or to reduce significant risk of harm. The term 'No action required' does not mean that general post-development arboricultural management works are not required.
<i>RPA Radius</i>	The radius of the root protection area, when plotted as a circle centred on the base of the stem.
<i>RPA Area</i>	The total area of RPA in metres squared, e.g. 100m ² .
<i>Retention Category</i>	See below – A2.2.

A2.2. Tree retention categories

Retention category and definition	Criteria
<i>U (marked in red on the Tree Constraints Plan) = trees for removal.</i>	Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years.
<i>A (marked green on the Tree Constraints Plan) = Trees of high quality</i>	Trees of high quality with an estimated remaining life expectancy of at least 40 years.
<i>B (marked in blue on the Tree Constraints Plan) = Trees of moderate quality</i>	Trees of moderate quality with an estimated remaining life expectancy of at least 20 years.
<i>C (marked in grey on the Tree Constraints Plan) = Trees of low quality</i>	Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm.

Appendix 3. Report Limitations & General Guidelines

- A3.1 Where the inspection of trees was limited (*see Appendix 1*), the 'Tree statistics and measurements' (*Appendix 2.1*) are estimated, and observations, condition and life expectancy are based on an inspection from the available vantage point.
- A3.2 It is recommended that qualified and experienced companies are sought when appointing tree work contractors and they should be approved under the Arboricultural Association Approved Contractors scheme. It is essential that all appointed tree work contractors have adequate Public Liability, Products Liability and Employers Liability Insurance. All tree works must conform to the current BS 3998 "*Recommendations for Tree Work*".
- A3.3 Godwin's Arboricultural Ltd will not accept liability for works undertaken by third-party companies. All necessary checks must be made by the appointed tree work contractor before undertaking any works to ensure that no statutory tree protection measures or relevant laws are contravened.
- A3.4 The validity, accuracy and findings of this report are directly related to the accuracy of the information made available before and during the inspection process. No checking of independent third-party data will be undertaken. Godwin's Arboricultural Ltd will not be responsible for the recommendations within this report where essential data are not made available or are inaccurate.
- A3.5 The assessment and works recommendations relate to conditions found at the time of our inspection. Any significant alteration to the site post our site inspection but pre-submission for planning that may affect the trees present, or have a bearing on the planning implications (including level changes, hydrological changes, storms, extreme climatic events or site works) will necessitate a re-assessment of the trees and the site.
- A3.6 This report has been carried out to inform the planning process, and not to assess the potential hazards and risks posed by trees. Where clear and obvious hazards have been observed to accessible trees, these have been addressed in the recommendations of the work. Where inspections were limited by restrictions such as stem ivy, understory vegetation, limited access, epicormic growth or being located on adjacent land, any form of tree condition assessment was restricted. A full assessment of the levels of risk posed by trees can only be informed by considering site use together with assessing any hazards present within a tree.
- A3.7 Trees are dynamic structures that continue to develop and decline; in addition, changes in site use are likely to occur during and as a result of the proposed development. On this basis, regular tree risk assessments are advised.
- A3.8 Godwin's Arboricultural Ltd plans are to scale whenever possible, but care should be taken when measuring from a plan without first checking the original data.

Appendix 4. Protective Barrier Construction

- A4.1 The default specification for protective barriers should consist of a vertical and horizontal scaffold framework, well-braced to resist impacts, as illustrated below. The vertical tubes should be spaced at a *maximum* interval of 3 m and driven securely into the ground. Onto this framework, welded mesh panels should be securely fixed. Care should be exercised when locating the vertical poles to avoid underground services and, in the case of the bracing poles, also to avoid contact with structural roots.

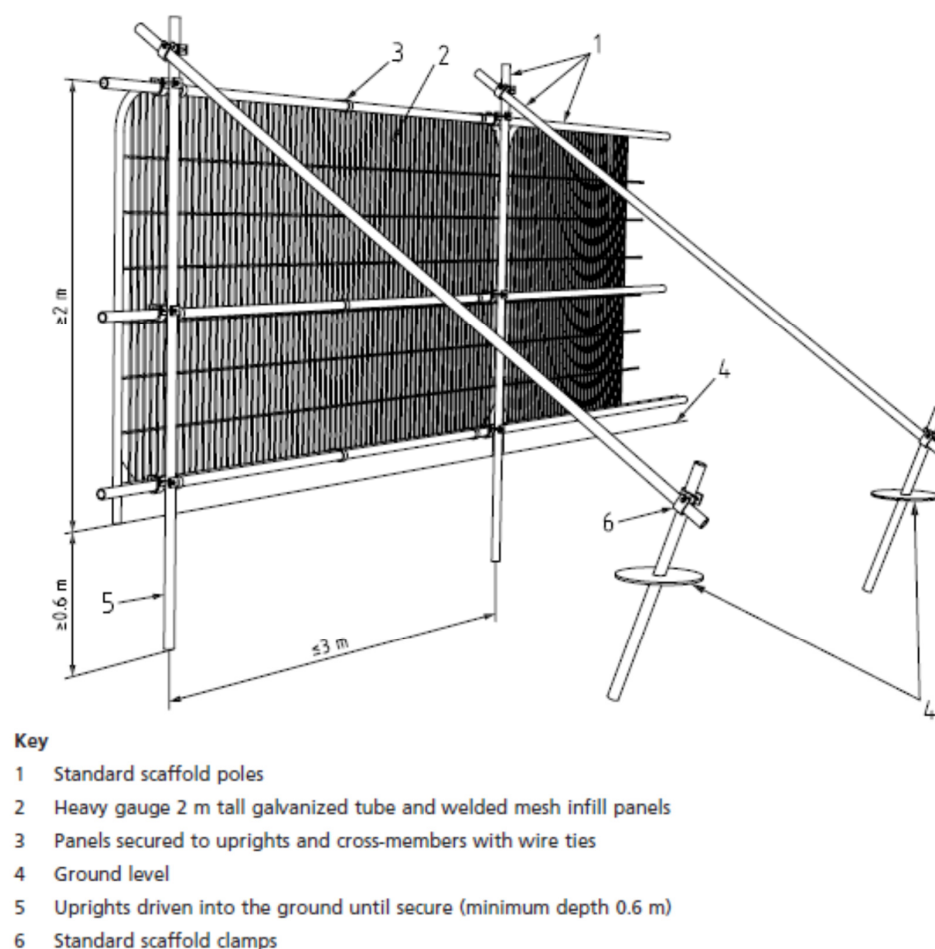


Figure 1. Default protective fencing barrier as detailed in BS 5837: 2012.

- A4.2 Where the site circumstances and associated risk of damaging incursion into the RPA do not necessitate the default level of protection, an alternative specification may be adopted. This system includes 2 m tall welded mesh panels on rubber or concrete feet, secure enough to provide an adequate level of protection from cars, vans, pedestrians and manually operated plant. In such cases, the fence panels should be joined together using a minimum of two anti-tamper couplers, installed so that they can only be removed from inside the fence. The distance between the fence couplers should be at least 1 m and should be uniform throughout the fence. The panels should be supported on the inner side by stabilizer struts, which should normally be attached to a base plate secured with ground pins (Figure 2a). Where the fencing is to be erected on retained hard surfacing or it is otherwise unfeasible to use ground pins, e.g. due to the presence of underground services, the stabilizer struts should be mounted on a block tray (Figure 2b).


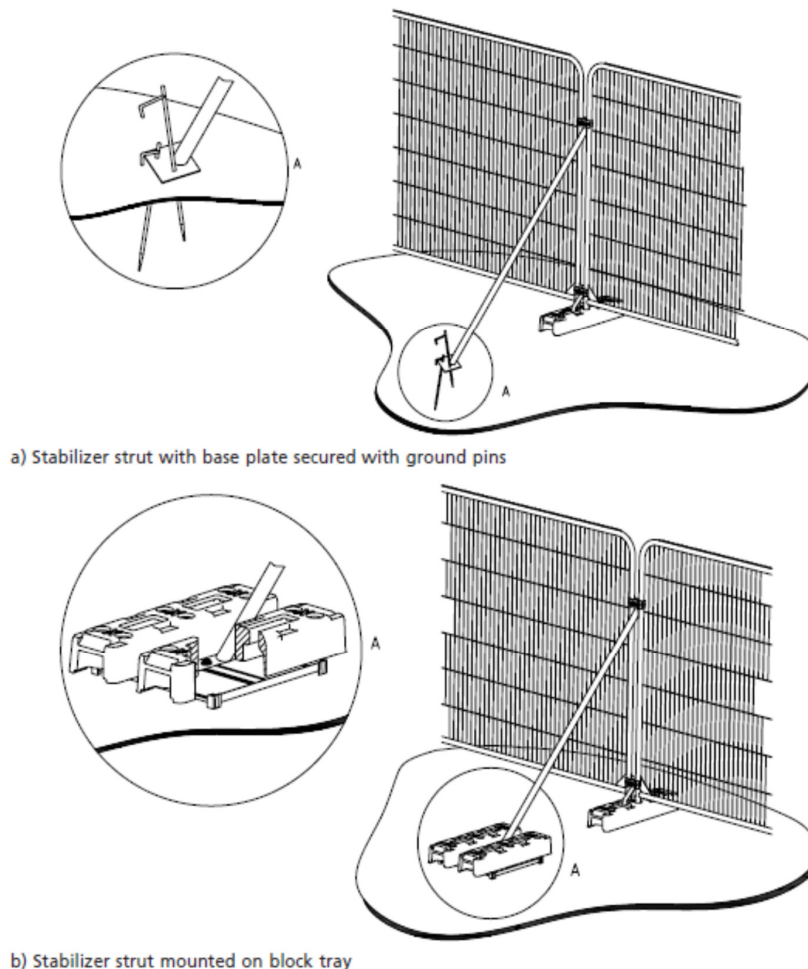


Figure 2. Examples of above-ground stabilizing systems

Appendix 5. Statutory Tree Protection Check Results

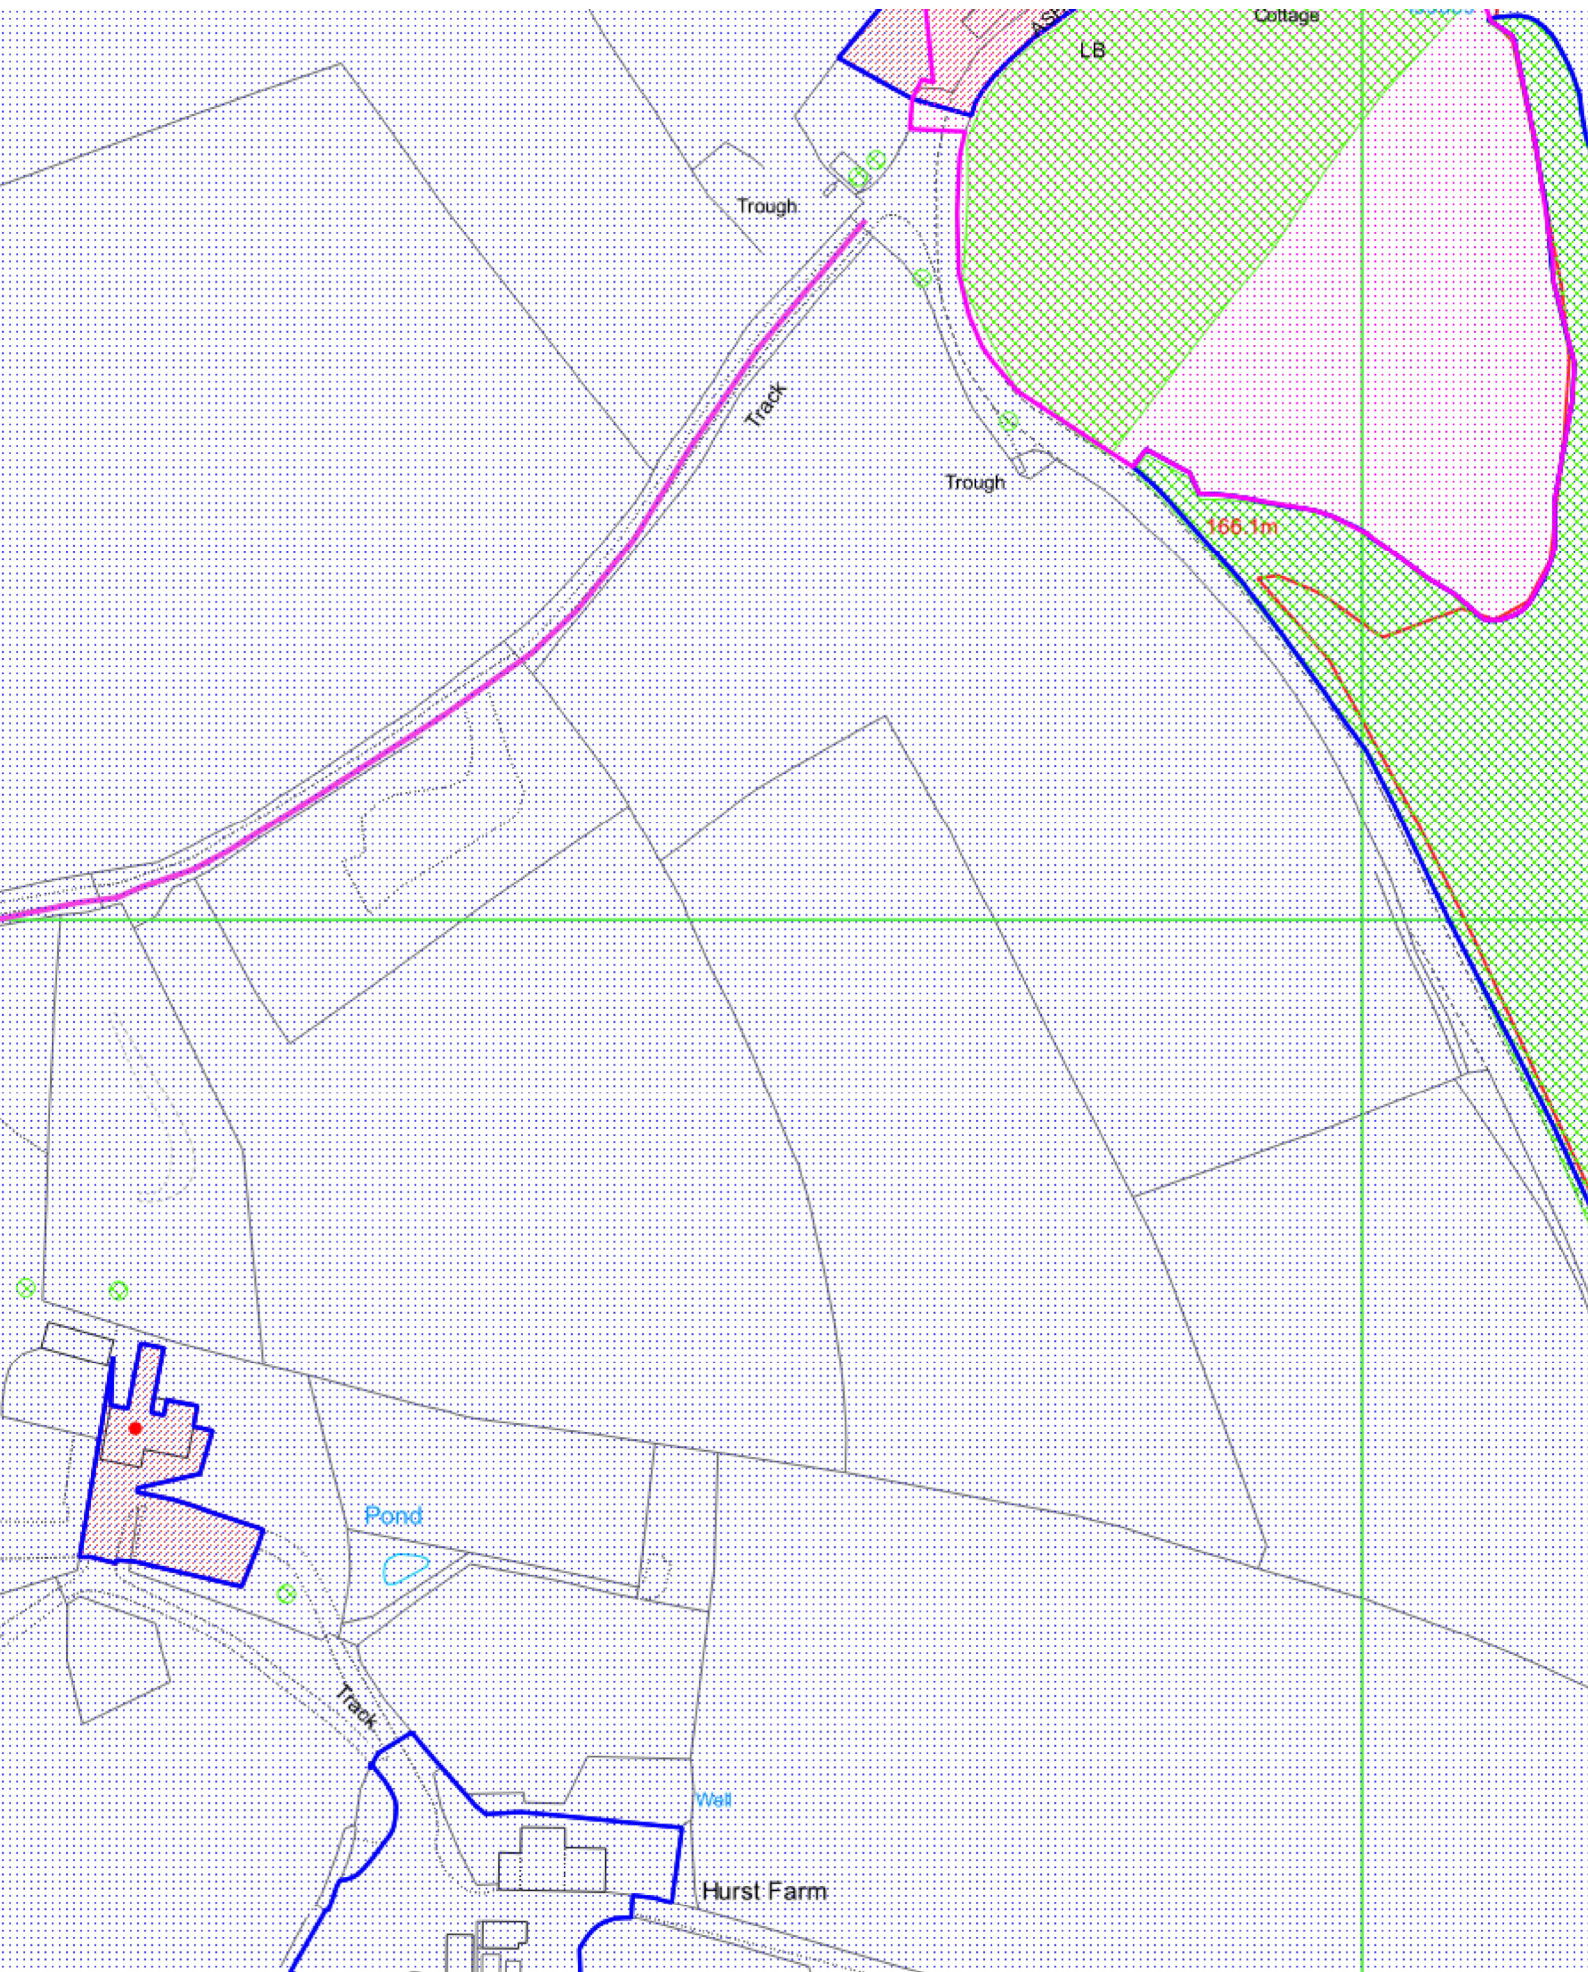

Individual Trees Continued:

10

<u>Number on Map</u>	<u>Description of Trees</u>	<u>Situation</u> Plot numbers referred to are Ordnance Survey Plot numbers on 25 inch sheets LXXX.14 (Edition of 1929); LXXXVIII.2, LXXXVIII.3, LXXXVIII.6 and LXXXVIII.7. (Edition of 1930)
<u>In the Borough of Heywood</u>		
T.27.	Ash	In Plot No. 257.
T.28.	Oak	In Plot No. 250.
T.29.	Ash	In Plot No. 248.
T.30.	Oak	On boundary between Plot Nos. 232 & 248.
T.31.	Ash	In Plot No. 235.
T.32.	Sycamore	In Plot No. 235.
T.33.	Beech	In Plot No. 235.
T.34.	Sycamore	In Plot No. 212.
T.35.	Sycamore	In Plot No. 212.
T.36.	Sycamore	In Plot No. 212.
T.37.	Oak	In Plot No. 221.
T.38.	Oak	In Plot No. 221.
T.39.	Oak	In Plot No. 282.
T.40.	Oak	In Plot No. 130.
T.41.	Oak	In Plot No. 126.
T.42.	Sycamore	In Plot No. 194.
T.43.	Lime	On boundary between Plot Nos. 191 & 192.
T.44.	Beech	On boundary between Plot Nos. 191 & 192.
T.45.	Beech	On boundary between Plot Nos. 191 & 192.
T.46.	Sycamore	In Plot No. 196.
T.47.	Oak	In Plot No. 191.
T.48.	Sycamore	On boundary between Plot Nos. 121 & 143.
T.49.	Sycamore	On boundary between Plot Nos. 121 & 143.
T.50.	Sycamore	On boundary between Plot Nos. 121 & 143.
T.51.	Sycamore	On boundary between Plot Nos. 121 & 143.
T.52.	Sycamore	On boundary between Plot Nos. 121 & 143.
T.53.	Sycamore	On boundary between Plot Nos. 120 & 143.
T.54.	Sycamore	On boundary between Plot Nos. 120 & 143.

Godwins Arboricultural Limited © 2024
Tree Surveys and Tree Reports

info@godwins.co.uk | www.godwins.co.uk