



01 South Elevation - Window Repairs
2210 1:50 @ A1


Repaint timber members of window
to match existing as NBS M60

Renew burnt sand mastic joint as
NBS Z20 to joint between window and masonry
as per manufacturers recommendations.

Limited access due to current scaffold layout
Allow for Architects Inspection when
access is available.

Rot to multiple sections of bottom rail to timber
window. Replace entire bottom cill as NBS C51 to
match existing profile.

Crack at timber mullion. Fill with 2
part epoxy as NBS M60/160.

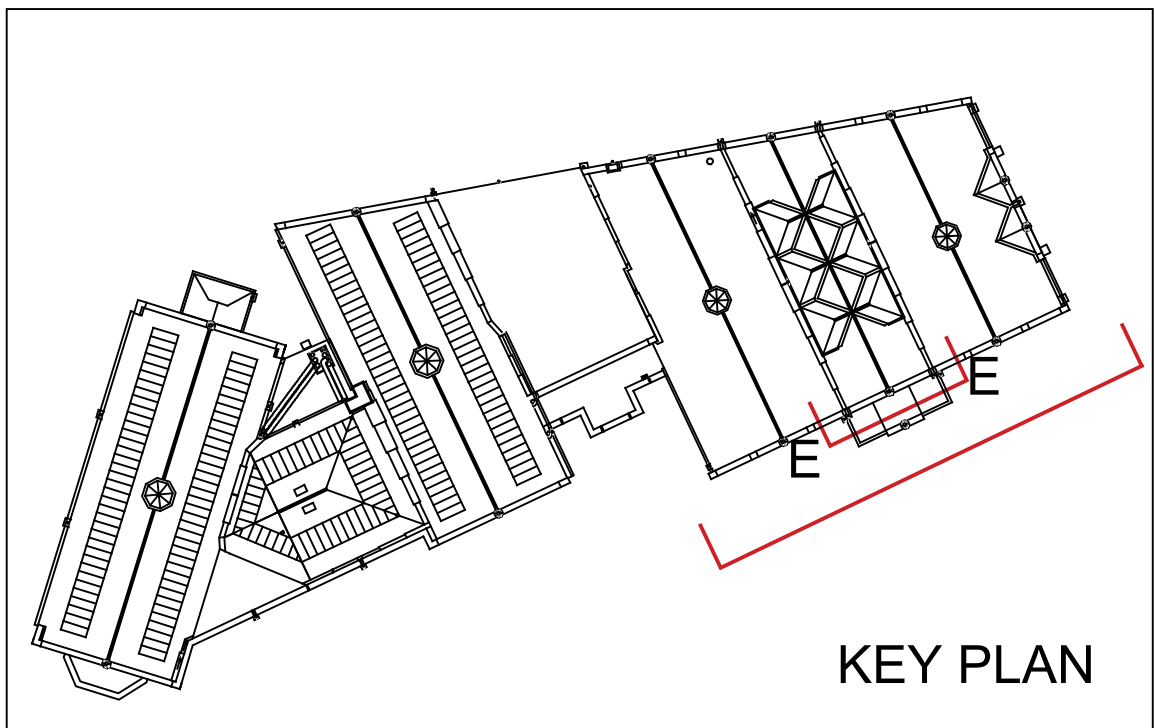

KEY PLAN

0 0.5 1 2.5
Scale 1:50 m

Notes

- Any dwg format drawing is to be read in conjunction with and at the scale of the accompanying pdf.
- Where colours other than black or grey are used, the drawing must be plotted in colour.
- For status 'C' (Construction) drawings all dimensions are to be checked on site by the contractor, scaling is for Local Authority purposes only.
- Unless otherwise indicated, all dimensions are in millimeters.
- All information on this drawing is to be read in conjunction with the relevant Donald Insall Associates specification and trade contractors' drawings and information by specialists.
- In the event of any discrepancy, please contact us immediately.
- This drawing may contain survey information by others and is to be used solely for the purposes for which it was issued.
- These are uncontrolled documents issued for information purposes only. If you have any queries regarding the drawings, please contact DIA immediately.
- Please note DIA cannot be held responsible for any errors arising from changes made to an uncontrolled dwg file.

© 2019 DONALD INSALL ASSOCIATES LTD

Drawing Status

- F Feasibility
- S Sketch Design
- P Planning
- B Building Control
- D Developed Design
- M Measurement
- T Tender
- C Construction
- R Record

Rev	Date	Dwn	Auth	Revision
3	15-08-25	SZA	RZM	Window numbering Update
2	04-08-25	SZA	RZM	Construction Issue
1	09-07-2025	SZA	RZM	Issued for AI
0	24-06-2025	SZA	RZM	Issued for Tender

Donald Insall Associates
Chartered Architects and Historic Building Consultants

Bridgegate House, 5 Bridge Place
Chester CH1 1SA
(+44) 01244 350 063
chester@insall-architects.co.uk

Touchstones Art Gallery, Rochdale

Roof Zone 1
South Elevation - Window Repair

Project	No	
RTAG.03	2210	
Scale (A1)	Status	Revision
1:50	5C	3