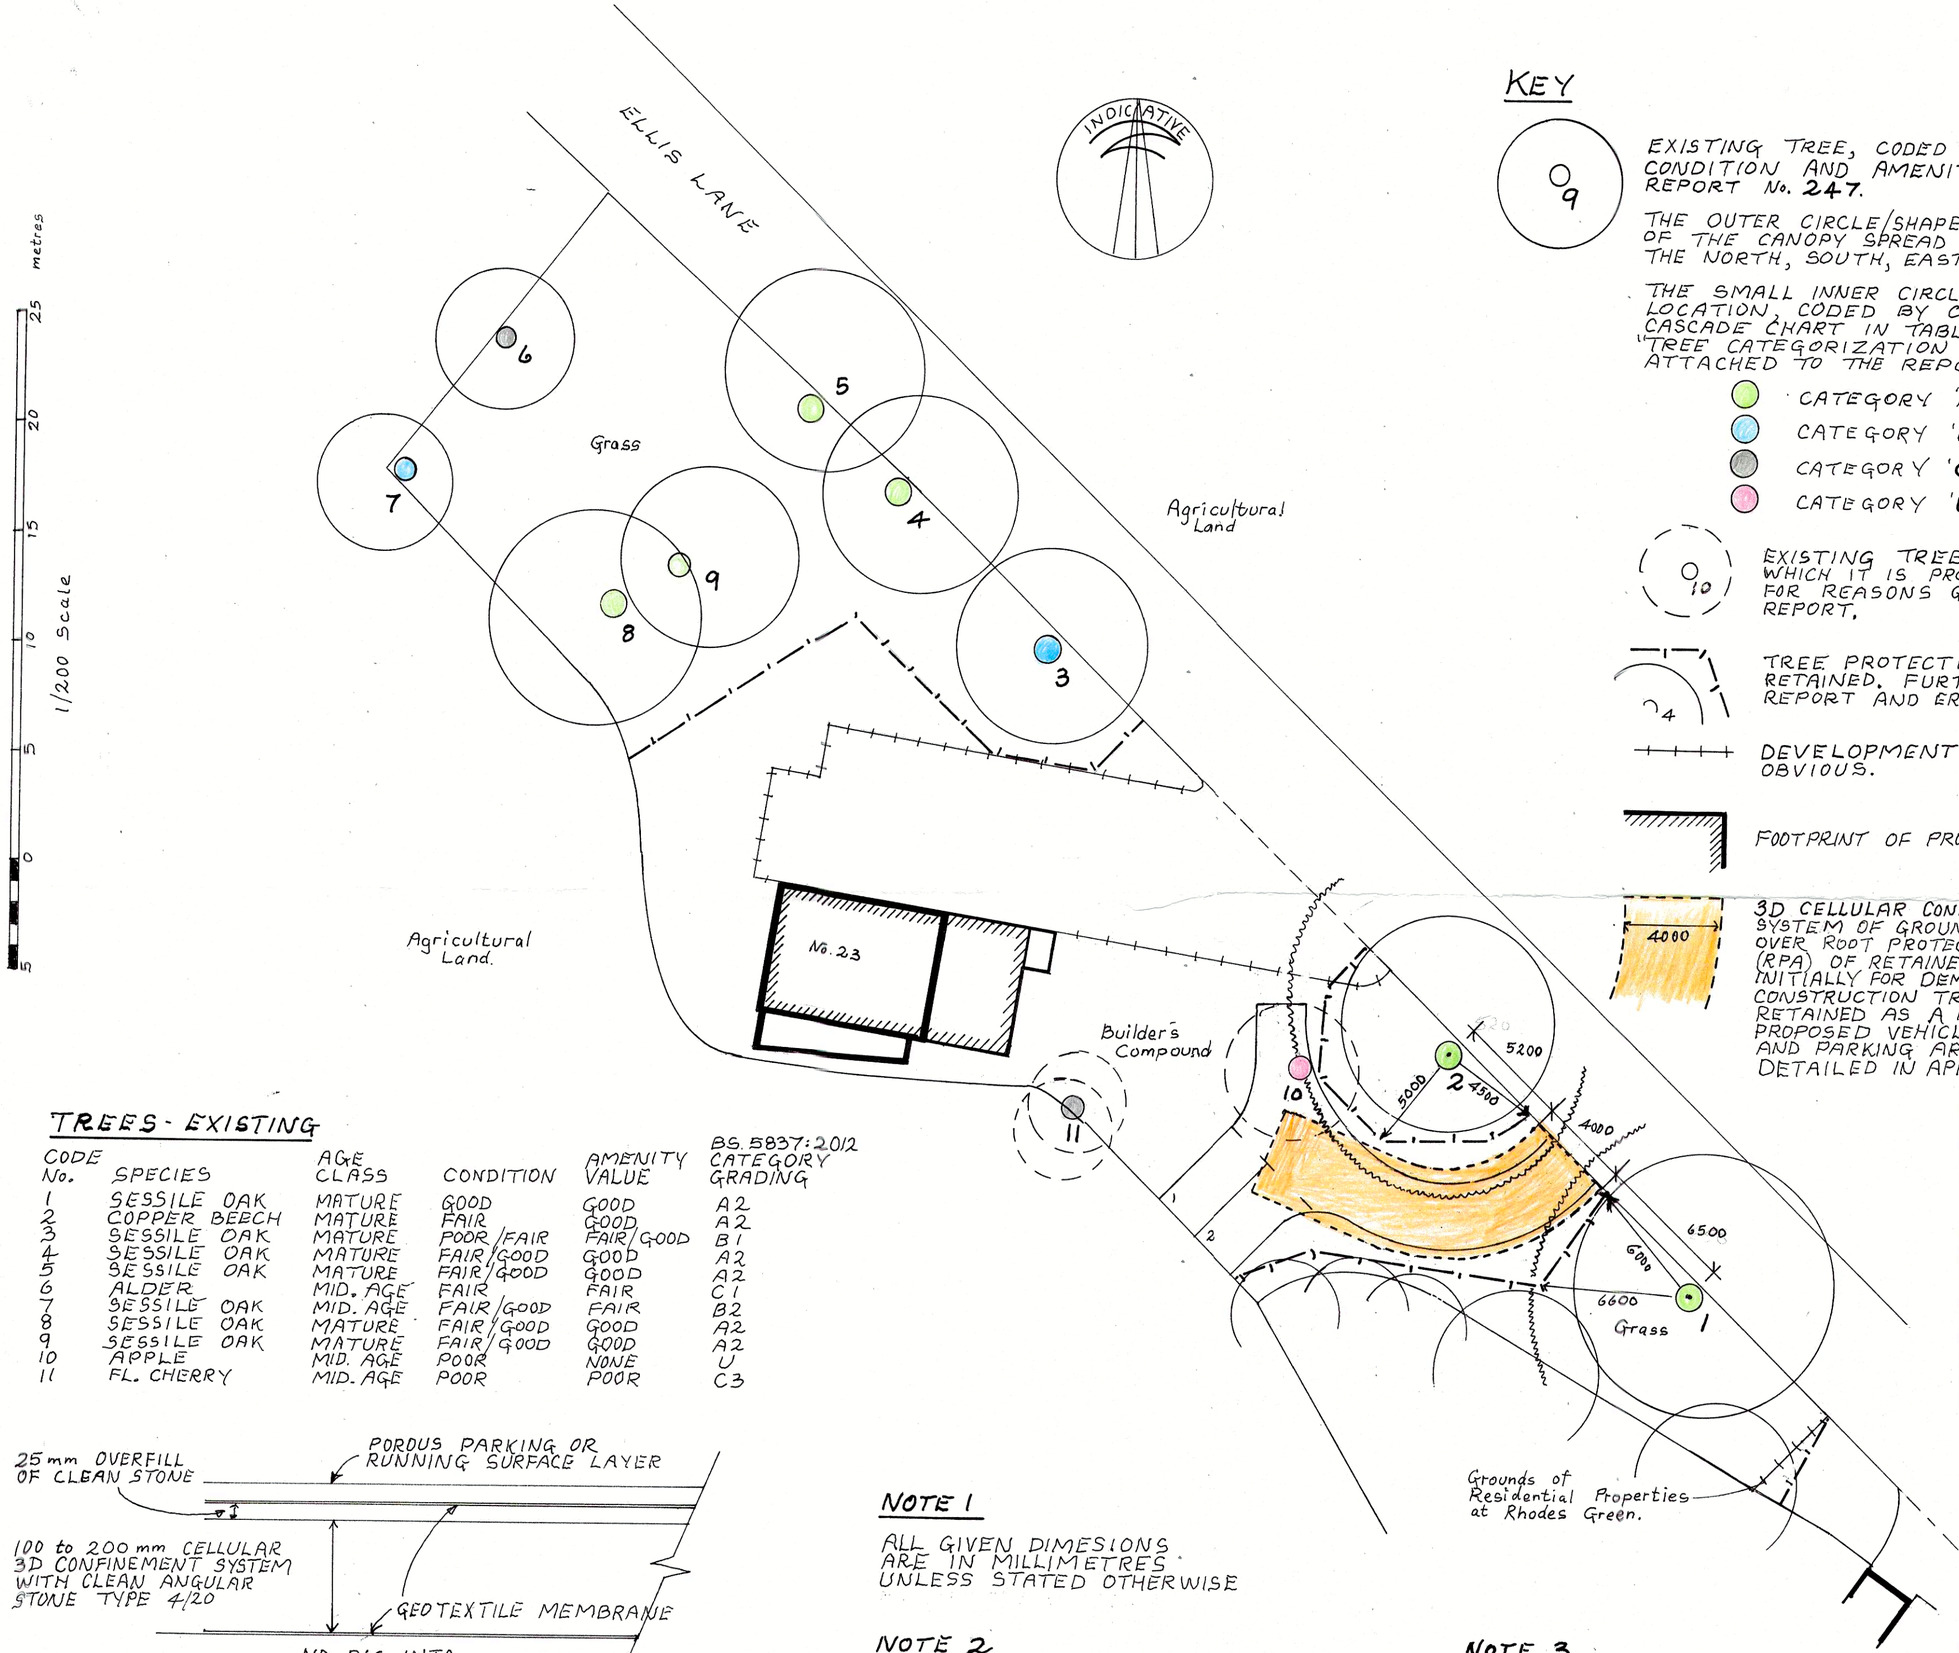


KEY

EXISTING TREE, CODED BY NUMBER AS TO IT'S SPECIES, SIZE, CONDITION AND AMENITY VALUE IN THE TREE SURVEY REPORT No. 247.

THE OUTER CIRCLE/SHAPE REPRESENTING THE OUTLINE/EXTENT OF THE CANOPY SPREAD BASED ON THE MEASURED RADII TO THE NORTH, SOUTH, EAST AND WEST.

THE SMALL INNER CIRCLE REPRESENTING THE TREE TRUNK LOCATION, CODED BY COLOUR IN ACCORDANCE WITH THE CASCADE CHART IN TABLE 1 OF SECTION 4.3 "TREE CATEGORIZATION METHOD" IN BS 5837:2012 ATTACHED TO THE REPORT AS APPENDIX C.

- CATEGORY 'A'
- CATEGORY 'B'
- CATEGORY 'C'
- CATEGORY 'U'

EXISTING TREE CODED EXACTLY AS THE ABOVE WHICH IT IS PROPOSED COULD/SHOULD BE REMOVED FOR REASONS GIVEN IN SECTION 4 PART 2 OF THE REPORT.

TREE PROTECTION FENCING TO EXISTING TREES TO BE RETAINED. FURTHER DETAILED IN PART 4.3 OF THE REPORT AND ERECTED AS ILLUSTRATED IN APPENDIX D

DEVELOPMENT SITE BOUNDARY OTHER THAN WHERE OBVIOUS.

FOOTPRINT OF PROPOSED REBUILD.

CALCULATED EDGE OF RPA, HAVING ALLOWED A 20% OFF-SET IN THE DIRECTION OF AREA OF UNRESTRICTED ROOTING AVAILABLE ON OPPOSITE SIDE OF THE TREE.

4000

3D CELLULAR CONFINEMENT SYSTEM OF GROUND PROTECTION OVER ROOT PROTECTION AREAS (RPA) OF RETAINED TREES, INITIALLY FOR DEMOLITION AND CONSTRUCTION TRAFFIC, BUT RETAINED AS A PART OF THE PROPOSED VEHICLE ACCESS AND PARKING ARRANGEMENTS. DETAILED IN APPENDIX E

TREES - EXISTING

CODE No.	SPECIES	AGE CLASS	CONDITION	AMENITY VALUE	BS 5837:2012 CATEGORY GRADING
1	SESSILE OAK	MATURE	GOOD	GOOD	A2
2	COPPER BEECH	MATURE	FAIR	GOOD	A2
3	SESSILE OAK	MATURE	POOR/FAIR	FAIR/GOOD	B1
4	SESSILE OAK	MATURE	FAIR/GOOD	GOOD	A2
5	SESSILE OAK	MATURE	FAIR/GOOD	GOOD	A2
6	ALDER	MID. AGE	FAIR	FAIR	C1
7	SESSILE OAK	MID. AGE	FAIR/GOOD	FAIR	B2
8	SESSILE OAK	MATURE	FAIR/GOOD	GOOD	A2
9	SESSILE OAK	MATURE	FAIR/GOOD	GOOD	A2
10	APPLE	MID. AGE	POOR	NONE	U
11	FL. CHERRY	MID. AGE	POOR	POOR	C3

TYPICAL SECTION (NTS)
GROUND/ROOT PROTECTION SYSTEM

NOTE 1

ALL GIVEN DIMESIONS ARE IN MILLIMETRES UNLESS STATED OTHERWISE

NOTE 2

THE ORIGINAL OF THIS DRAWING WAS PRODUCED IN COLOUR. A MONOCHROME COPY SHOULD NOT BE RELIED UPON.
(Ref. BS 5837:2012 Page 4 Section 4.1)

NOTE 3

THIS DRAWING IS APPENDIX 'A' OF THE TREE SURVEY REPORT No 247 WITH WHICH IT MUST BE READ.

Drawing
TREE SURVEY
FOR ARBORICULTURAL IMPACT ASSESSMENT

Project
PROPOSED HOUSE RECONSTRUCTION, AT 23 RHODES GREEN, MIDDLETON, M24 4SL

Client
Ms. R. SIDDALL

JOHN GRAYSON
LANDSCAPE CONSULTANT,
MARDEN HOUSE,
37 HUDDERSFIELD ROAD,
DENSHAW,
SADDLEWORTH,
OLDHAM.
OL3 5SB
tel. 01457-875467

Scale: 1/200 @ A2

Date: [redacted] FEB 2019

Drg. No.: 247/1