
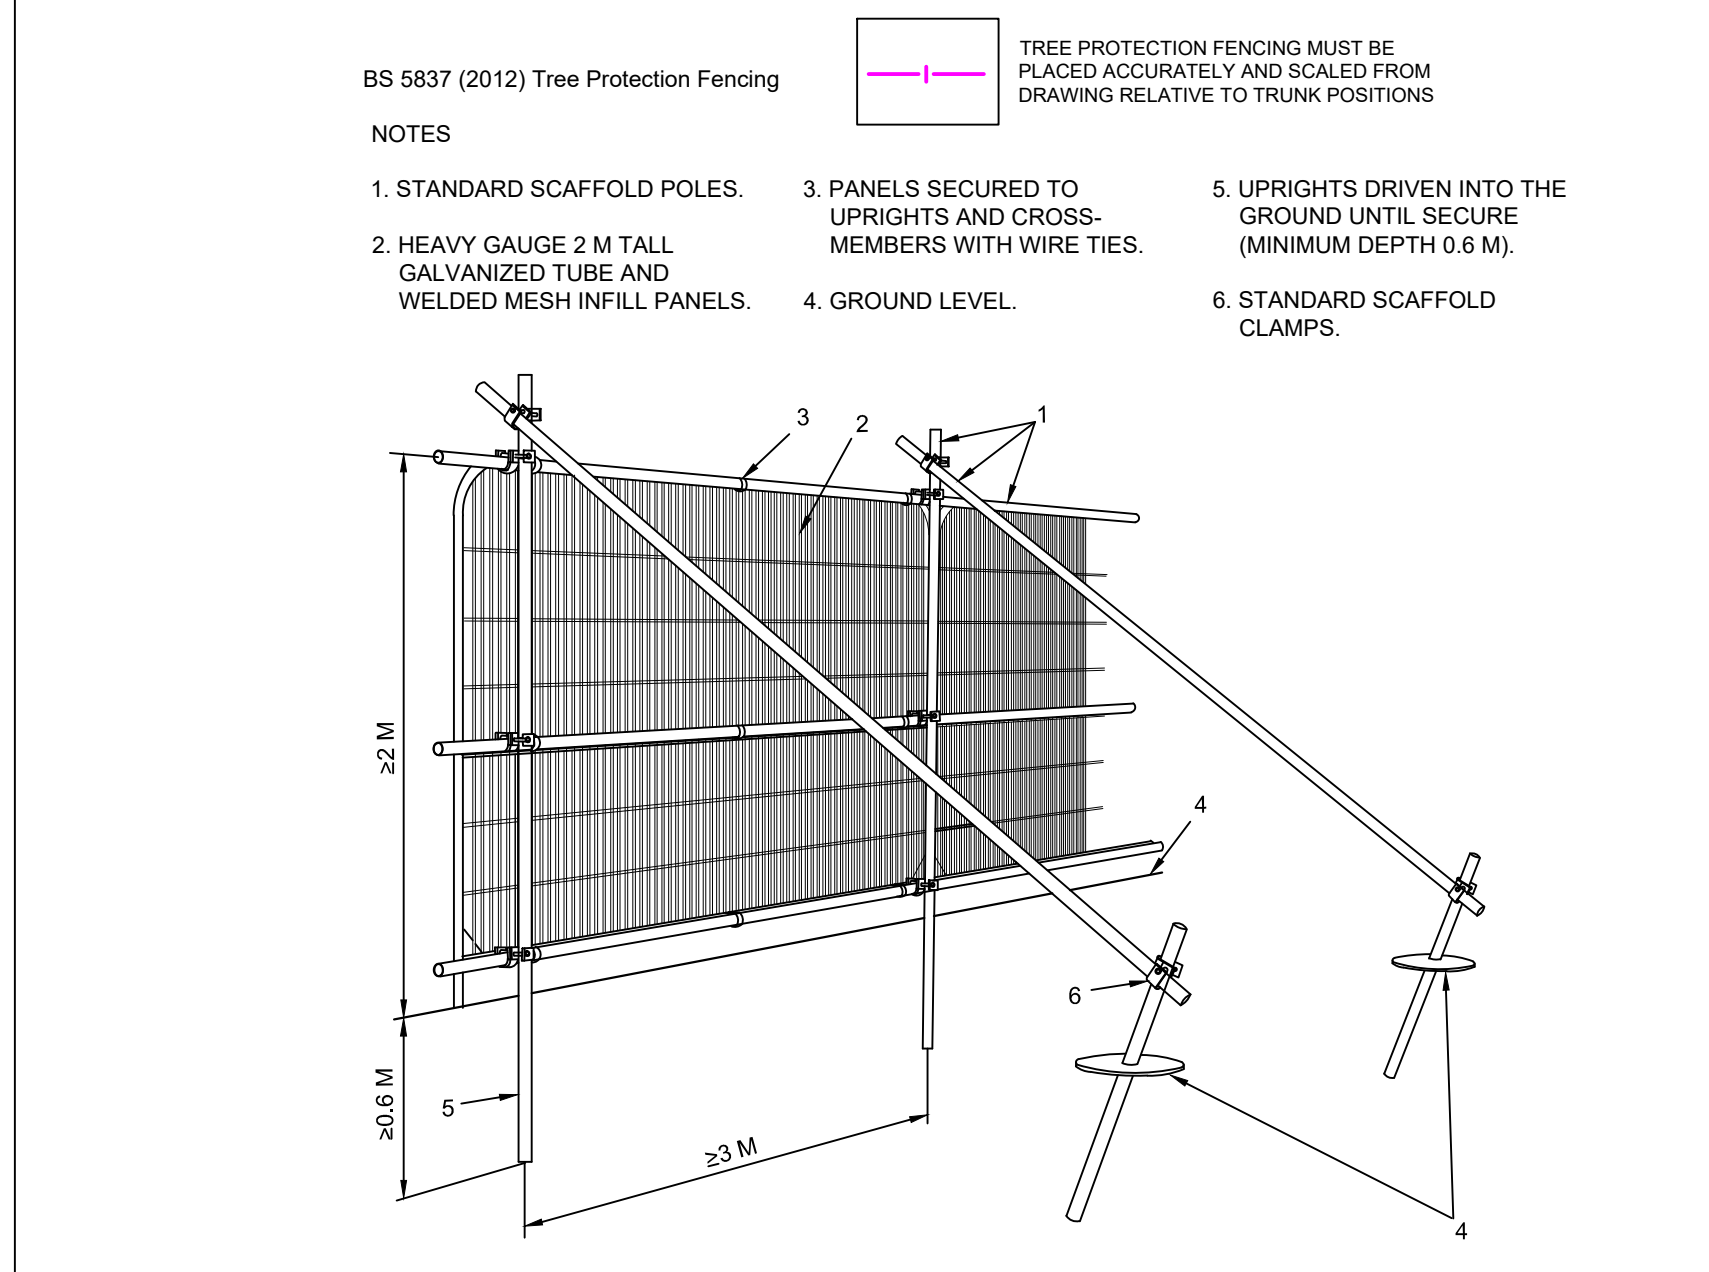
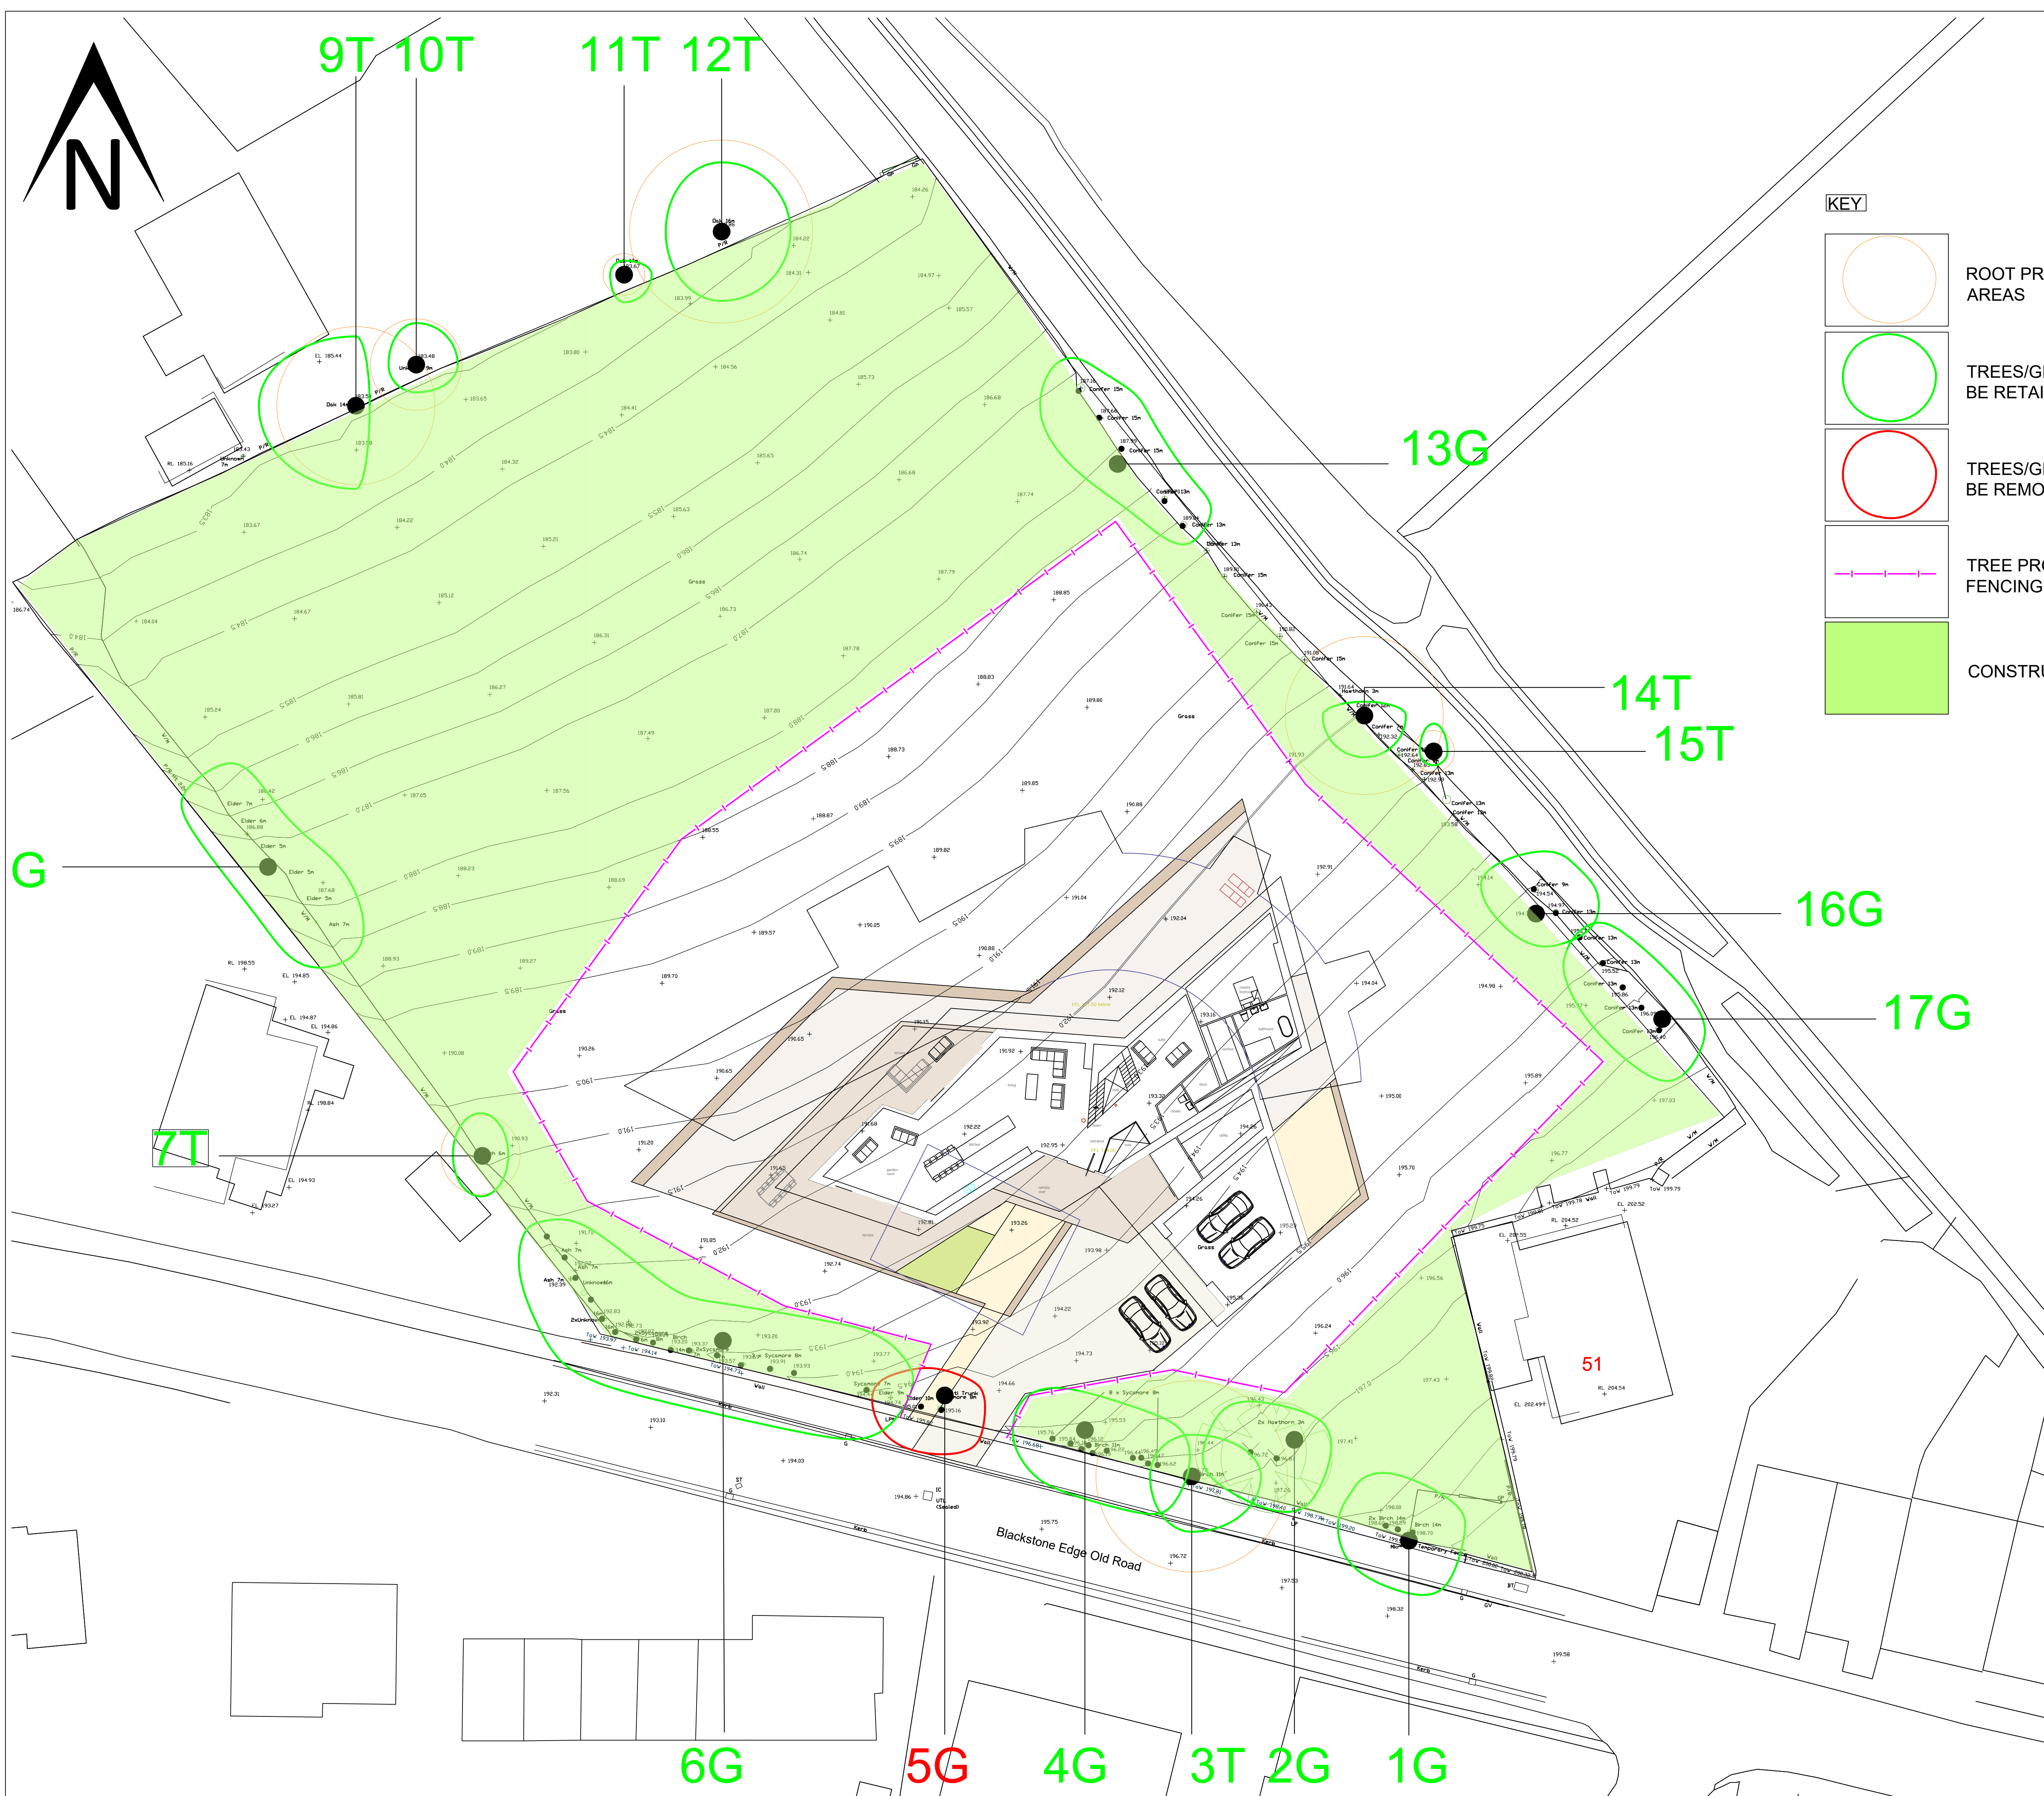


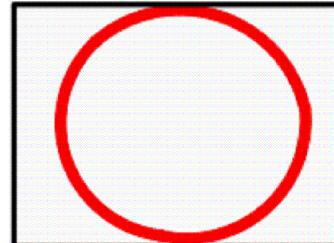

Phase	Requirements	Method				
1 Prior to erection of protective fencing.	Undertake tree and vegetation removal and pruning works Trees/vegetation to be removed: 	Refer to section 5.5 of AIA/MS report. All tree works to be carried out to BS3998: 2010: by suitably qualified and insured professional tree surgeons. The following tree felling must be undertaken at this Phase: Items requiring removal: <table><tr><td>8G</td><td>Ash x 6</td></tr></table> The following tree pruning must be undertaken at this Phase: Items requiring pruning: <table><tr><td>17G</td><td>Leyland Cypress x 4. Remove failed stem from the 2nd tree from the west within the row.</td></tr></table>	8G	Ash x 6	17G	Leyland Cypress x 4. Remove failed stem from the 2nd tree from the west within the row.
8G	Ash x 6					
17G	Leyland Cypress x 4. Remove failed stem from the 2nd tree from the west within the row.					
2 Prior to any construction works on site	Erection of protective fencing: To retain throughout the duration of the development: 	Protective fencing is to be erected in accordance with 5.6 of AIA/MS report. The fencing must comply with the positions shown in the Tree Protection Plan. A scale copy of the Tree Protection Plan must be used as reference and fencing positions measured from the Plan using a scale rule and/or using the provided distances where shown. No works, no storage of materials, no access, or any ground disturbance is to take place within the Tree Protection Barrier Fencing other than works specified within the Arboricultural Method Statement. Fenced areas are to be treated as Construction Exclusion Zones. Warning signs to be placed on all protective fencing. For large sections of fencing the signs must be placed at 20m intervals. Signs must be laminated and securely attached at all corners. Two signs are to be placed side by side; copies of which are attached within Appendix A.				
3 Verifying quality of protective barriers	Verify that the location and quality of tree protection barriers is adequate prior to onset of main site works.	Site visit with Arboricultural Consultant and Site Manager. Tree Officer to be pre-informed of visit. In order for set works to proceed the pro-forma in Appendix B of the AIA/AMS report is to be completed and passed on to the local planning authority: If the protective barriers are not adequately, work is not to proceed until rectified.				
4 Ongoing	Maintain protective fencing	The tree protective barrier fencing is to remain in situ during all construction works.				

Phase	Requirements	Method
5 Completion of main construction and undertaking of landscaping	Landscaping and Dismantling of tree barrier protective fencing.	It is essential that ground levels within the root protection areas are not altered, either by raising or lowering soil levels; even at the landscaping stage. Landscaping operations must be undertaken in a manner that will not impact trees. Landscaping within the root protection area of trees must be undertaken in the following manner: - Any existing ground flora (grass/weeds/scrub) is to be sprayed with a systemic herbicide and left to die-off. - Dead flora is to be strimmed as hard as possible with a brush cutter or similar. The bulk of the strimmed material is to be removed by raking. - A good quality organic topsoil layer may be placed down. Small depressions may be filled (and lightly compacted underfoot). Placed topsoil soil layers must not exceed 100mm depth. - No plant machinery operating within the root protection areas to exceed 1 tonne gross weight and must only operate from propriety ground protection boards such as DuraMatt Access Mats (see Appendix C). - Turf and other planting to proceed thereafter.

Tree Schedule			
Tree Number	Species	RPA Radius	Category
1G	3 x hybrid black poplar		B2
2G	Hawthorn x 3		C2
3T	Hybrid black poplar	6.9m	B2
4G	Sycamore x 10		B2
5G	Ash x 2		U
6G	Sycamore x 11, poplar x 4		B2
7T	Rowan	2.86m	C2
8G	Ash x 6		U
9T	Sycamore	5.7m	B2
10T	Holly	3.3m	B2
11T	Magnolia	1.5m	C2
12T	Lime	6.6m	A2
13G	Leyland Cypress x 5		B2
14T	Leyland Cypress	5.7m	C2
15T	Sycamore	1.5m	C2
16G	1 x sycamore, 2 x holly		C2
17G	Leyland Cypress x 4		B2

No dimension to be scaled from this drawing
© copyright reserved

Date: Dwn: Rev:

Landscape Architecture
Arboriculture

Trevor Bridge Associates Ltd
Ashton Old Bath
Stanford Street West
Ashton-under-Lyne
Lancs OL6 7FW

Tel: 0161-804 2099
E-mail: info@trevorbridge.co.uk

Project
THE EDGE HOUSE, LITTLEBOROUGH
MR M MULDOWNEY

Title
TREE PROTECTION PLAN

Date: SEP'22 Scale(s): 1:200 @ A0 Dwg no: 6898.02 Rev:

Dwn: MD Chkd: MG