

		Inspection Report		40 Francis Road Irlam Manchester M44 6AY	
Section: MH 01	Date: 2023-01-09	Job Number: 70 BOLTON RD	Weather: No rain or snow	PLR:	
Operator: A JONES			Cleaned: yes		


Place: Road: Location:	BOLTON Other pedestrian area	Direction: Catchment: Total Length: Pipe Length:	Downstream	Start ref: Start depth: End ref: End depth:	MH 01 SHARED CONNECTION
Use: Year Laid: Purpose: Lining: Comments:	Combined Investigation of known structural or service defects	Pipe Shape: Width / Height: Flow Control: Pipe Material:	circular ? / 100mm polyvinyl chloride		

0.00m (MH 01)

	Meterage	CD	Code	Observation	Video	Pic.
	0.00m		IC	Start node type, inspection chamber reference number: MH 01	00:00:01	(1)
	1.17m		LL	Line deviates left	00:00:19	(2)
	1.74m		RFJ	Roots, fine at joint	00:00:27	(3)
	2.33m		JDL	Joint displaced, large	00:00:36	(4)
	3.26m		RM	Roots, mass 80%	00:00:56	(5)
4.41m	3.48m		RM	Roots, mass 80%	00:01:04	(6)
	3.70m		RF	Roots, fine	00:01:12	(7)
	4.41m		RFJ	Roots, fine at joint	00:01:20	(8)

		Inspection Report		40 Francis Road Irlam Manchester M44 6AY	
Section: MH 01	Date: 2023-01-09	Job Number: 70 BOLTON RD	Weather: No rain or snow	PLR:	
Operator: A JONES			Cleaned: yes		

4.41m

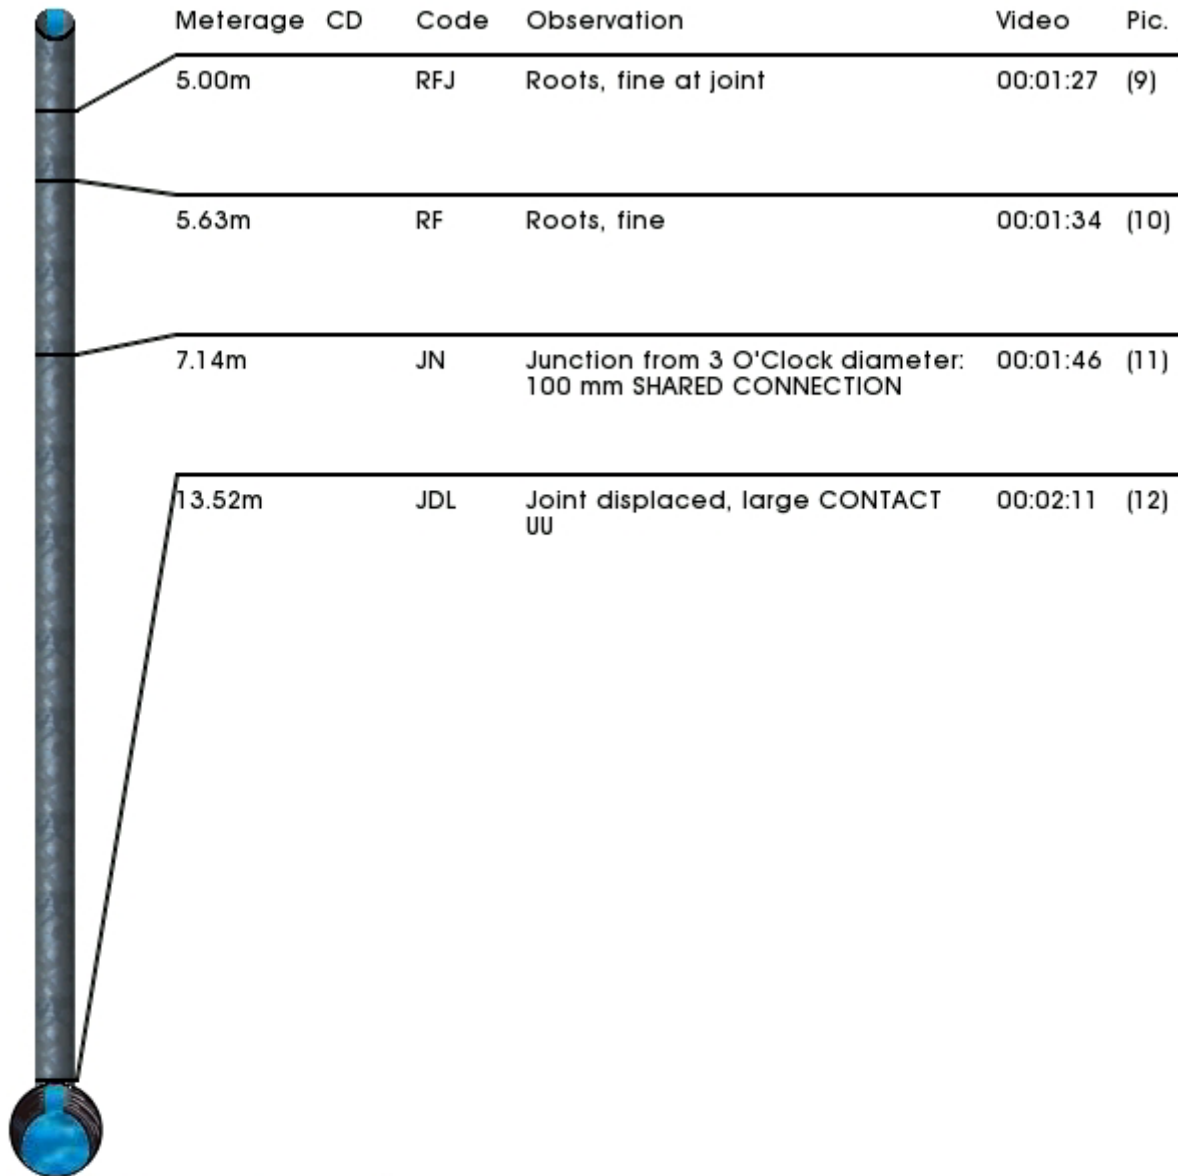


13.52m (SHARED CONNECTION)

		Inspection Report		40 Francis Road Irlam Manchester M44 6AY	
Section: MH 01	Date: 2023-01-09	Job Number: 70 BOLTON RD	Weather: No rain or snow	PLR:	
Operator: A JONES			Cleaned: yes		




(1)

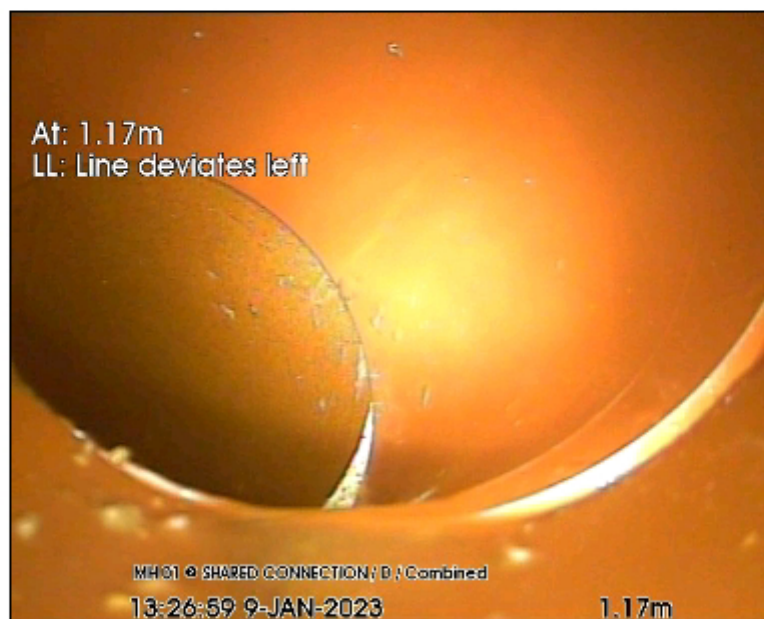

(2)

		Inspection Report		40 Francis Road Irlam Manchester M44 6AY	
Section: MH 01	Date: 2023-01-09	Job Number: 70 BOLTON RD	Weather: No rain or snow	PLR:	
Operator: A JONES			Cleaned: yes		

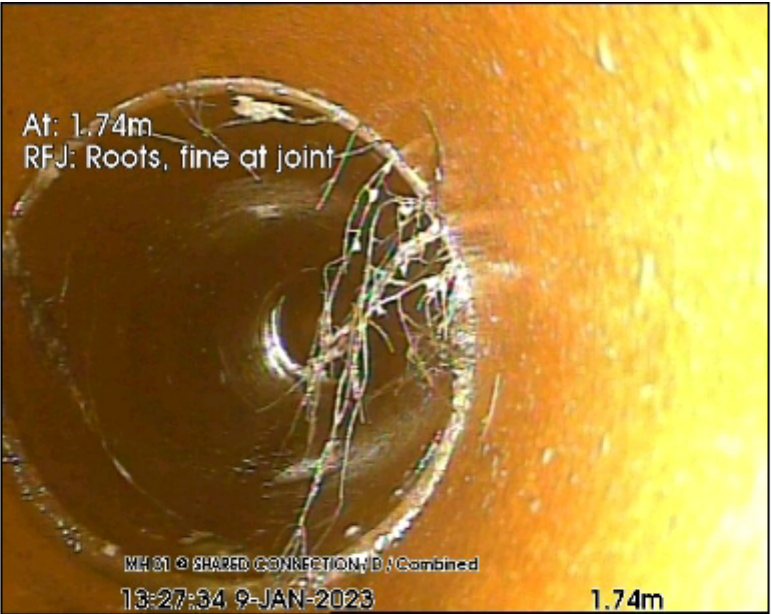


(3)



(4)

		Inspection Report		40 Francis Road Irlam Manchester M44 6AY	
Section: MH 01	Date: 2023-01-09	Job Number: 70 BOLTON RD	Weather: No rain or snow	PLR:	
Operator: A JONES			Cleaned: yes		

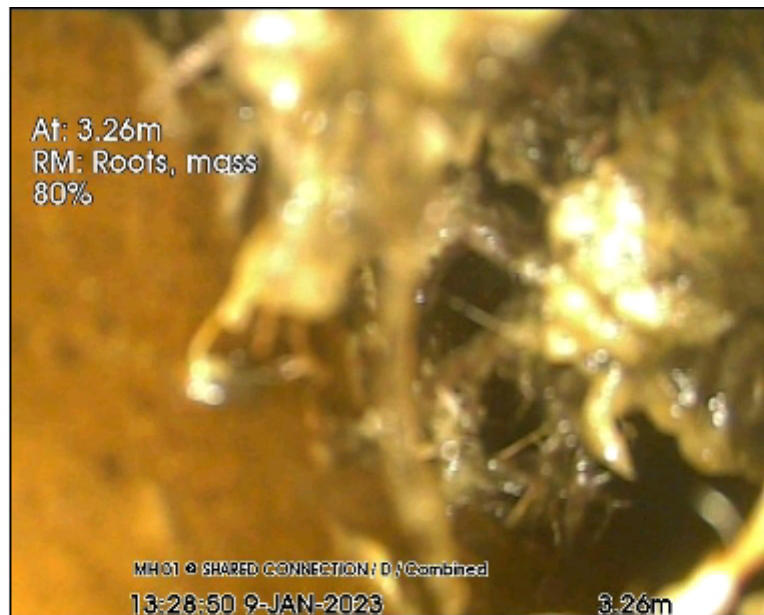

(5)



(6)

		Inspection Report		40 Francis Road Irlam Manchester M44 6AY	
Section: MH 01	Date: 2023-01-09	Job Number: 70 BOLTON RD	Weather: No rain or snow	PLR:	
Operator: A JONES			Cleaned: yes		



(7)



(8)

		Inspection Report		40 Francis Road Irlam Manchester M44 6AY	
Section: MH 01	Date: 2023-01-09	Job Number: 70 BOLTON RD	Weather: No rain or snow	PLR:	
Operator: A JONES			Cleaned: yes		




(9)



(10)

		Inspection Report		40 Francis Road Irlam Manchester M44 6AY	
Section: MH 01	Date: 2023-01-09	Job Number: 70 BOLTON RD	Weather: No rain or snow	PLR:	
Operator: A JONES			Cleaned: yes		

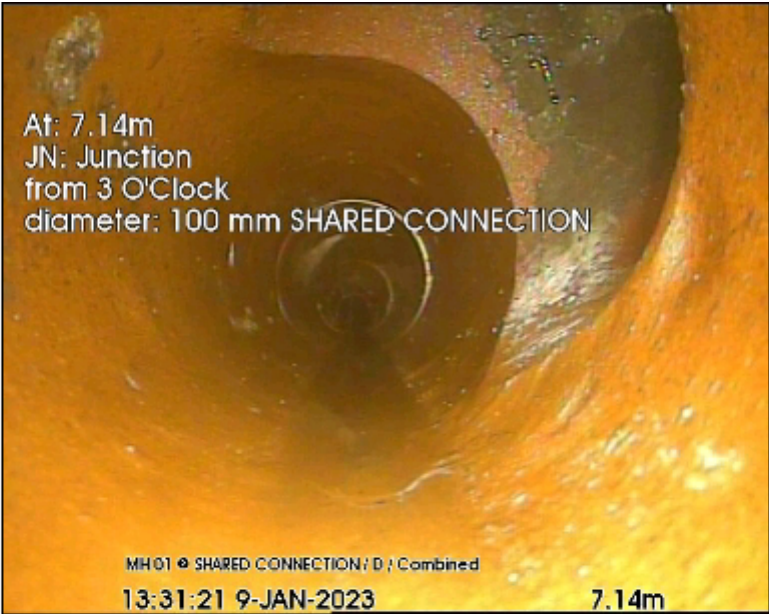

(11)



(12)