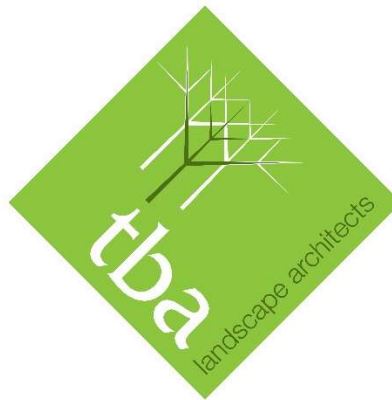


**Trub Farm
Rochdale**

MCI Developments Ltd

**ARBORICULTURAL IMPACT ASSESSMENT
AND
METHOD STATEMENT**

Revision D



tba
landscape architects

Landscape Architecture
Arboriculture

Ashton Old Baths
Stamford Street West
Ashton-under-Lyne
Lancashire
OL6 7FW

Tel: 0161 8042099

Email: info@trevorbridge.co.uk
www.trevorbridge.co.uk

© Copyright reserved Trevor Bridge Associates Limited 2024
The contents of this document must not be copied
in whole or in part without the written consent of
Trevor Bridge Associates Limited

May 2024
Revised May 2024
Revised March 2025
Revised 26.03.25

Ref: MG/7450/AIA&AMS/REVD

Contents

1.0 Introduction

2.0 Arboricultural Impact Assessment

3.0 The Arboricultural Impact Table – Key

3.2 Arboricultural Impact Table – Cascade Chart

3.3 Arboricultural Impact Table Schedule

4.0 General Issues

5.0 Arboricultural Method Statement

6.0 Method Statement Schedule

APPENDIX A - SIGNS TO ATTACH TO PROTECTIVE BARRIER FENCING

APPENDIX B – SITE INSPECTION PRO-FORMA

APPENDIX C – GROUND PROTECTION BOARDS

Trub Farm, Rochdale

1.0 Introduction

- 1.1 This document has been prepared by Trevor Bridge Associates on the behalf of MCI Developments Ltd. It provides an Arboricultural Impact Assessment (AIA) and Arboricultural Method Statement (AMS) in regard to the following proposed development.
- Construction of 158 dwellings and associated infrastructure.
- 1.2 This document follows, and should be read in conjunction with, a pre-development tree survey that was undertaken by TBA Ltd in May 2024 (ref: *MG/7450/TSR/APR24*).
- 1.3 For the purposes of preparing this document the following material was referenced:
- **Client drawing: *Site Layout. Job Ref.: 000. Drawing. No. MCI-100-DR-A-500. Rev.: PL04***
- 1.4 This report assesses the potential impacts to trees due to consequences of the development proposals, as well as specifying the necessary methodologies required during construction to ensure that trees being retained are afforded adequate protection from harm.
- 1.5 Accompanying this report is the following drawing which must be read in conjunction with this report:
- ***TBA Drawing: Tree Protection Plan. Drawing No. 7450.07 Revision E. Date: March 2025.***

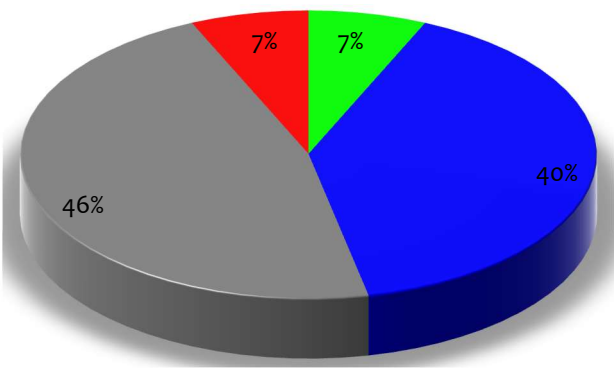
2.0 Arboricultural Impact Assessment

2.1 The consequences on existing trees situated within and adjacent the proposed development site are considered.

2.2 The value of the trees and vegetation surveyed

In the initial tree survey report a total of 15 items were surveyed within and adjacent the development site. These items comprised 7 individual trees, 6 groups, and a single hedge, and woodland. The chart and table below show the ratio of tree retention categories on the site and number of items (be it groups or individuals etc that were surveyed).

Vegetation retention category ratios



A
B
C
U


Retention Category	No.
A (High Value)	1
B (Moderate value)	6
C (Low value)	7
U (Remove)	1

Trub Farm, Rochdale




3.0 Arboricultural Impact Table - Key

- 3.1 The Arboricultural Impact Table (section 3.3) lists all items surveyed within the site. The tree data is taken from the initial tree survey report. The table is colour coded for ease of reference, particularly in relation to the value of trees and the potential impact that may occur to them:

Tree Values

 High	High value tree / group / hedge as included within the initial tree survey
 B (Moderate)	Moderate value tree / group / hedge as included within the initial tree survey
 C (Low)	Low value tree / group / hedge as included within the initial tree survey
 U (Remove)	Tree / group / hedge in poor condition. Retention unsustainable within context of development

Impacts on Tree's / Groups

 Removal	Tree / Group / Hedge will require removal in order to facilitate the development proposals
 Partial Removal	Group or hedge will require partial removal to facilitate the development proposals
 High	The development proposals will have a high impact the on the tree /group / hedge
 Moderate	The development proposals will have a moderate impact on the tree / group /hedge
 Low	The development proposals will have a low impact on the tree / group / hedge
 None	The development proposals will have no impacts on the tree / group / hedge

Trub Farm, Rochdale

3.2 Arboricultural Impact Table - Cascade Chart:

3.2.1 Tree **Values** are taken from BS: 5837 and comprise of the following:



3.2.2 The **Impacts** comprise of 6 elements:



3.2.3 Causes of impacts comprise of 6 factors: **'None'**, **'To facilitate development'**, **'Due to poor condition'**, **'Direct disturbance to roots'**, **'Pruning required'** and **'Possible future pruning pressure due to shade and other factors'**.

3.2.4 Comments are also included providing more information where necessary.

	REMOVAL	PARTIAL REMOVAL	HIGH	MODERATE	LOW
TO FACILITATE DEVELOPMENT	Tree / group requires removal.	Partial removal of group is required. i.e., 'a section of hedge may require removal to allow a new access road'.	N/A	N/A	N/A
DUE TO POOR CONDITION	Tree or group require removal due to poor structural and / or physiological condition.	Part of group require removal due to poor structural and / or physiological condition.	N/A	N/A	N/A
DIRECT DISTURBANCE TO ROOTS	N/A	N/A	In many case this will result in the loss of tree/s - refer to 'TO FACILITATE DEVELOPMENT' . In rare cases a Tree/s may be retained but damage will occur to the roots.	Disturbance will be caused to roots of a tree/s that are likely to result in some physiological and structural dysfunction. The extent of damage does not require trees to be felled. Remedial actions may be taken in some cases that would help mitigate against damage but site topography, tree age, condition and species condition may result in disturbance being considered MODERATE as opposed to LOW .	Activity will occur within the root protection area of trees which will have a low impact, or can be mitigated by special measures.
PRUNING REQUIRED	N/A	N/A	Pruning that may retain a tree but will have a potential impact on the tree condition and visual appearance	Pruning is required that is acceptable within recommendations within BS3008:2010, but would require a material alteration to the tree/group affected.	Pruning is required that will have little impact to the structural, physiological and visual amenity of a tree or group.
POSSIBLE FUTURE PRUNING PRESSURE DUE TO SHADE OR OTHER FACTORS	Removal of tree/s required as retention is unsustainable and/or undesirable within the context of development. i.e. fast growing tree in small garden.	Partial removal of tree/s required as retention is unsustainable and/or undesirable within the context of development. i.e. fast growing tree in small garden.	Tree/s likely to cause significant shading. i.e. small garden areas with dense mature trees to south.	Some level of shade or other inconvenience will occur. Not highly oppressive, but some residents may seek management of trees in long term.	Some level of shading / overhang will occur.

3.3 ARBORICULTURAL IMPACT TABLE SCHEDULE

Ref No.	Species	Value	Impact	Impact Cause	Management Options / Comments	Other
1T	Goat Willow	C1	None	N/a	Off site tree unaffected by development proposals.	
2G	2x Hawthorn	C1	None	N/a	Off site group unaffected by development proposals.	Group falls within easement for existing sewers.
3G	Group of Goat Willow, Elder and Hawthorn	B2	None	N/a	Off site group unaffected by development proposals.	
4T	Goat Willow	C2	None	N/a	Off site tree unaffected by development proposals.	A split and fallen branch that partially lies across the boundary requires cutting back to the boundary line.
5T	Goat Willow	C1	Low	Direct disturbance to roots	Minor ingress within the outer section of the root protection area.	
6G	Group of Hawthorn, Elderberry and young Silver Birch and Goat Willow	C1	None	N/a	Off site group unaffected by development proposals.	

Trub Farm, Rochdale

Ref No.	Species	Value	Impact	Impact Cause	Management Options / Comments	Other
7T	Goat Willow	B2	None	N/a		
8T	Goat Willow	U	None	N/a		
9T	Goat Willow	B2	None	N/a		
10T	Common Oak	C3	None	N/a	The tree's elevated position atop a retaining structure isolates it from ground disturbance within the site.	

Trub Farm, Rochdale

Ref No.	Species	Value	Impact	Impact Cause	Management Options / Comments	Other
11W	Mixed Species Woodland Area	A3	Moderate	Pruning required, Possible future pruning pressure due to shading and/or other factors	Pruning required to boundary line to facilitate the construction of Apartment block. Pressure for pruning may occur as rear gardens will be shaded from mid-day onward.	
			Low	Direct disturbance to roots	While some boundary trees may be impacted by works, they are generally smaller specimens. The larger trees and bulk of the woodland will remain unaffected.	
12G	Group of Goat Willow and Silver Birch	B2	None	N/a	Off site group unaffected by development proposals.	
13H	Hawthorn Hedge	B3	Moderate	Direct disturbance to roots	While it is possible that no disturbance will occur, potential alterations to site levels may impact the trees.	Full details of the external works are required in order to fully ascertain impacts to the hedge.
			Low	Pruning required	The site side of the hedge requires cutting back to provide space for the installation of bin collection point.	

Trub Farm, Rochdale

Ref No.	Species	Value	Impact	Impact Cause	Management Options / Comments	Other
14G	2x Goat Willow	C1	Removal	To facilitate development	New access will require loss of the group.	One of the trees may be situated outside the redline boundary. A topographical survey is required to ascertain an accurate position.
15G	Hawthorn Hedge	B3	Low	Direct disturbance to roots	While it is possible that no disturbance will occur, potential alterations to site levels may impact the trees.	Full details of the external works are required in order to fully ascertain impacts to the hedge.

4.0 General Issues

4.1 Installation of underground services

At the time of considering the layout design, no information was available relating to the proposed location of underground services. By default no services shall be placed within the identified Root Protection Areas of trees being retained. While it is possible in some cases that underground services may be placed within Root Protection Areas, this is best done under arboricultural supervision (at least initially). Where special installation methods are necessary (such as pipe jacking) supplementary method statements must be provided. The proposed location of underground infrastructures must be made available to the local planning authority prior to installation.

4.2 Storage of materials, contractor parking and site logistics

Logistically the site has adequate space for the placement of site huts and material storage. By default all compounds and storage areas are to be outside root protection areas/construction exclusion zones.

4.3 Level changes on site

No excavation or raising of ground levels are to occur within the construction exclusion zones within the site demarked by tree protection barrier fencing (green coloured zones) within the Tree Protection Plan.

5.0 Arboricultural Method Statement

- 5.1 The Arboricultural Method Statement (AMS) specifies all measures to be undertaken to ensure the ongoing health and viability of trees to be retained within the proposed development.
- 5.2 This AMS is in compliance with British Standard 5837: 2012. **Accompanying this document is a plan that shows the position of protective fencing and any additional special measures that are required. This plan is referred to as the Tree Protection Plan.**
- 5.3 The AMS must be considered a 'working document'. It must be made available to the developer, site manager, and LPA. A copy of this document and the Tree Protection Plan must be kept on the development site at all times. All site operatives must be briefed on the main contents of this document.
- 5.4 It is the Site/Project Manager's responsibility to ensure that the detail of this AMS and the TPP and any agreed amendments are known and understood by all site personnel. A copy of this AMS and the TPP will be available for reference on site by the Project and Site Managers, and will form the basis of the management of all works relating to the trees on the site following commencement of the project. The Site Manager shall induct all personnel who could have an impact on trees on the content of this document.

5.5 **Tree Works –General Issues**

- 5.5.1 All tree works (tree felling and pruning) are to take place prior to any site operations and immediately before the installation of protective fencing.
- 5.5.2 All works to the existing trees are to be carried out by a fully qualified tree surgeon and in accordance with BS 3998 (2010) *Recommendations for Tree Work*.
- 5.5.3 The necessary tree surgery works should be carried out **before** any construction work starts and immediately before erection of protective fencing. Any works will include any trees that require removal in order to facilitate construction and access. No tree works must be carried out unless permission is provided by the local planning authority. Tree works to any protected trees (trees within a Conservation Area or subject to a Tree Preservation Order) that do not require works to directly enable the development to proceed will require a notification/application to be made to the Local Planning Authority. Any tree works required in order to directly facilitate the development to proceed (such as tree felling) must not proceed unless full planning consent and written consent is given by the local planning authority.
- 5.5.4 Wildlife issues and timing of operations. The following must be observed:
- Bats. Under current legislation it is an offence to 'intentionally or recklessly disturb a bat' or 'damage, destroy or block access to the resting place of any bat'. For further details consultation must be made with the Statutory Nature Conservancy Organisation (Natural England, 0300 060 1842 www.naturalengland.org.uk). Where relevant any current ecological surveys for the site will take precedence in this matter.
- 5.5.5 Birds. It is an offence to kill, injure or take any wild bird; or take, damage or destroy the nest of any wild bird while it is in use or being built. Therefore work likely to disturb nesting birds should be avoided from late March to August.

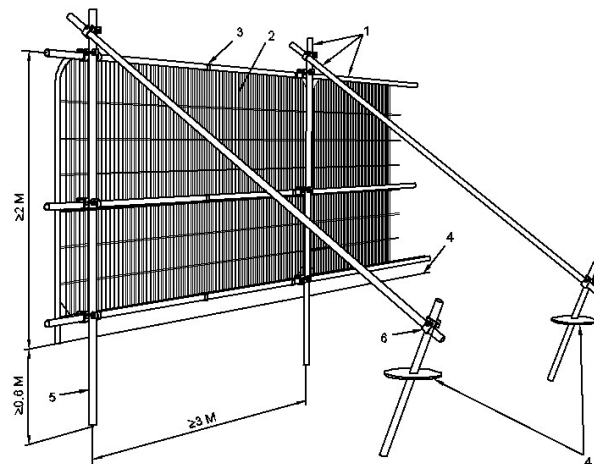
5.6 Tree Protective Barrier Fencing

- 5.6.1 Protective barriers must be erected prior to any site operations. The protective barriers are essential to prevent root severance or compaction of the soil in the Root Protection Areas, and so give the best chance of continued good health of the retained trees.
- 5.6.2 Tree protective barriers are to comprise a vertical and horizontal scaffold framework which is braced to withstand impacts, and not easily moved or relocated by site operatives (to prevent opportunistic moving of the barrier fences). The vertical tubes should be spaced at intervals of no more than 3m and driven securely into the ground. Onto this framework welded mesh panels should be securely fixed (such as Heras). The fencing is to be placed accurately as shown within the Tree Protection Plan. A scale copy of the tree protection plan shall be referenced and scale measurements taken to indicate the necessary fencing positions.

BS 5837 (2012) Tree Protection Fencing

NOTES

- | | | |
|--|---|--|
| 1. STANDARD SCAFFOLD POLES. | 3. PANELS SECURED TO UPRIGHTS AND CROSS-MEMBERS WITH WIRE TIES. | 5. UPRIGHTS DRIVEN INTO THE GROUND UNTIL SECURE (MINIMUM DEPTH 0.6 M). |
| 2. HEAVY GAUGE 2 M TALL GALVANIZED TUBE AND WELDED MESH INFILL PANELS. | 4. GROUND LEVEL. | 6. STANDARD SCAFFOLD CLAMPS. |



Care must be taken when locating vertical poles to avoid underground services and, in the case of bracing poles, also to avoid contact with structural roots. If the presence of underground services prevents the use of driven poles, an alternative specification should be prepared; such alternatives could include the attachment of the panels to a free standing scaffold support framework.

Where fencing is required adjacent the site boundaries it is acceptable to use Hoarding to double as protective fencing but only where the exact location of the protective fencing is adhered to (as per the Tree Protection Plan) and where it is hand installed only.

5.7 General Requirements

- 5.7.1 Developers must enforce the methods of protection identified within the statement. All contractors must also agree to them. Any failure to comply with them must be dealt with by the developer. Any damage that may occur to trees due to failure to observe the method statement must be reported to the Local Planning Authority and arboricultural advice must be sought.
- 5.7.2 No pruning, lopping, felling or severance of roots is to take place without prior consent of the local authority or unless in compliance with specifications included within the Method Statement.
- 5.7.3 **The ground levels within the protected areas, be they fenced or special working areas, must neither be raised nor excavated unless specifically in compliance with requirements within this method statement.**
- 5.7.4 No ropes, cables, services, or notice boards shall be fixed to existing trees.
- 5.7.5 Fires should not be permitted, or else not lit where flames could extend to within 10m of the foliage, branches or trunk of any trees (it should be noted that local environmental health authorities may have specific restrictions on fires),
- 5.7.6 Should temporary access within the Root Protection Area be required that is not included within the method statement, an agreement, in advance, with the consultant and the LPA must be made. The fence may need to be re-aligned and the ground surface protected. For vehicular access this protection will need to be specifically detailed and agreed.
- 5.7.7 Care must be taken in regard to tall or wide loads, or use of plant with booms, jibs and counterweights. Where machinery may be required to operate in the vicinity of trees a banksman must ensure that no direct physical damage is caused to trees. It must be checked that any materials or vehicles entering the site are able to do so without causing damage to adjacent trees.
- 5.7.8 Any material that will contaminate soil (e.g. concrete mixings, and vehicle washings) must not be discharged within 10m of any Root Protection Area. In addition it is essential that allowance be made for the slope of the ground so that damaging materials cannot run towards trees, or Root Protection Areas. If diesel and fuel containers are used or stored on site they must be kept within a plastic container bund to prevent any ground contamination and spill kits must be kept available to remediate any spillage.

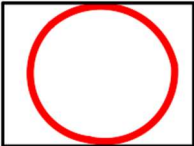
5.8 Arboricultural monitoring

- (i) The arboricultural consultant (or local authority Tree Officer) shall be consulted whenever an unexpected issue occurs that involves any retained tree on site including access within the Protection Area.
- (ii) No amendments shall be made to the methods detailed in this Arboricultural Method Statement without the agreement of the consultant or local planning authority Tree Officer.
- (ii) If the site agent is at all unclear about exact compliance with any of the above requirements, or if requested by any other party, then a pre-start meeting shall be arranged with the architect, site agent, local authority tree officer and arboricultural consultant in attendance as necessary.

5.9 Health and Safety Issues

All operations must be carried out with full regard to Health and Safety requirements. Due to the diverse nature of recommendations included (e.g. tree surgery works, construction etc) it is necessary that supervisors of those undertaking recommended operations undertake risk assessments prior to starting the relevant works. It should be the Site Managers/developers responsibility to ensure that risk assessments are submitted prior to undertaking relevant works.

6.0 Method Statement Schedule

Phase	Requirements	Method												
1 Prior to erection of protective fencing.	Undertake tree and vegetation removal and pruning works Trees/vegetation to be removed:  Trees/vegetation to be pruned: 	Refer to section 5.5 of AIA/MS report. All tree works to be carried out to BS3998: 2010: by suitably qualified and insured professional tree surgeons. The following tree felling must be undertaken at this Phase: <table><tr><th colspan="2">Items requiring removal:</th></tr><tr><td>14G</td><td>2x Goat Willow</td></tr></table> The following tree pruning must be undertaken at this Phase: <table><tr><th colspan="2">Items requiring pruning:</th></tr><tr><td>4T</td><td>Cut back fallen branch to the site boundary.</td></tr><tr><td>11W</td><td>Trim back canopy foliage to the boundary.</td></tr><tr><td>13H</td><td>Trim back the site side lateral foliage back to the boundary to provide clearance.</td></tr></table>	Items requiring removal:		14G	2x Goat Willow	Items requiring pruning:		4T	Cut back fallen branch to the site boundary.	11W	Trim back canopy foliage to the boundary.	13H	Trim back the site side lateral foliage back to the boundary to provide clearance.
Items requiring removal:														
14G	2x Goat Willow													
Items requiring pruning:														
4T	Cut back fallen branch to the site boundary.													
11W	Trim back canopy foliage to the boundary.													
13H	Trim back the site side lateral foliage back to the boundary to provide clearance.													
2 Prior to any construction works on site	Erection of protective fencing: To retain throughout the duration of the development: 	Protective fencing is to be erected in accordance with 5.6 of AIA/MS report. The fencing must comply with the positions shown in the Tree Protection Plan. A scale copy of the Tree Protection Plan must be used as reference and fencing positions measured from the Plan using a scale rule and/or using the provided distances where shown. No works, no storage of materials, no access, or any ground disturbance is to take place within the Tree Protection Barrier Fencing other than works specified within the Arboricultural Method Statement. Fenced areas are to be treated as Construction Exclusion Zones. Warning signs to be placed on all protective fencing. For large sections of fencing the signs must be placed at 20m intervals. Signs must be laminated and securely attached at all corners. Two signs are to be placed side by side; copies of which are attached within Appendix A.												
3 Verifying quality of protective barriers	Verify that the location and quality of tree protection barriers is adequate prior to onset of main site works.	Site visit with Arboricultural Consultant and Site Manager. Tree Officer to be pre-informed of visit. In order for set works to proceed the pro-forma in Appendix B. of the AIA/AMS report is to be completed and passed on to the local planning authority: If the protective barriers are not adequately, work is not to proceed until rectified.												
4 Ongoing	Maintain protective fencing	The tree protective barrier fencing is to remain in situ during all construction works.												

Phase	Requirements	Method
5 Completion of main construction and undertaking of landscaping	Landscaping and Dismantling of tree barrier protective fencing.	It is essential that ground levels within the root protection areas are not altered, either by raising or lowering soil levels; even at the landscaping stage. Landscaping operations must be undertaken in a manner that will not impact trees. Landscaping within the root protection area of trees must be undertaken in the following manner: - Any existing ground flora (grass/weeds/scrub) is to be sprayed with a systemic herbicide and left to die-off. - Dead flora is to be strimmed as hard as possible with a brush cutter or similar. The bulk of the strimmed material is to be removed by raking. - A good quality organic topsoil layer may be placed down. Small depressions may be filled (and lightly compacted underfoot). Placed topsoil soil layers must not exceed 100mm depth. - No plant machinery operating within the root protection areas to exceed 1 tonne gross weight and must only operate from propriety ground protection boards such as DuraMatt Access Matts (see Appendix C). - Turf and other planting to proceed thereafter.
6 Completion of main construction and installation of boundary treatments	Garden and perimeter fencing within RPA of retained trees	In addition to the points addressed in 7 above, within RPAs of retained trees the wooden fencing shall be installed as follows: - Hand tools only - Exploratory post holes to be dug. Any roots encountered less than 2.5cm diameter should be cleanly cut back. - Roots in excess of 2.5cm can only be removed once arboricultural advice has been sought. - Where roots in excess of 8cm are encountered, an alternative location for the post hole is required. - Prior to the pouring of concrete a non-permeable membrane must fully line the post hole.

APPENDIX A - SIGNS TO ATTACH TO PROTECTIVE FENCING



Construction and Trees



Why Is Fencing Erected Around Trees?

1. The major cause of damage to trees on construction sites is due to **soil compaction**.
2. Roots use the spaces between soil particles to obtain Oxygen, Water and Nutrients.
3. Heavy plant and machinery compresses (compacts) the soil, squashing out the air spaces and preventing root function.
4. A compacted soil structure will stay compacted.
5. Consequently the tree suffers and will show signs of branch die-back.
6. Symptoms such as die-back may take several years to appear.
7. Soil compaction over roots can be prevented by maintaining a fenced exclusion zone over the tree roots.
8. The exclusion zone distance is calculated using British Standard 5837.
9. Protective Fencing is installed at the calculated distance.
10. Protective Fencing is a condition of planning approval, if it is removed or repositioned the construction firm is in breach of a condition and may be subjected to legal action.

APPENDIX B – Site Inspection pro-forma

SITE INSPECTION - ARBORICULTURAL METHOD STATEMENT
(Ref: MG/7450/AIA&AMS/REVD)

Site Address : Trub Farm, Rochdale

Name of Arboricultural Inspector:

Date of Inspection:

The purpose of this site inspection is to confirm with requirements within the above referenced Arboricultural Method Statement.

The site is to be visited and the placement of tree protection barrier fencing checked for compliance with specifications within the method statement.

Further works on the site shall not proceed until the tree protective fencing is installed in compliance with the method statement and in submitting this document to the Local Planning Authority the inspector is verifying that the necessary specifications have been met.

Notes (continue on separate attachments as necessary):

Photographs: (attach below):

APPENDIX C – GROUND PROTECTION BOARDS

(to be used for light plant access when undertaking temporary operations within the root protection areas of trees- such as fencing and landscaping)

DuraMatt Single Sided Access Mat - 2400mm x 600mm x 10mm - 17kg

Product Code: DURA-240060017SS



MultiMatts are the market leading provider of temporary access and ground protection solutions. Temporary Access and Ground Protection Mats are now an essential requirement for the construction, civil engineering and groundwork industries, although they're also used extensively within the festival and outdoor event sectors.

Our DuraMatt - Light/Medium Duty Access Mat is manufactured from 100% recycled Low Density Polyethylene (LDPE) and weigh just 17kg. DuraMatt is ideal for both short and long term projects and can be used in a variety of applications.

DuraMatt is capable of taking weights of 15-20 tonnes* depending on the ground conditions, they've also been designed with a connection hole in each corner should the mats need to be connected together.

DuraMatt has a unique diamond pattern "non-slip" surface on one side, the other side has been left smooth for working on hard standing areas and sensitive grass, it also allows contractors to use the mat as a spoil board for construction materials. It's flexible nature allows the mats to follow the contours of the ground to deliver highly effective access over undulating or sloping terrain.

Standard colour option is Grey – Please contact us for other colours or customisation.

Key Applications

- Ground Work Spoil Boards
- Temporary Roadways and Car Parks
- Pedestrian Walkways
- Heritage sites; Eco-Sensitive areas
- Sports and Leisure Events
- Golf Course and Sports Field Maintenance
- Ground Protection
- Emergency Access Routes
- Utilities
- Infrastructure Maintenance

Key Features and Benefits

- 2.4m x 0.6m x 10mm - Weight 17kg
- Maximum Weight loading approx. 15-20 tonnes*
- Unique diamond pattern "non-slip" surface for optimal grip
- Avoids health and safety issues
- Avoids property, heritage and environmental damage and reinstatement
- Avoids vehicles becoming bogged down
- Low transportation and handling costs
- Various connection options for different ground conditions and equipment
- Premium 100% recycled (LD) polyethylene which is 100% recyclable

END OF DOCUMENT