



Project

Project Name: LITTLEBOROUGH HOLLINGWORTH RD
Project Date: 06/11/2025
Inspection Standard: MSCC5 Sewers & Drainage GB (SRM5 Scoring)

Table of Contents

Project Name	Project Number	Project Date
LITTLEBOROUGH HOLLINGWORTH RD		06/11/2025

Project Information	P-1
Scoring Summary	P-2
Section Profile	P-3
Section Summary	P-4
Section Item 2: 02 > 03 (02X)	1
Section Item 3: 02 > 03 (02X)	2
Section Item 4: 03 > 04 (03X)	3
Section Item 5: 04 > 05 (04X)	4
Section Item 6: 05 > 06 (05X)	5
Section Item 7: 01 > 02 (01X)	6

Project Information

Project Name
LITTLEBOROUGH HOLLINGWORTH RD**Project Number****Project Date**
06/11/2025

Client

Company: VISTRY
Contact: SAKHILE MAJOLA
Street: REDHALL AVE
Town or City: WAKEFIELD
County: WEST YORKSHIRE
Post Code: WF1 2UL

Site

Street: HOLLINGWORTH RD
Town or City: LITTLEBOROUGH

Contractor

Company: ADIEN
Contact: JOE WALSHAW
Department: DEREK LEWIS BLDG
Street: MILLFIELD IND EST
Town or City: DONCASTER
County: SOUTH YORKSHIRE
Post Code: DN5 0SJ

Scoring Summary

Project Name
LITTLEBOROUGH HOLLINGWORTH RD

Project Number

Project Date
06/11/2025

Structural Defects

Item No.	PLR	Grade	Description
All inspected pipes are in an acceptable structural condition (< grade 3).			

Service / Operational Condition

Item No.	PLR	Grade	Description
All inspected pipes are in an acceptable service condition (< grade 3).			

Abandoned Surveys

Item No.	PLR	Description
6	05X	Survey abandoned

Information

These scoring summaries are based on the SRM grading from the WRc.

Section Profile

Project Name
LITTLEBOROUGH HOLLINGWORTH RD

Project Number

Project Date
06/11/2025

Circular, 600 mm, 0 mm

Item No.	Upstream Node	Downstream Node	Date	Road	Material	Total Length	Inspected Length
2	02	03	06/11/2025	HOLLINGWORTH RD	Concrete	43.90 m	43.90 m
3	02	03	06/11/2025	HOLLINGWORTH RD	Concrete	84.40 m	84.40 m
4	03	04	06/11/2025	HOLLINGWORTH RD	Concrete	8.30 m	8.30 m
5	04	05	06/11/2025	HOLLINGWORTH RD	Concrete	49.60 m	49.60 m
7	01	02	11/11/2025	HOLLINGWORTH RD	Concrete	31.10 m	31.10 m

Total: 5 Inspections x Circular 600 mm, 0 mm = 217.30 m Total Length and 217.30 m Inspected Length

Total: 5 Inspections = 217.30 m Total Length and 217.30 m Inspected Length

Section Summary

Project Name LITTLEBOROUGH HOLLINGWORTH RD	Project Number	Project Date 06/11/2025
--	-----------------------	-----------------------------------

Number of sections	6
Total length of sections	237.30 m
Total length of inspected sections	225.30 m
Total length of not inspected sections	12.00 m
Number of abandoned inspections	1
Number of section inspection photos	0
Number of section inspection videos	0
Number of section inspection scans	0
Number of section inclination measurements	0

PLR:	02X	Upstream Node:	02
Inspection Direction:	Downstream	Downstream Node:	03
Inspected Length:	43.90 m	Dia/Height:	600 mm
Total Length:	43.90 m	Material:	Concrete

No.	m+	Code	Observation
1	0.00	MH	Start node, manhole, reference: 02
2	0.00	WL	Water level, 15% of the vertical dimension
3	43.90	MHF	Finish node, manhole, reference: 03

PLR:	02X	Upstream Node:	02
Inspection Direction:	Downstream	Downstream Node:	03
Inspected Length:	84.40 m	Dia/Height:	600 mm
Total Length:	84.40 m	Material:	Concrete

No.	m+	Code	Observation
1	0.00	MH	Start node, manhole, reference: 02
2	0.00	WL	Water level, 10% of the vertical dimension
3	84.40	MHF	Finish node, manhole, reference: 03

PLR:	03X	Upstream Node:	03
Inspection Direction:	Downstream	Downstream Node:	04
Inspected Length:	8.30 m	Dia/Height:	600 mm
Total Length:	8.30 m	Material:	Concrete

No.	m+	Code	Observation
1	0.00	MH	Start node, manhole, reference: 03
2	0.00	WL	Water level, 5% of the vertical dimension
3	8.30	MHF	Finish node, manhole, reference: 04

Section Summary

Project Name LITTLEBOROUGH HOLLINGWORTH RD	Project Number	Project Date 06/11/2025
--	-----------------------	-----------------------------------

PLR:	04X	Upstream Node:	04
Inspection Direction:	Downstream	Downstream Node:	05
Inspected Length:	49.60 m	Dia/Height:	600 mm
Total Length:	49.60 m	Material:	Concrete

No.	m+	Code	Observation
1	0.00	MH	Start node, manhole, reference: 04
2	0.00	WL	Water level, 5% of the vertical dimension
3	49.60	MHF	Finish node, manhole, reference: 05

PLR:	05X	Upstream Node:	05
Inspection Direction:	Downstream	Downstream Node:	06
Inspected Length:	8.00 m	Dia/Height:	600 mm
Total Length:	20.00 m	Material:	Concrete

No.	m+	Code	Observation
1	0.00	MH	Start node, manhole, reference: 05
2	0.00	WL	Water level, 5% of the vertical dimension
3	6.50	WL	Water level, 15% of the vertical dimension
4	7.60	WL	Water level, 30% of the vertical dimension
5	8.00	MCBR	Pipe material changes to brick at this point
6	8.00	SC	Pipe size changes, new size(s), 600mm high, 600mm wide
7	8.00	SA	Survey abandoned


PLR:	01X	Upstream Node:	01
Inspection Direction:	Upstream	Downstream Node:	02
Inspected Length:	31.10 m	Dia/Height:	600 mm
Total Length:	31.10 m	Material:	Concrete

No.	m+	Code	Observation
1	0.00	MH	Start node, manhole, reference: 02
2	0.00	WL	Water level, 5% of the vertical dimension
3	31.10	MHF	Finish node, manhole, reference: 01

Section Inspection - 06/11/2025 - 02X

Item No.	Insp. No.	Date	Time	Client's Job Ref	Weather	Pre Cleaned	PLR
2	1	06/11/25	19:14	Not Specified	No Rain Or Snow	No	02X
Operator		Vehicle		Camera	Preset Length	Legal Status	Alternative ID
JW		Not Specified		Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:	Littleborough	Inspection Direction:	Downstream	Upstream Node:	02
Road:	Hollingworth Rd	Inspected Length:	43.90 m	Upstream Pipe Depth:	
Location:	Footway	Total Length:	43.90 m	Downstream Node:	03
Surface Type:		Joint Length:		Downstream Pipe Depth:	
Use:	Surface water	Pipe Shape:	Circular		
Type of Pipe:	Gravity drain/sewer	Dia/Height:	600 mm		
Flow Control:	No flow control	Material:	Concrete		
Year Constructed:	Not Specified	Lining Type:	No Lining		
Inspection Purpose:	Routine inspection	Lining Material:	No Lining		
Comments:					
Recommendations:					

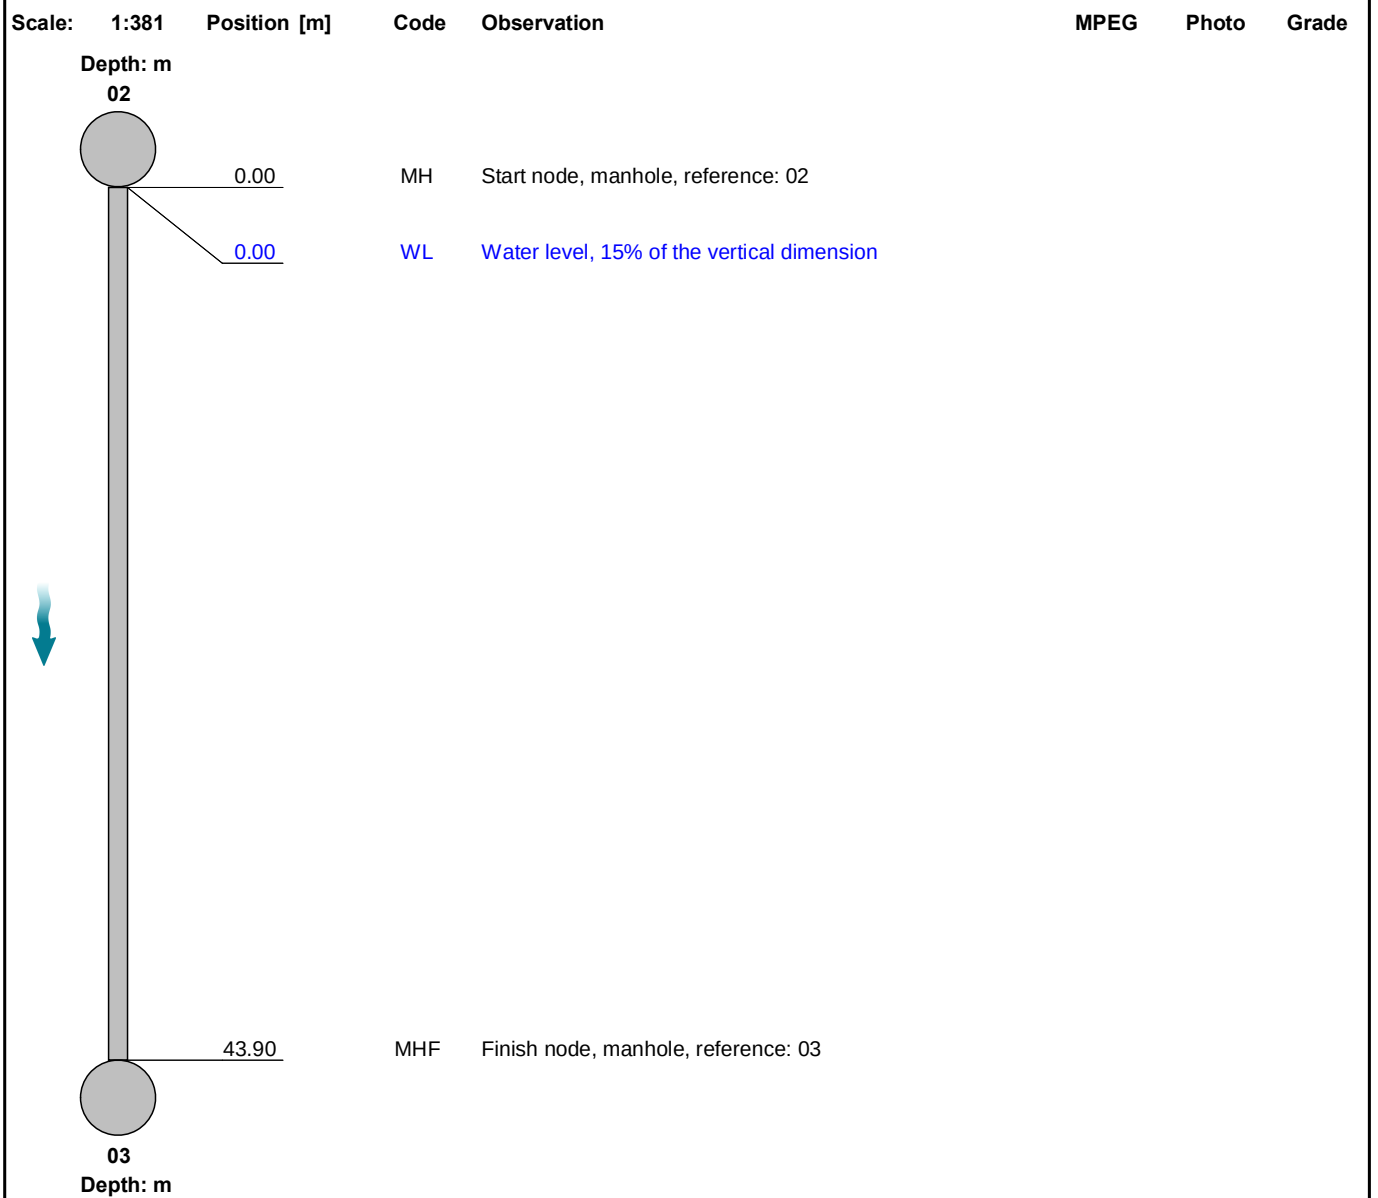


Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

Section Inspection - 06/11/2025 - 02X

Item No.	Insp. No.	Date	Time	Client's Job Ref	Weather	Pre Cleaned	PLR
3	1	06/11/25	19:20	Not Specified	No Rain Or Snow	No	02X
Operator		Vehicle		Camera	Preset Length	Legal Status	Alternative ID
JW		Not Specified		Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:	Littleborough	Inspection Direction:	Downstream	Upstream Node:	02
Road:	Hollingworth Rd	Inspected Length:	84.40 m	Upstream Pipe Depth:	
Location:	Footway	Total Length:	84.40 m	Downstream Node:	03
Surface Type:		Joint Length:		Downstream Pipe Depth:	
Use:	Culverted watercourse	Pipe Shape:	Circular		
Type of Pipe:	Gravity drain/sewer	Dia/Height:	600 mm		
Flow Control:	No flow control	Material:	Concrete		
Year Constructed:	Not Specified	Lining Type:	No Lining		
Inspection Purpose:	Routine inspection	Lining Material:	No Lining		
Comments:					
Recommendations:					

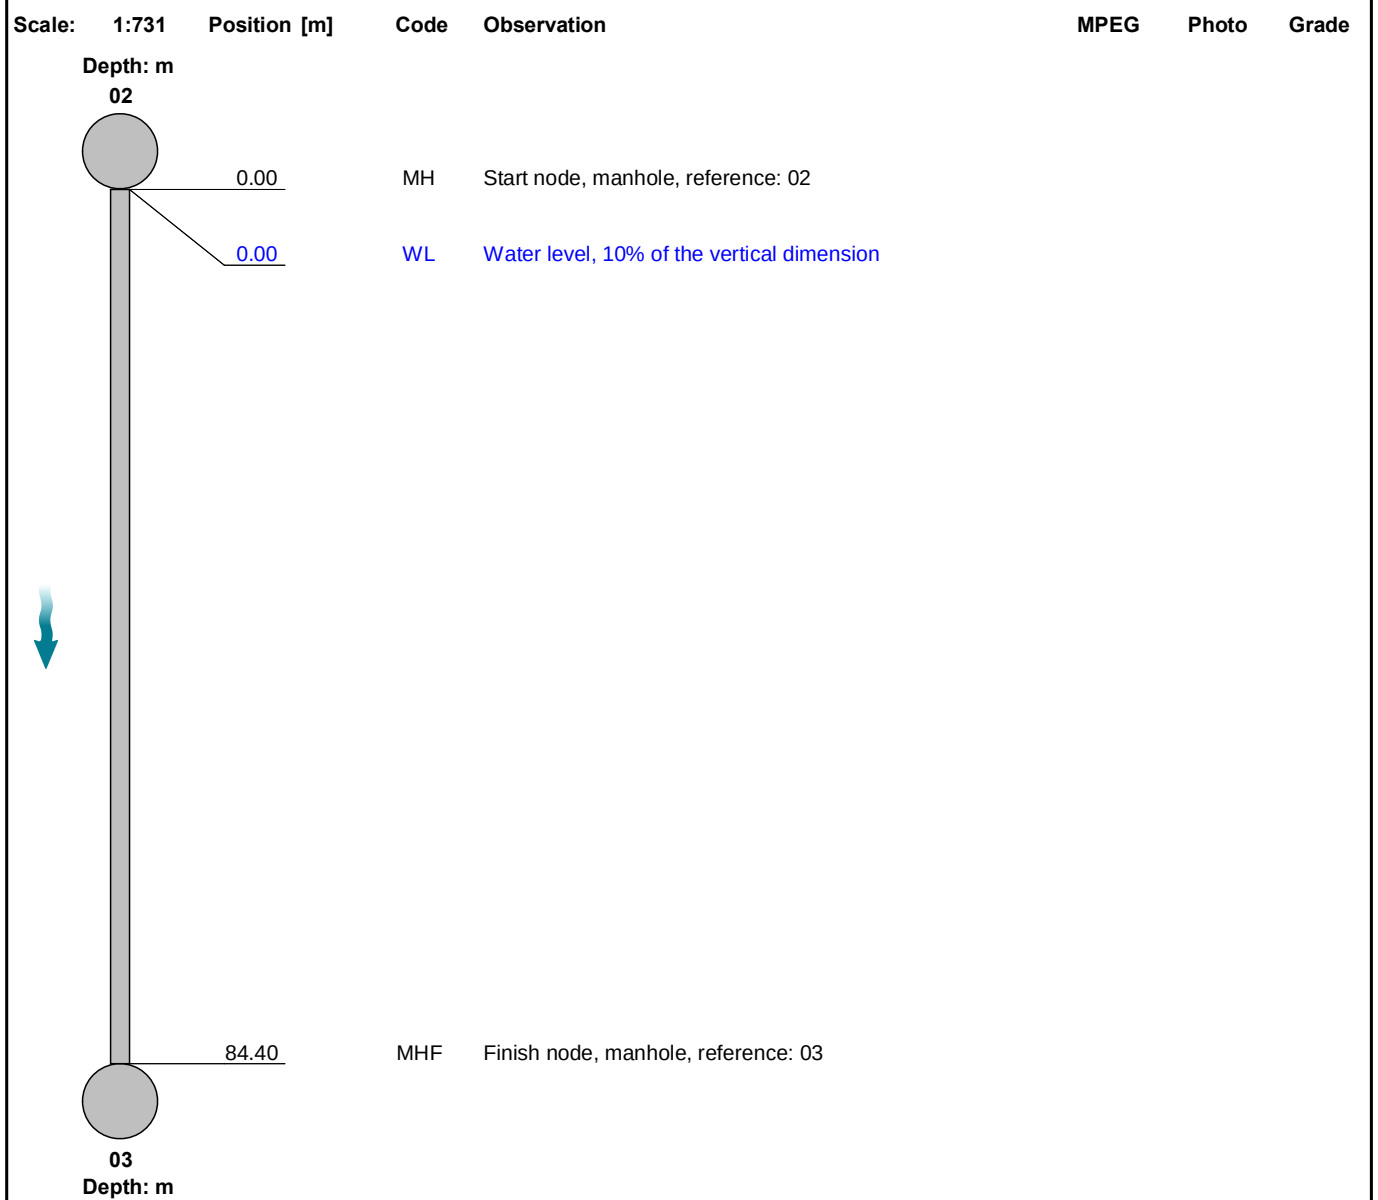


Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

Section Inspection - 06/11/2025 - 03X

Item No.	Insp. No.	Date	Time	Client's Job Ref	Weather	Pre Cleaned	PLR
4	1	06/11/25	19:28	Not Specified	No Rain Or Snow	No	03X
Operator		Vehicle		Camera	Preset Length	Legal Status	Alternative ID
JW		Not Specified		Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:	Littleborough	Inspection Direction:	Downstream	Upstream Node:	03
Road:	Hollingworth Rd	Inspected Length:	8.30 m	Upstream Pipe Depth:	
Location:	Footway	Total Length:	8.30 m	Downstream Node:	04
Surface Type:		Joint Length:		Downstream Pipe Depth:	
Use:	Culverted watercourse	Pipe Shape:	Circular		
Type of Pipe:	Gravity drain/sewer	Dia/Height:	600 mm		
Flow Control:	No flow control	Material:	Concrete		
Year Constructed:	Not Specified	Lining Type:	No Lining		
Inspection Purpose:	Routine inspection	Lining Material:	No Lining		
Comments:					
Recommendations:					

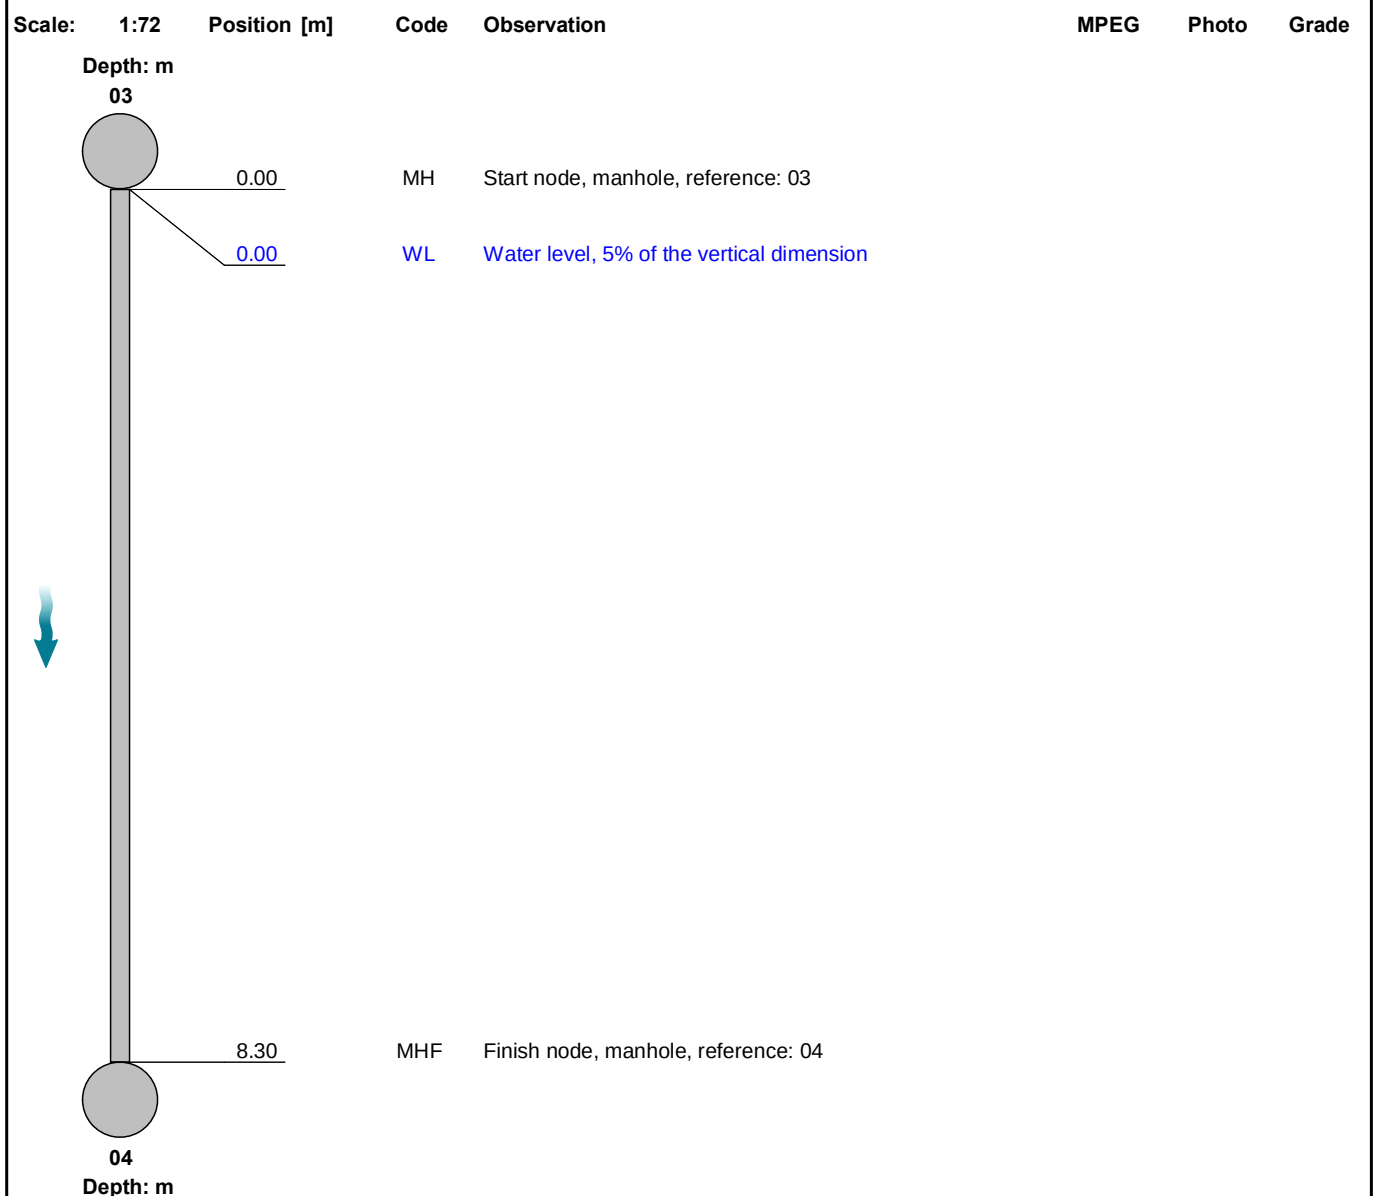


Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

Section Inspection - 06/11/2025 - 04X

Item No.	Insp. No.	Date	Time	Client's Job Ref	Weather	Pre Cleaned	PLR
5	1	06/11/25	19:32	Not Specified	No Rain Or Snow	No	04X
Operator		Vehicle		Camera	Preset Length	Legal Status	Alternative ID
JW		Not Specified		Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:	Littleborough	Inspection Direction:	Downstream	Upstream Node:	04
Road:	Hollingworth Rd	Inspected Length:	49.60 m	Upstream Pipe Depth:	
Location:	Footway	Total Length:	49.60 m	Downstream Node:	05
Surface Type:		Joint Length:		Downstream Pipe Depth:	
Use:	Culverted watercourse	Pipe Shape:	Circular		
Type of Pipe:	Gravity drain/sewer	Dia/Height:	600 mm		
Flow Control:	No flow control	Material:	Concrete		
Year Constructed:	Not Specified	Lining Type:	No Lining		
Inspection Purpose:	Routine inspection	Lining Material:	No Lining		
Comments:					
Recommendations:					

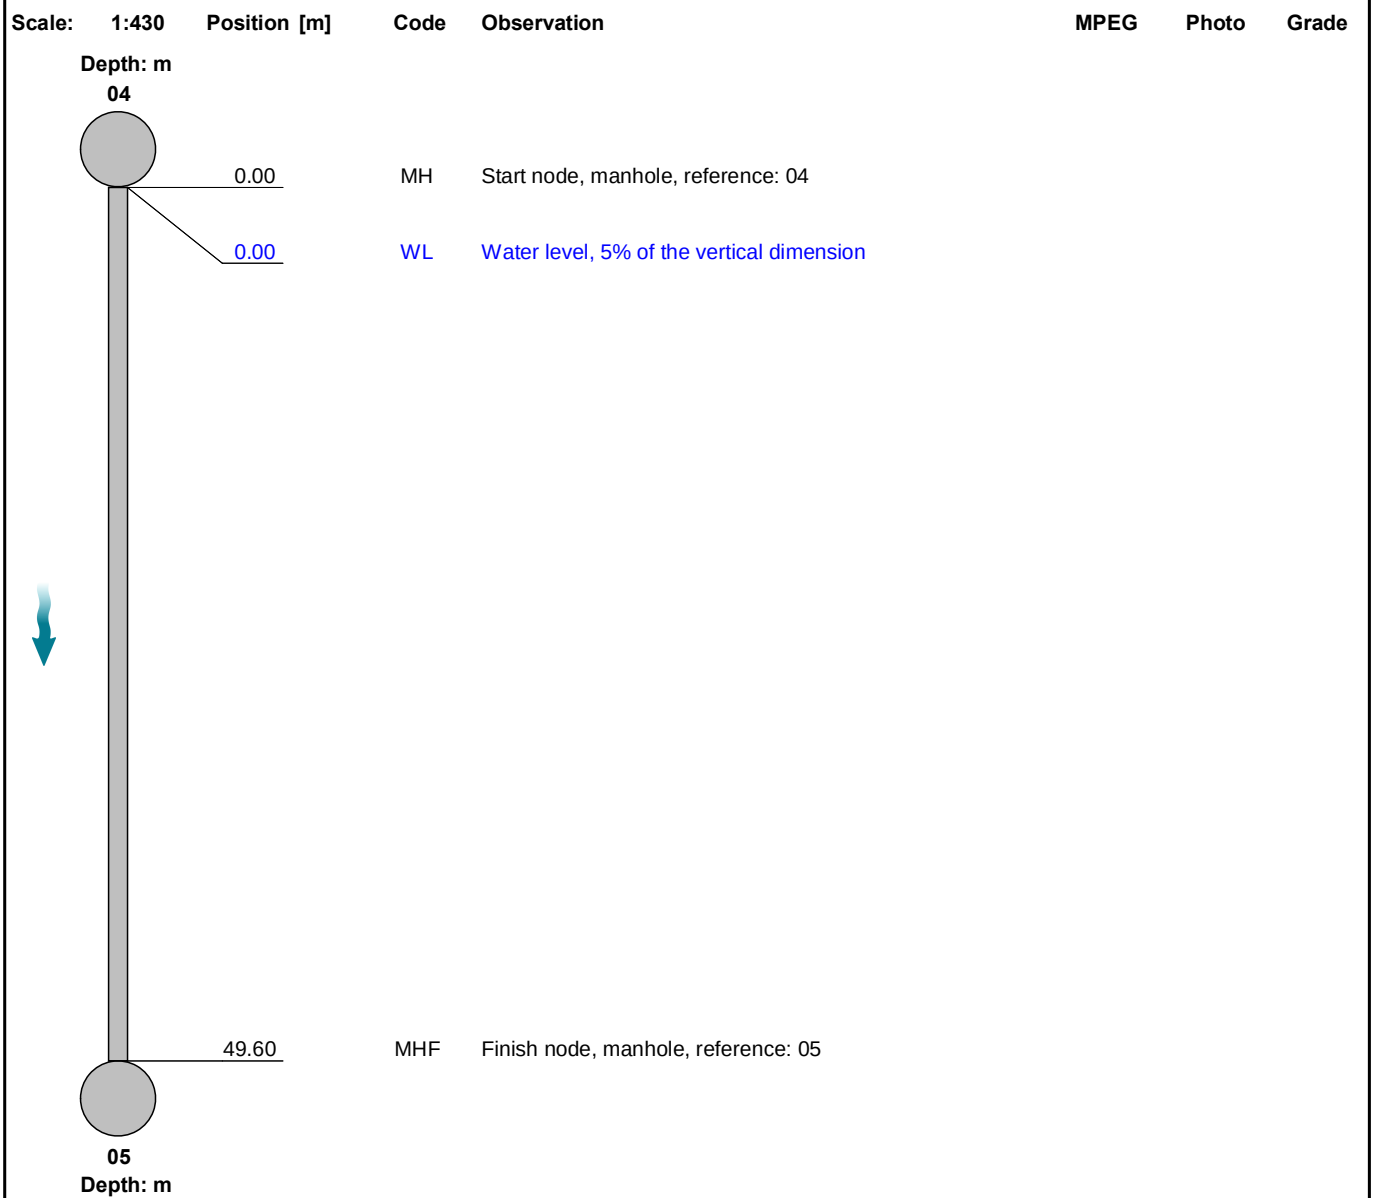


Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

Section Inspection - 06/11/2025 - 05X

Item No.	Insp. No.	Date	Time	Client's Job Ref	Weather	Pre Cleaned	PLR
6	1	06/11/25	19:37	Not Specified	No Rain Or Snow	No	05X
Operator		Vehicle		Camera	Preset Length	Legal Status	Alternative ID
JW		Not Specified		Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:	Littleborough	Inspection Direction:	Downstream	Upstream Node:	05
Road:	Hollingworth Rd	Inspected Length:	8.00 m	Upstream Pipe Depth:	
Location:	Footway	Total Length:	20.00 m	Downstream Node:	06
Surface Type:		Joint Length:		Downstream Pipe Depth:	
Use:	Culverted watercourse	Pipe Shape:	Circular		
Type of Pipe:	Gravity drain/sewer	Dia/Height:	600 mm		
Flow Control:	No flow control	Material:	Concrete		
Year Constructed:	Not Specified	Lining Type:	No Lining		
Inspection Purpose:	Routine inspection	Lining Material:	No Lining		
Comments:					
Recommendations:					

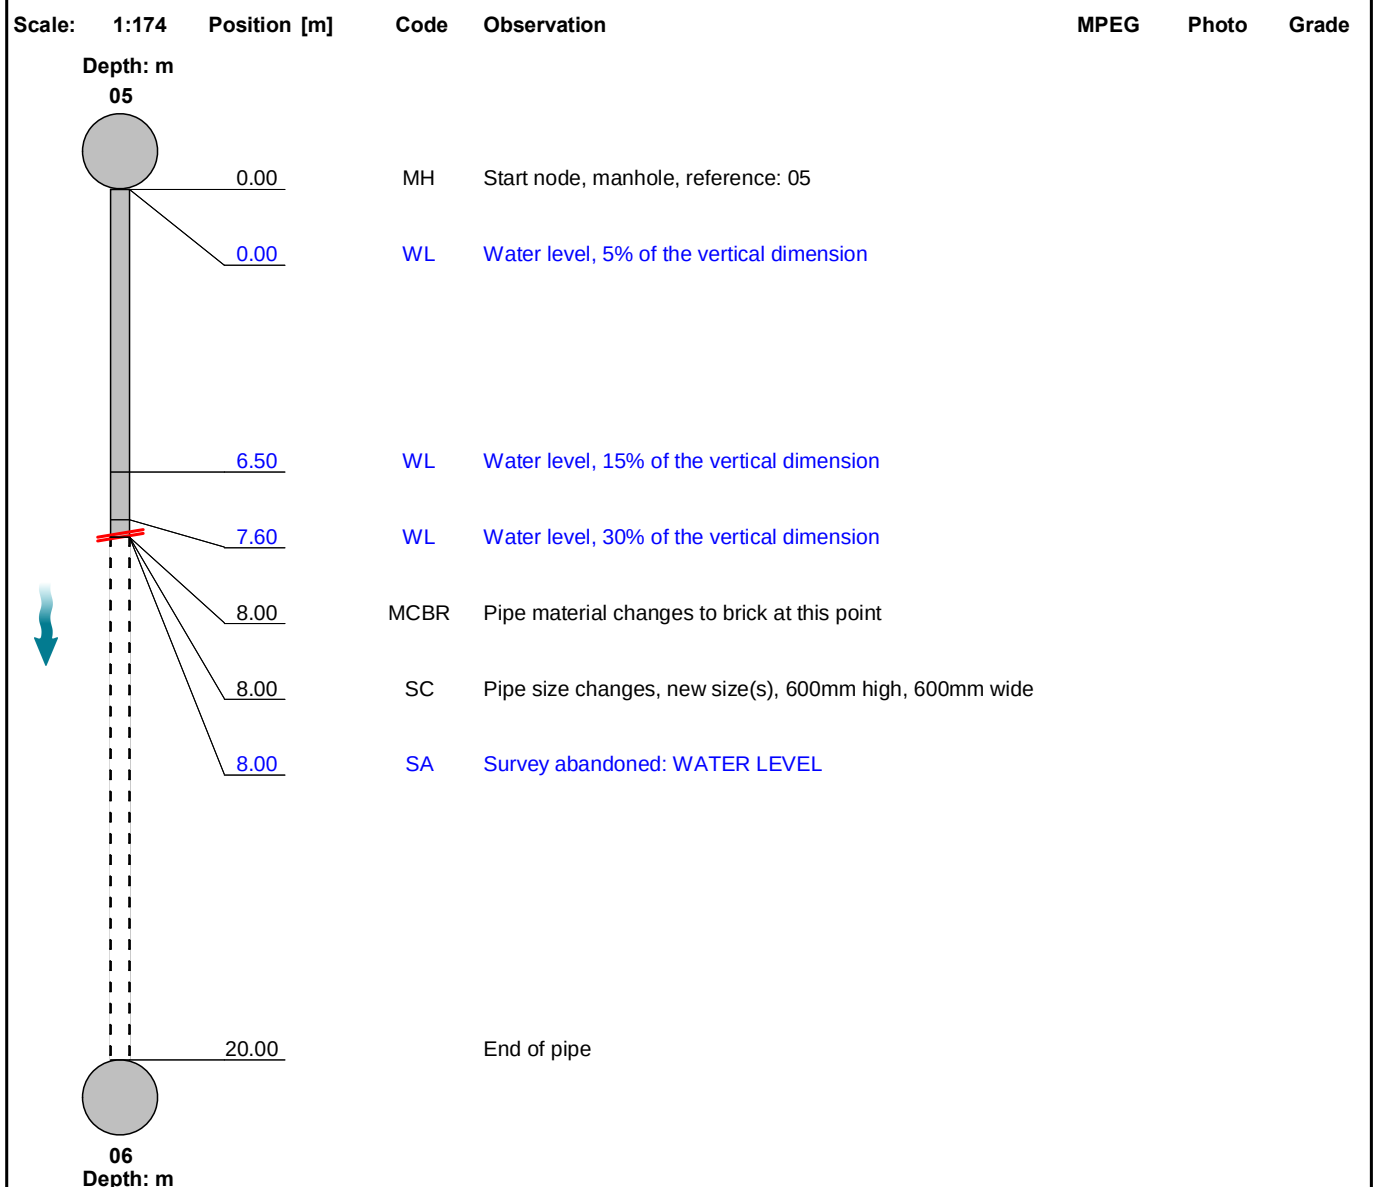


Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

Section Inspection - 11/11/2025 - 01X

Item No.	Insp. No.	Date	Time	Client's Job Ref	Weather	Pre Cleaned	PLR
7	1	11/11/25	9:40	Not Specified	No Rain Or Snow	No	01X
Operator		Vehicle		Camera	Preset Length	Legal Status	Alternative ID
JW		Not Specified		Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:	Littleborough	Inspection Direction:	Upstream	Upstream Node:	01
Road:	Hollingworth Rd	Inspected Length:	31.10 m	Upstream Pipe Depth:	
Location:	Footway	Total Length:	31.10 m	Downstream Node:	02
Surface Type:		Joint Length:		Downstream Pipe Depth:	
Use:	Culverted watercourse	Pipe Shape:	Circular		
Type of Pipe:	Gravity drain/sewer	Dia/Height:	600 mm		
Flow Control:	No flow control	Material:	Concrete		
Year Constructed:	Not Specified	Lining Type:	No Lining		
Inspection Purpose:	Routine inspection	Lining Material:	No Lining		
Comments:					
Recommendations:					

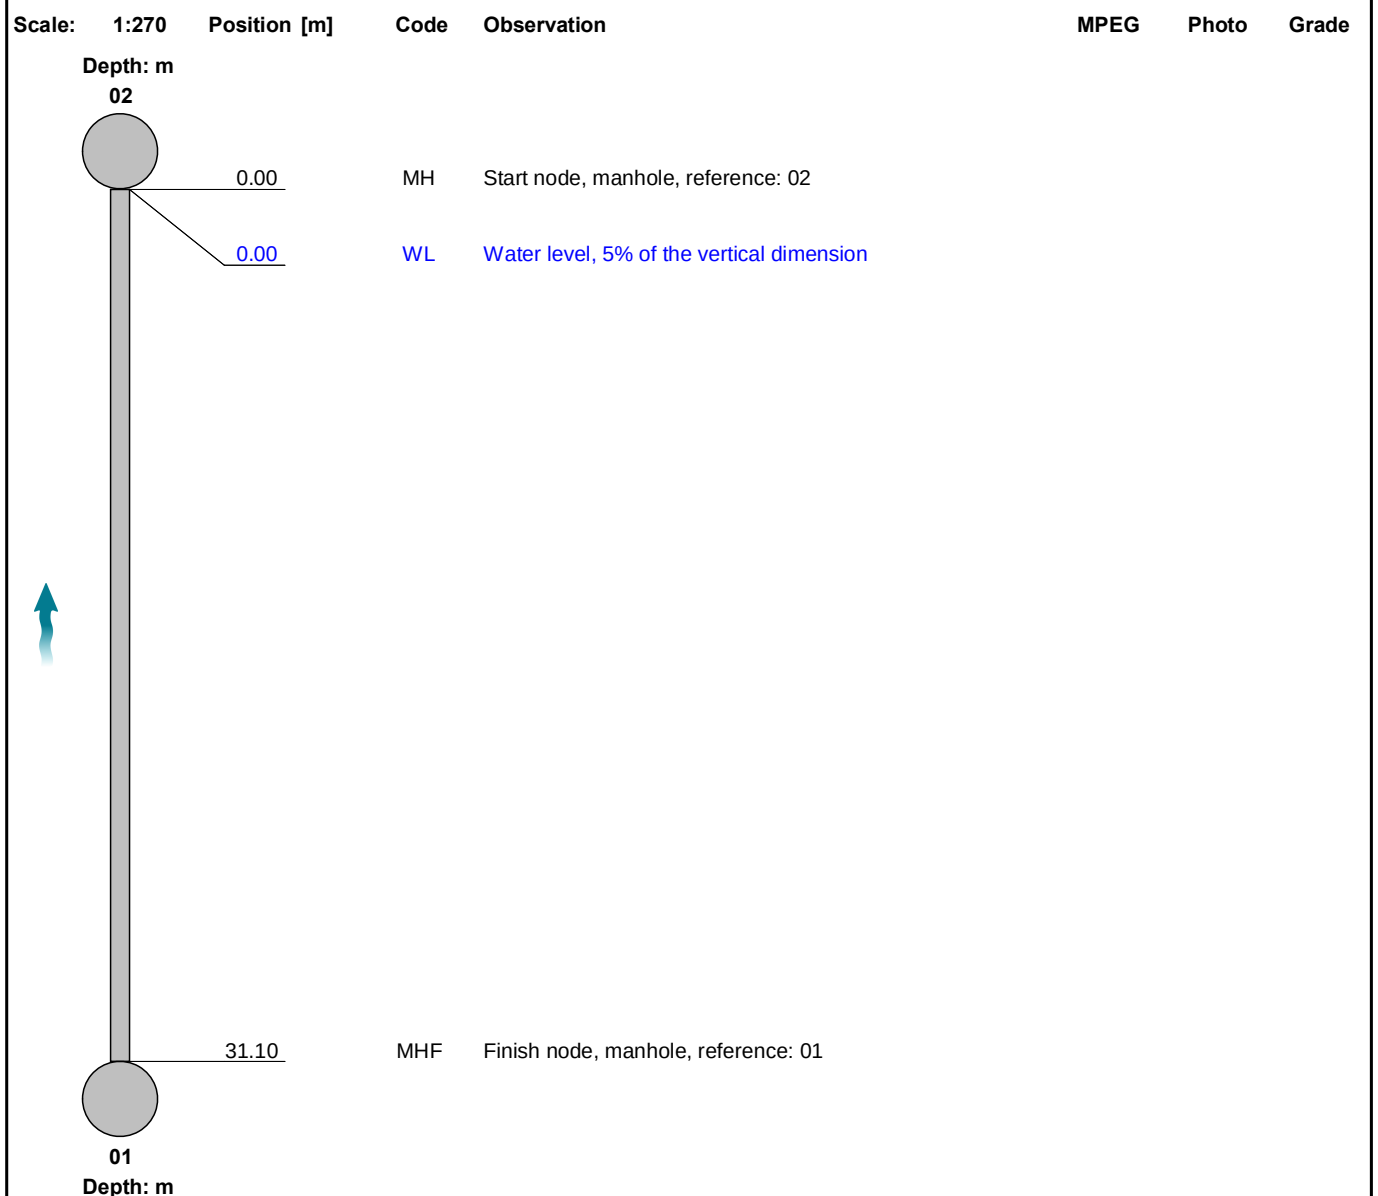

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0